

# **OIL ANALYSIS REPORT**

Sample Rating Trend



# JOHN DEERE 199 ADELAIDE AVE W

Component

**Diesel Engine** 

**DIESEL ENGINE OIL SAE 15W40 (--- GAL)** 

### Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a new component breaking in.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	AATIONI	ar a tha a d		Apr2023	late to mode	le la taran O
	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0787146		
Sample Date		Client Info		12 Apr 2023		
Machine Age	hrs	Client Info		157		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Fuel		WC Method	>2.1	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>51	1		
Chromium	ppm	ASTM D5185(m)	>11	0		
Nickel	ppm	ASTM D5185(m)	>5	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	<1		
Aluminum	ppm	ASTM D5185(m)	>31	<1		
Lead	ppm	ASTM D5185(m)	>26	<1		
Copper	ppm	ASTM D5185(m)	>26	1		
Tin	ppm	ASTM D5185(m)	>4	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	8		
Barium	ppm	ASTM D5185(m)	10	<1		
Molybdenum	ppm	ASTM D5185(m)	100	45		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	450	635		
Calcium	ppm	ASTM D5185(m)	3000	1471		
Phosphorus	ppm	ASTM D5185(m)	1150	948		
Zinc	ppm	ASTM D5185(m)	1350	1105		
Sulfur	ppm	ASTM D5185(m)	4250	2740		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>22	6		
Sodium	ppm	ASTM D5185(m)	>158	2		
Potassium	ppm	ASTM D5185(m)	>20	<1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	4.7		
Sulfation	Abs/.1mm	ASTM D7415*	>30	16.9		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	11.3		



## **OIL ANALYSIS REPORT**

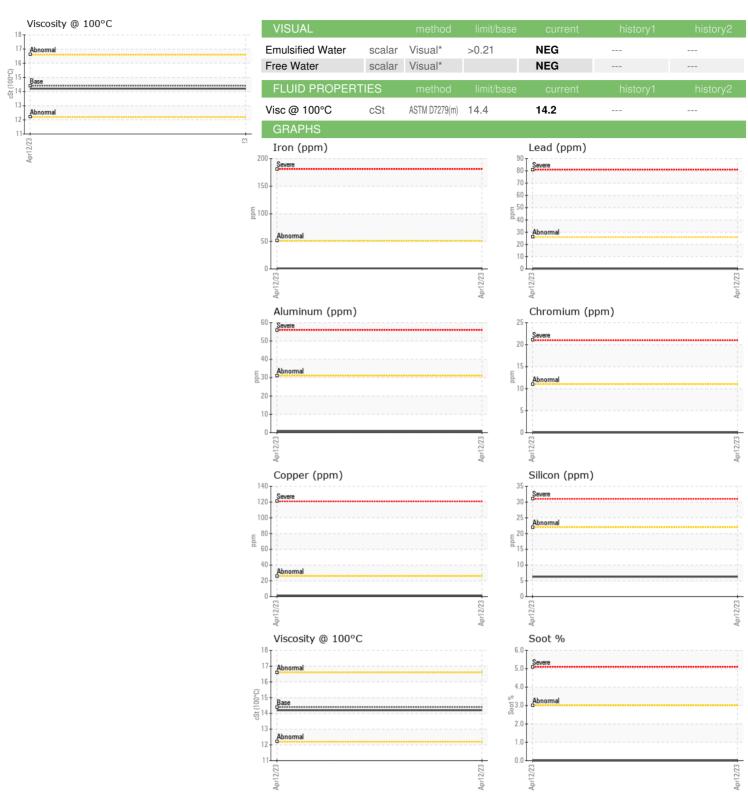



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: WC0787146 : 02588466 : 5657532

Received : 12 Oct 2023 Diagnosed : 12 Oct 2023 Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

GenWorx Power Systems Inc.

785 Westney Road, Unit 4 Ajax, ON

CA Contact: M Hamta

mhamta@genworx.ca T:

F: