




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
CATERPILLAR 140M GRD300
 Component
Right Tandem
 Fluid
MOBIL 10W (--- GAL)

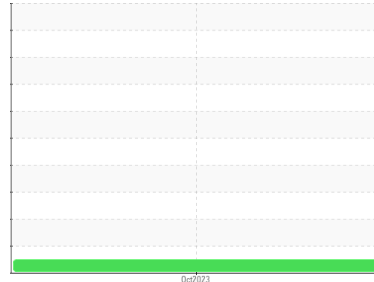

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0861392	---	---
Sample Date	Client Info		01 Oct 2023	---	---
Machine Age	hrs	Client Info	10597	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Not Chngd	---	---
Sample Status			NORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>425	54	---
Chromium	ppm	ASTM D5185(m)	>5	0	---
Nickel	ppm	ASTM D5185(m)	>5	<1	---
Titanium	ppm	ASTM D5185(m)		0	---
Silver	ppm	ASTM D5185(m)		<1	---
Aluminum	ppm	ASTM D5185(m)	>5	<1	---
Lead	ppm	ASTM D5185(m)		0	---
Copper	ppm	ASTM D5185(m)	>8	<1	---
Tin	ppm	ASTM D5185(m)		0	---
Antimony	ppm	ASTM D5185(m)	>5	0	---
Vanadium	ppm	ASTM D5185(m)		0	---
Beryllium	ppm	ASTM D5185(m)		0	---
Cadmium	ppm	ASTM D5185(m)		0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		3	---
Barium	ppm	ASTM D5185(m)		<1	---
Molybdenum	ppm	ASTM D5185(m)		<1	---
Manganese	ppm	ASTM D5185(m)		<1	---
Magnesium	ppm	ASTM D5185(m)		902	---
Calcium	ppm	ASTM D5185(m)		1207	---
Phosphorus	ppm	ASTM D5185(m)		1128	---
Zinc	ppm	ASTM D5185(m)		1292	---
Sulfur	ppm	ASTM D5185(m)		3155	---
Lithium	ppm	ASTM D5185(m)		<1	---

CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	6	---
Sodium	ppm	ASTM D5185(m)		<1	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---
Free Water	scalar	Visual*		NEG	---











OIL ANALYSIS REPORT

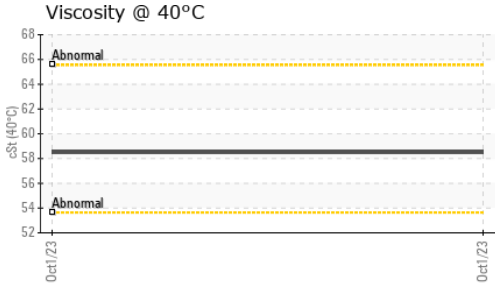

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		58.5	---	---

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image

GRAPHS

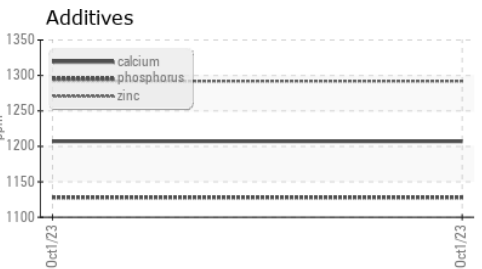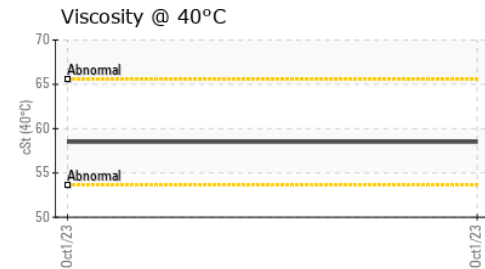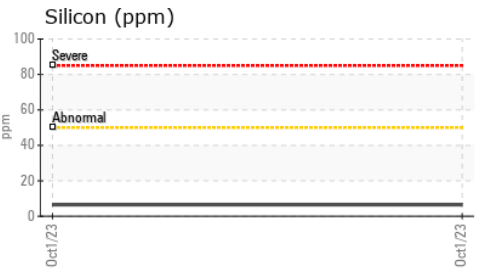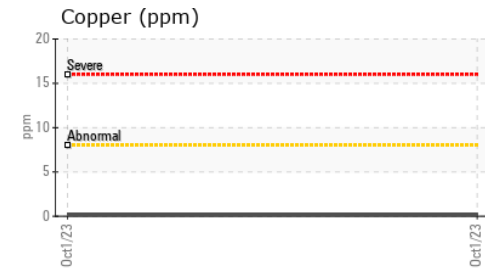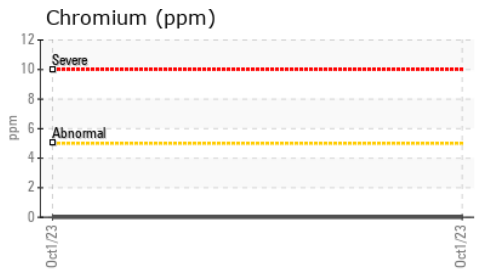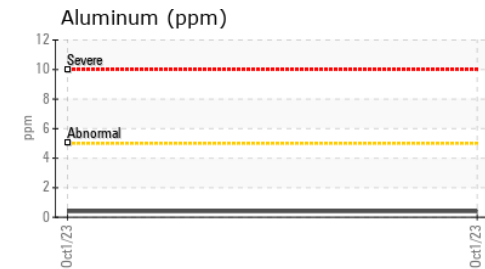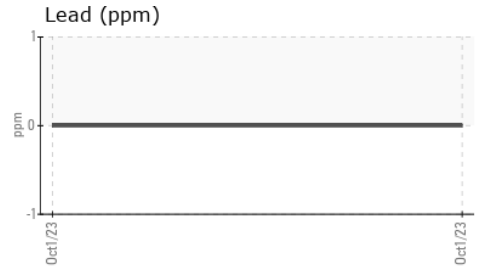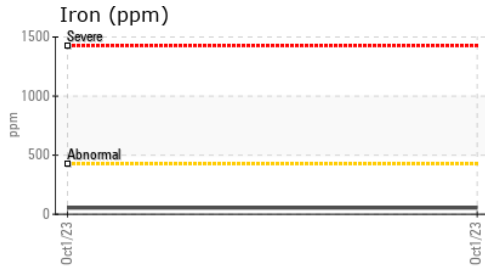

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0861392
Lab Number : 02588675
Unique Number : 5657741
Test Package : MOB 1

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1
 Contact: Mitch Lamontagne
 AEM_KL_macassaoilsampleresults@agnicoeagle.com
 T: (705)567-5208
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.