


OIL ANALYSIS REPORT

Autoneun - A09100 A2310054

Component **Hydraulic System**

AW HYDRAULIC OIL ISO 46 (--- GAL)

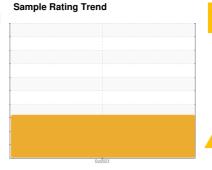



DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample.

Wear

Copper and iron ppm levels are noted.

Contamination

Silicon ppm levels are notably high.

Fluid Condition

{not applicable}

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Batch #		Client Info		2023 10 0040		
Machine ID		Client Info		A2310054		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		10/10/2023		
Sample Number		Client Info		E30000502		
Sample Date		Client Info		10 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		un a tha a al	line it /le e e e		la: atam d	history O
		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>20	<u> 11</u>		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>10	<1		
Lead	ppm	ASTM D5185(m)	>20	8		
Copper	ppm	ASTM D5185(m)	>20	<u> </u>		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	1		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	25	8		
Calcium	ppm	ASTM D5185(m)	200	33		
Phosphorus	ppm	ASTM D5185(m)	300	438		
Zinc	ppm	ASTM D5185(m)	370	432		
Sulfur	ppm	ASTM D5185(m)	2500	1659		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<u></u> 41		
Sodium	ppm	ASTM D5185(m)		1		
				_		


Potassium

ppm

ASTM D5185(m) >20



OIL ANALYSIS REPORT

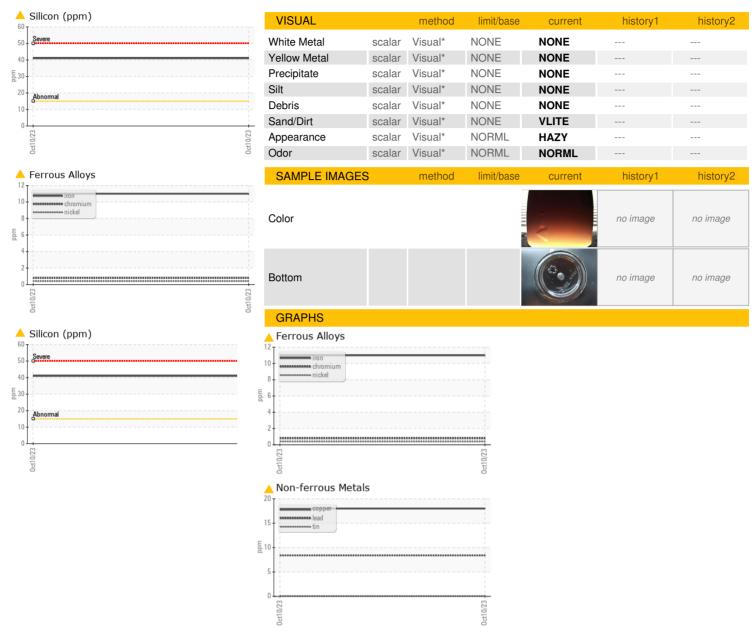



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : E30000502 : 02588780

: 5657846 Test Package : TEST (Additional Tests: ICP)

Validity of results and interpretation are based on the sample and information as supplied.

Received Diagnosed Diagnostician : Tatiana Sorkina

: 12 Oct 2023 : 17 Oct 2023

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Environmental 360 Solutions Ltd. 640 Victoria Street Cobourg, ON CA K9A 5H5 Contact: Aylwin Lee aylwinlee@e360s.ca T: (905)372-2251 F: (905)373-4950