



PROBLEM SUMMARY

Sample Rating Trend



ISO




Machine Id
BU114

Component
Hydraulic System


Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

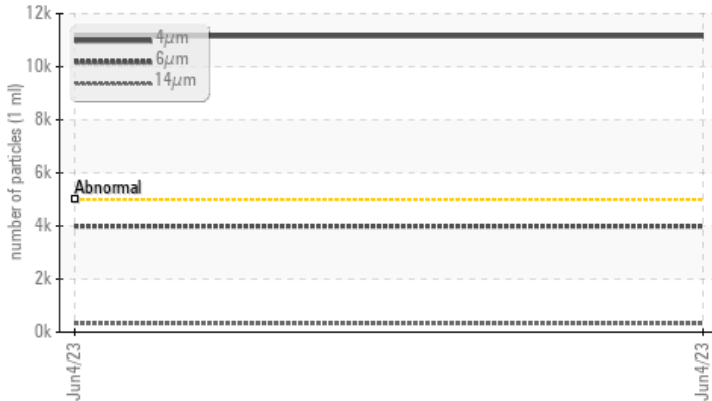

Non-ferrous Metals

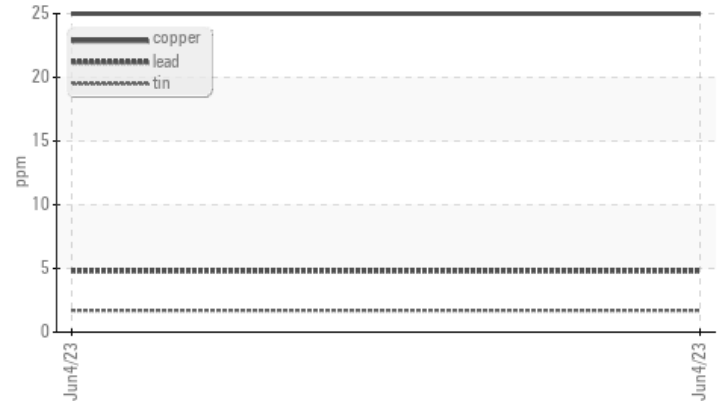

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	---	---
Particles >4µm	ASTM D7647	>5000	▲ 11154	---	---
Particles >6µm	ASTM D7647	>1300	▲ 3990	---	---
Particles >14µm	ASTM D7647	>160	▲ 323	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 21/19/16	---	---

Customer Id: ISLQUA
 Sample No.: WC0767898
 Lab Number: 02588906
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Alert	---	---	?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.
Information Required	---	---	?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



ISO



Machine Id
BU114

Component
Hydraulic System

Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0767898	---	---
Sample Date	Client Info		04 Jun 2023	---	---
Machine Age	yrs	Client Info	10	---	---
Oil Age	yrs	Client Info	5	---	---
Oil Changed	Client Info		Not Changed	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >20	6	---	---
Chromium	ppm	ASTM D5185(m) >20	0	---	---
Nickel	ppm	ASTM D5185(m) >20	<1	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m)	<1	---	---
Aluminum	ppm	ASTM D5185(m) >20	<1	---	---
Lead	ppm	ASTM D5185(m) >20	5	---	---
Copper	ppm	ASTM D5185(m) >20	25	---	---
Tin	ppm	ASTM D5185(m) >20	2	---	---
Antimony	ppm	ASTM D5185(m)	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 5	1	---	---
Barium	ppm	ASTM D5185(m) 5	<1	---	---
Molybdenum	ppm	ASTM D5185(m) 5	0	---	---
Manganese	ppm	ASTM D5185(m)	0	---	---
Magnesium	ppm	ASTM D5185(m) 25	3	---	---
Calcium	ppm	ASTM D5185(m) 200	47	---	---
Phosphorus	ppm	ASTM D5185(m) 300	345	---	---
Zinc	ppm	ASTM D5185(m) 370	431	---	---
Sulfur	ppm	ASTM D5185(m) 2500	1069	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	<1	---	---
Sodium	ppm	ASTM D5185(m)	1	---	---
Potassium	ppm	ASTM D5185(m) >20	<1	---	---

FLUID CLEANLINESS






	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 11154	---	---
Particles >6µm	ASTM D7647	>1300	▲ 3990	---	---
Particles >14µm	ASTM D7647	>160	▲ 323	---	---
Particles >21µm	ASTM D7647	>40	54	---	---
Particles >38µm	ASTM D7647	>10	3	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 21/19/16	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 0.57	0.41	---	---




OIL ANALYSIS REPORT

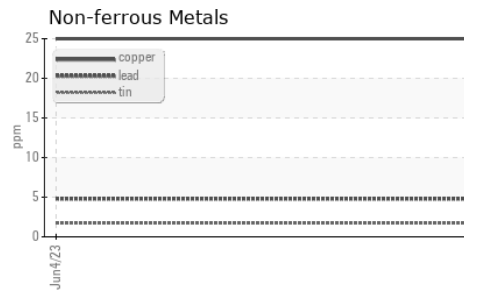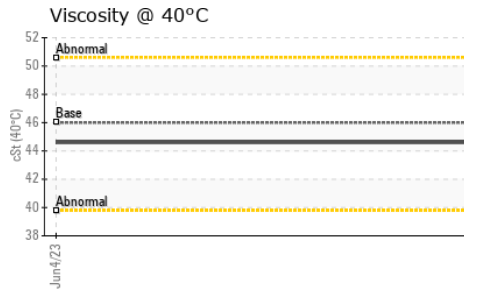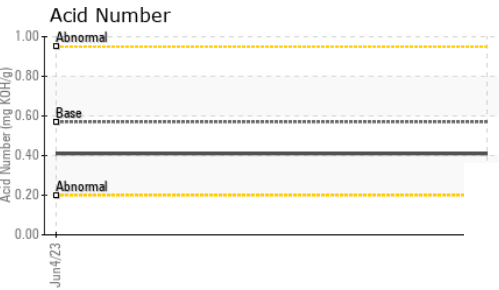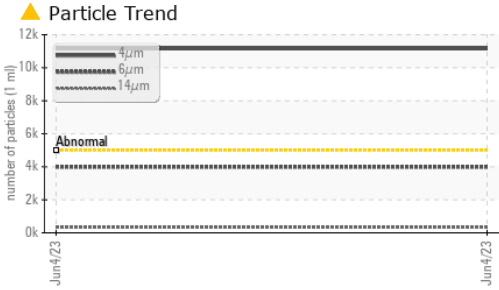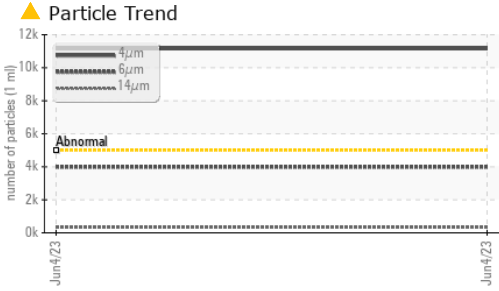





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.05	NEG	---
Free Water	scalar	Visual*		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	44.6	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

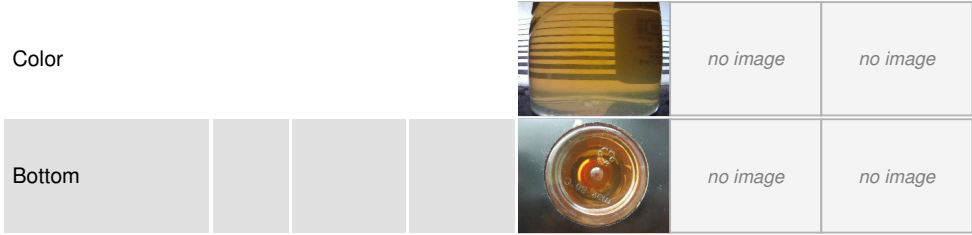

GRAPHS

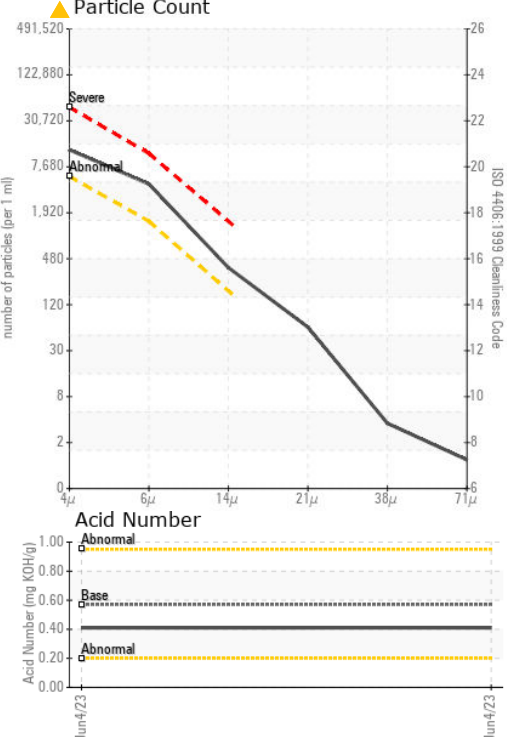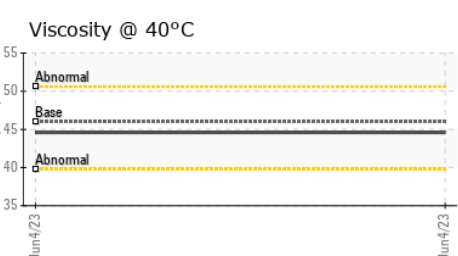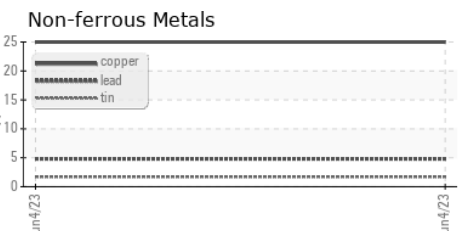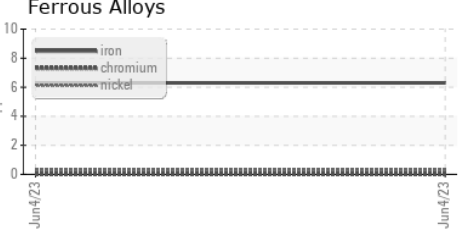

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0767898 **Received** : 13 Oct 2023
Lab Number : 02588906 **Diagnosed** : 16 Oct 2023
Unique Number : 5657972 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: TAN Man)

Island Hydrostatics Inc.
 1063 Centre Cres
 Qualicum Beach, BC
 CA V9K 2G6
 Contact: Justin Kovac
 islandhydrostatics@gmail.com
 T: (250)714-6174
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.