


OIL ANALYSIS REPORT

Gary Steacy - G02900 A2310084

Component **Transformer Oil**

NOT GIVEN (--- GAL)

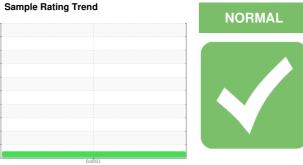

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

{not applicable}

Fluid Condition

{not applicable}

				0ct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Batch #		Client Info		2023 10 0260		
Machine ID		Client Info		A2310084		
Department		Client Info		Production		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		10/16/2023		
Sample Number		Client Info		E30000519		
Sample Date		Client Info		16 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>125	1		
Chromium	ppm	ASTM D5185(m)		0		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	<1		
Aluminum	ppm	ASTM D5185(m)	>5	0		
Lead	ppm	ASTM D5185(m)	>30	<1		
Copper	ppm	ASTM D5185(m)	>10	<1		
Tin	ppm	ASTM D5185(m)	>2	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		2		
Zinc	ppm	ASTM D5185(m)		1		
Sulfur	ppm	ASTM D5185(m)		1337		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	<1		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	0		

PCBs



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES	S	method	limit/base	current	history1	history2
Color				000519	no image	no image
Bottom				(nax 80 C)	no image	no image
GRAPHS						
Dielectric BDV Interfacial Tension						
8				1		
6			6	1		
4			(m) 4	†i		
0			<u>-</u> 2	†		
0			E 0	+		
-2			Interfacial Tension (mlVm)	+		
4						
-6 +			-6	1		
-8						
-10			-10			
Oct16/23			Oct16/23	Oct16/23		Oct16/23 -



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Unique Number : 5659224

: E30000519 : 02590158

Received Diagnosed

: 23 Oct 2023 Diagnostician : Tatiana Sorkina

: 18 Oct 2023

Test Package: TEST (Additional Tests: ICP, PCBTransformer) To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

640 Victoria Street Cobourg, ON CA K9A 5H5 Contact: Fred Kosseim

fkosseim@e360s.ca T: (905)372-2251 F: (905)372-1658