


# **OIL ANALYSIS REPORT**



**NORMAL** 

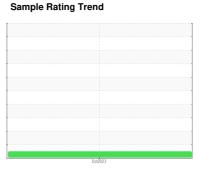

Machine Id **2354** 

Component **Natural Gas Engine** 

**VALVOLINE PREMIUM BLUE 9200 15W40 (** 

### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Metal levels are typical for a new component breaking in.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**

The condition of the oil is acceptable for the time in service.

( GAL)						
`		,		Oct2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0830206		
Sample Date		Client Info		16 Oct 2023		
Machine Age	kms	Client Info		7946		
Oil Age	kms	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>50	31		
Chromium	ppm	ASTM D5185(m)	>4	<1		
Nickel	ppm	ASTM D5185(m)	>2	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	<1		
Aluminum	ppm	ASTM D5185(m)	>9	3		
Lead	ppm	ASTM D5185(m)	>30	1		
Copper	ppm	ASTM D5185(m)	>35	14		
Tin	ppm	ASTM D5185(m)	>4	<1		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		18		
Barium	ppm	ASTM D5185(m)		2		
Molybdenum	ppm	ASTM D5185(m)		97		
Manganese	ppm	ASTM D5185(m)		9		
Magnesium	ppm	ASTM D5185(m)		590		
Calcium	ppm	ASTM D5185(m)		1164		
Phosphorus	ppm	ASTM D5185(m)		577		
Zinc	ppm	ASTM D5185(m)		644		
Sulfur	ppm	ASTM D5185(m)		1883		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>+100	38		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*		0		
Nitration	Abs/cm	ASTM D7624*	>20	7.4		
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.2		
FLUID DEGRADA	ATION _	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.4		
VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.1	NEG		
Free Water	scalar	Visual*		NEG		
	odaidi	rioddi				



## **OIL ANALYSIS REPORT**

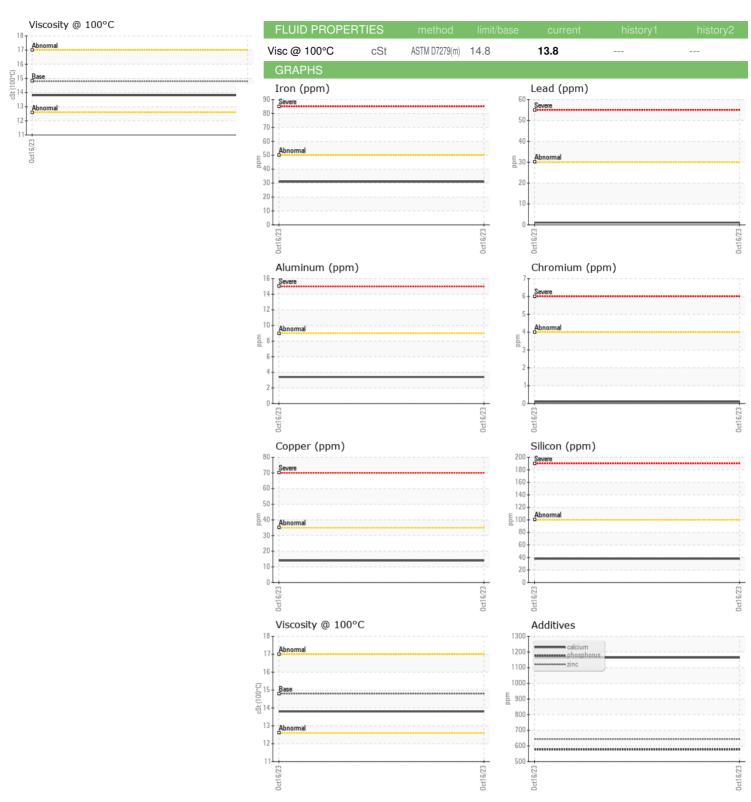



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0830206 : 02590916

: 5667995

Received Diagnosed

: 23 Oct 2023 : 23 Oct 2023 Diagnostician : Kevin Marson

CITY OF HAMILTON 2200 UPPER JAMES,, MOUNTAIN TRANSIT STOREROOM MOUNT HOPE, ON

CA LOR 1W0 Contact: Ron Skinner ron.skinner@hamilton.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (905)679-4502