

# **OIL ANALYSIS REPORT**

Sample Rating Trend

**NORMAL** 

# 401 CRANE MAIN HOIST W

Component

Gearbox

SHELL OMALA S4 GX 220 (--- GAL)

#### Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0811782		
Sample Date		Client Info		13 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>200	5		
Chromium	ppm	ASTM D5185(m)	>15	0		
Nickel	ppm	ASTM D5185(m)	>15	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>100	<1		
Copper	ppm	ASTM D5185(m)	>200	<1		
Tin	ppm	ASTM D5185(m)	>25	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		23		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		4		
Phosphorus	ppm	ASTM D5185(m)		428		
Zinc	ppm	ASTM D5185(m)		4		
Sulfur	ppm	ASTM D5185(m)		5067		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	8		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D974\*

0.92



## **OIL ANALYSIS REPORT**

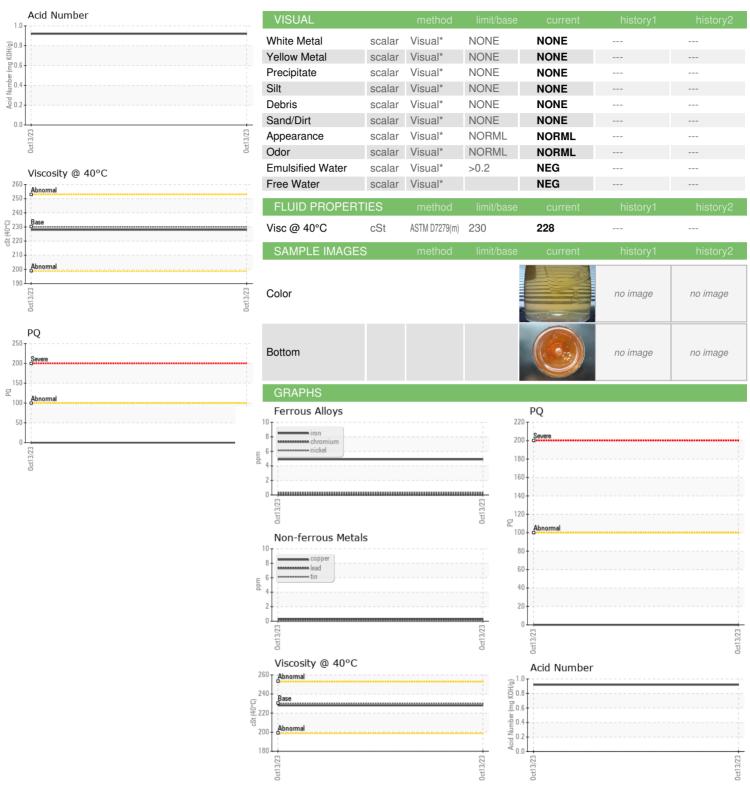



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0811782

: 02591184 : 5668263 Test Package : IND 2

Received Diagnosed Diagnostician

: 23 Oct 2023 : 25 Oct 2023 : Wes Davis

Vale - Copper Cliff Smelter COPPER CLIFF SMELTER WAREHOUSE, 155 BALSAM ST.

COPPER CLIFF, ON CA P0M 1N0 Contact: Andy Kozachanko

andrew.kozachanko@vale.com T: (705)682-6687

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (705)682-6939