

## **OIL ANALYSIS REPORT**

## Area EZE Flow - E02800 Machine Id A2310118 Component

Hydraulic System Fluid AW HYDRAULIC OIL ISO 46 (--- GAL)

## DIAGNOSIS


Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

**Contamination** {not applicable}

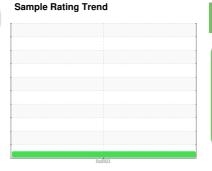



NORMAL

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Batch #		Client Info		2023 09 0660		
Machine ID		Client Info		A2310118		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		10/20/2023		
Sample Number		Client Info		E30000570		
Sample Date		Client Info		19 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	6		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>10	1		
Lead	ppm	ASTM D5185(m)	>20	2		
Copper	ppm	ASTM D5185(m)	>20	6		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	2		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	25	55		
Calcium	ppm	ASTM D5185(m)	200	78		
Phosphorus	ppm	ASTM D5185(m)	300	449		
Zinc	ppm	ASTM D5185(m)	370	515		
Sulfur	ppm	ASTM D5185(m)	2500	1568		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	3		
Sodium	ppm	ASTM D5185(m)		3		

Potassium

ppm

ASTM D5185(m) >20

<1



## **OIL ANALYSIS REPORT**

bpm

bpm

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	WGOIL		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES	S	method	limit/base	current	history1	history2
Color	5	method			no image	no image
Bottom					no image	no image
GRAPHS						
Ferrous Alloys			0et19/23			
Non-ferrous Metal	s					
2			0et19/23			

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Environmental 360 Solutions Ltd. Laboratory CALA Sample No. : E30000570 Received : 23 Oct 2023 640 Victoria Street Cobourg, ON Lab Number : 02591212 Diagnosed : 25 Oct 2023 ISO 17025:2017 Accredited Laboratory Unique Number : 5668291 Diagnostician : Tatiana Sorkina CA K9A 5H5 Test Package : TEST (Additional Tests: ICP) Contact: Fred Kosseim To discuss this sample report, contact Customer Service at 1-905-372-2251. fkosseim@e360s.ca Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: (905)372-2251 Validity of results and interpretation are based on the sample and information as supplied. F: (905)372-1658

Contact/Location: Fred Kosseim - CHECOB