




OIL ANALYSIS REPORT

Sample Rating Trend

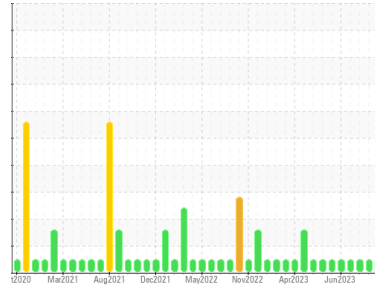

NORMAL



Area
ENGINE ROOM FLOOR
 Machine Id
22-BE-6464C-01 PROPELLER SHAFT BEARING (S/N Maint Plan 22480)
 Component
Port Bearing
 Fluid
MOBIL MOBILGARD 412 (12 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PP	PP	PP
Sample Date	Client Info	19 Sep 2023	11 Sep 2023	23 Aug 2023
Machine Age	days	Client Info	0	0
Oil Age	days	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2
PQ	ASTM D8184*	0	0	0
Iron	ppm	ASTM D5185(m) >20	3	3
Chromium	ppm	ASTM D5185(m) >2	0	0
Nickel	ppm	ASTM D5185(m) >2	0	0
Titanium	ppm	ASTM D5185(m)	0	0
Silver	ppm	ASTM D5185(m)	<1	<1
Aluminum	ppm	ASTM D5185(m) >5	2	1
Lead	ppm	ASTM D5185(m) >25	0	<1
Copper	ppm	ASTM D5185(m) >5	<1	<1
Tin	ppm	ASTM D5185(m) >15	2	1
Antimony	ppm	ASTM D5185(m)	0	0
Vanadium	ppm	ASTM D5185(m)	0	0
Beryllium	ppm	ASTM D5185(m)	0	0
Cadmium	ppm	ASTM D5185(m)	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	2	2
Barium	ppm	ASTM D5185(m) 0	<1	<1
Molybdenum	ppm	ASTM D5185(m) 0	0	0
Manganese	ppm	ASTM D5185(m) 0	0	0
Magnesium	ppm	ASTM D5185(m) 18	21	22
Calcium	ppm	ASTM D5185(m) 6350	6274	6420
Phosphorus	ppm	ASTM D5185(m) 200	210	219
Zinc	ppm	ASTM D5185(m) 380	354	372
Sulfur	ppm	ASTM D5185(m) 6950	4966	5460
Lithium	ppm	ASTM D5185(m)	<1	<1

CONTAMINANTS




method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	10	11
Sodium	ppm	ASTM D5185(m)	1	1
Potassium	ppm	ASTM D5185(m) >20	0	<1

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 1.25	1.50	1.58




OIL ANALYSIS REPORT

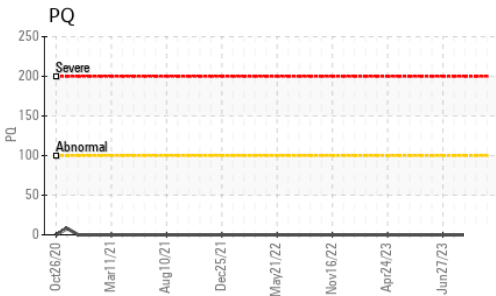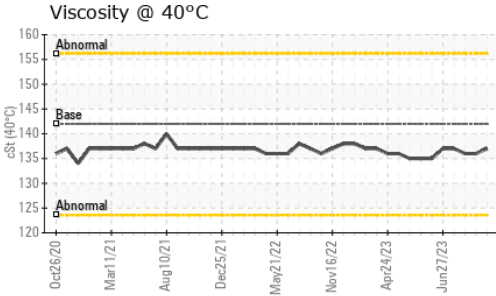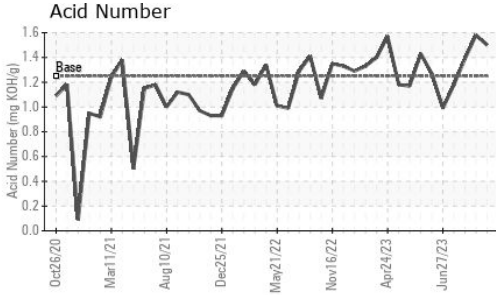






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	VLITE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	142	137	136

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

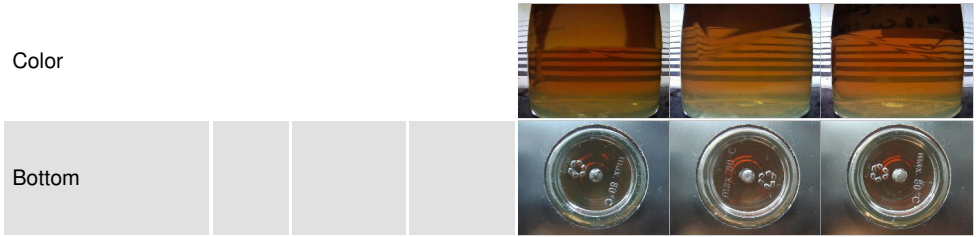

GRAPHS

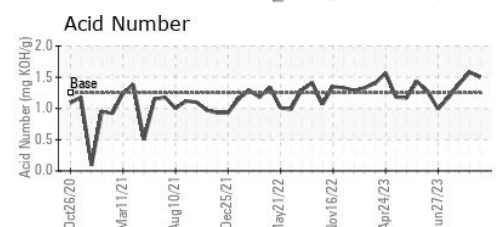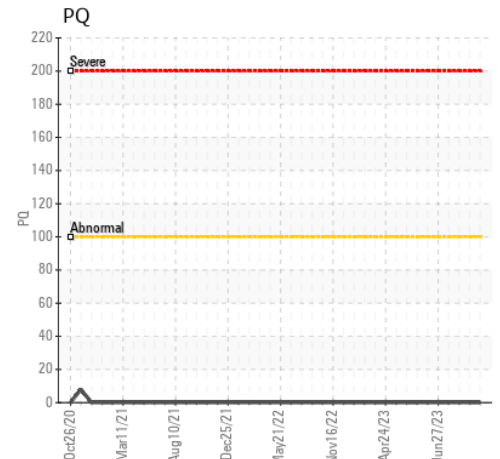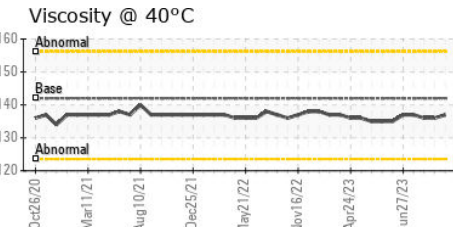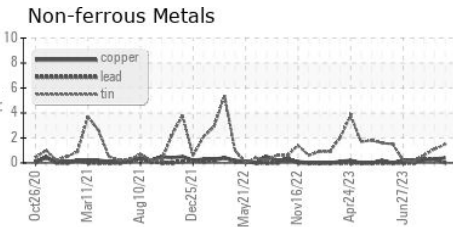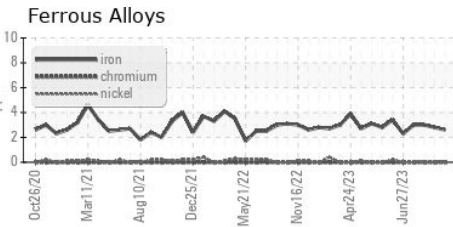

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 HUSKY SEA ROSE /AKER SOLUTIONS
Sample No. : PP **Received** : 26 Oct 2023
Lab Number : 02592124 **Diagnosed** : 27 Oct 2023
Unique Number : 5669203 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

PO BOX 20
 ST. JOHN'S, NL
 CA A1C 6C9
 Contact: Maintenance Supervisor
 maintsuper.searose@huskyenergy.ca
 T: x:
 F: x: