




PROBLEM SUMMARY

Sample Rating Trend

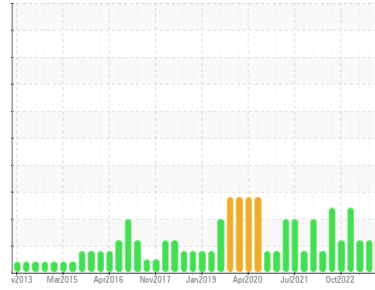


ISO



Area
SAB2
 Machine Id
SAB2 G19
 Component
Thrust Bearing
 Fluid
ESSO TERESSO ISO 46 (3182 LTR)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

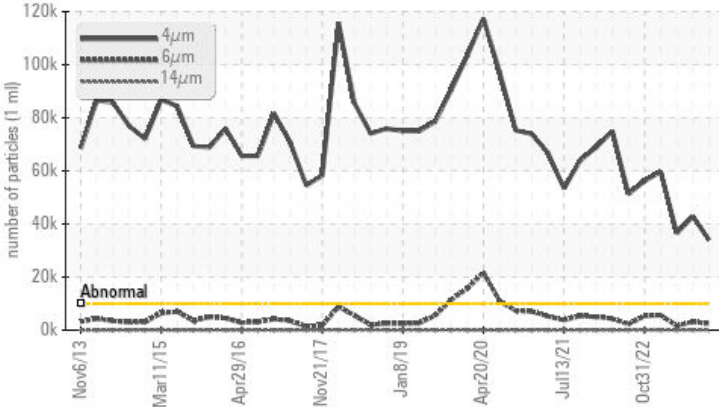


RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	ABNORMAL
Particles >4µm	ASTM D7647	>10000	▲ 33994	▲ 42855	▲ 36519
Particles >6µm	ASTM D7647	>1300	▲ 2452	▲ 3151	▲ 1626
Oil Cleanliness	ISO 4406 (c)	>20/17/14	▲ 22/18/11	▲ 23/19/12	▲ 22/18/10

PrtFilter



Customer Id: ONTQUE
 Sample No.: WC0858087
 Lab Number: 02592128
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Contact Required	---	---	?	Please contact your representative for information regarding the proper sampling kits for your service.
Alert	---	---	?	NOTE: We recommend using IND 3 test kits,

HISTORICAL DIAGNOSIS

31 Jul 2023 Diag: Kevin Marson

ISO



We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid. Component wear rates appear to be normal (unconfirmed). There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



05 Jun 2023 Diag: Kevin Marson

ISO



We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid. Component wear rates appear to be normal (unconfirmed). There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



26 Jan 2023 Diag: Kevin Marson

VISUAL METAL



We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid. Light concentration of visible metal present. Particles >4µm are abnormally high. Particles >6µm and oil cleanliness are abnormally high. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

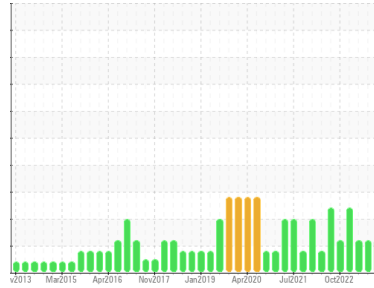

ISO



Area
SAB2
Machine Id
SAB2 G19

Component
Thrust Bearing
Fluid
ESSO TERESSO ISO 46 (3182 LTR)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear

Component wear rates appear to be normal (unconfirmed).

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Particle Filter (Magn: 100 x)



SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0858087	WC0830387	WC0780509
Sample Date	Client Info	25 Oct 2023	31 Jul 2023	05 Jun 2023
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2		
Iron	ppm	ASTM D5185(m)	>85	9	13	11
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>40	0	0	0
Lead	ppm	ASTM D5185(m)	>60	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>7	<1	<1	0
Tin	ppm	ASTM D5185(m)	>40	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

method	limit/base	current	history1	history2		
Boron	ppm	ASTM D5185(m)	0	<1	0	<1
Barium	ppm	ASTM D5185(m)		<1	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	<1	<1
Calcium	ppm	ASTM D5185(m)	0	0	<1	0
Phosphorus	ppm	ASTM D5185(m)	2.4	0	<1	0
Zinc	ppm	ASTM D5185(m)	0	<1	1	<1
Sulfur	ppm	ASTM D5185(m)		1070	1173	1051
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS

method	limit/base	current	history1	history2		
Silicon	ppm	ASTM D5185(m)	>20	2	2	2
Sodium	ppm	ASTM D5185(m)		<1	0	0
Potassium	ppm	ASTM D5185(m)	>20	0	<1	0

FLUID CLEANLINESS





method	limit/base	current	history1	history2	
Particles >4µm	ASTM D7647	>10000	▲ 33994	▲ 42855	▲ 36519
Particles >6µm	ASTM D7647	>1300	▲ 2452	▲ 3151	▲ 1626
Particles >14µm	ASTM D7647	>160	12	23	10
Particles >21µm	ASTM D7647	>40	3	5	3
Particles >38µm	ASTM D7647	>10	0	0	0
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>20/17/14	▲ 22/18/11	▲ 23/19/12	▲ 22/18/10

FLUID DEGRADATION

method	limit/base	current	history1	history2		
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.07	0.03	0.04



OIL ANALYSIS REPORT

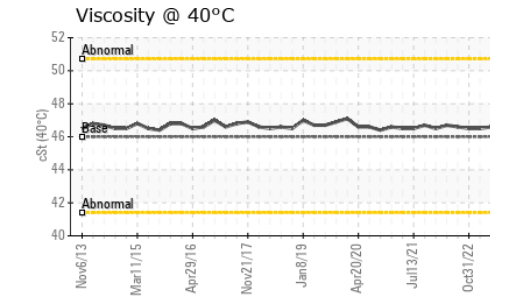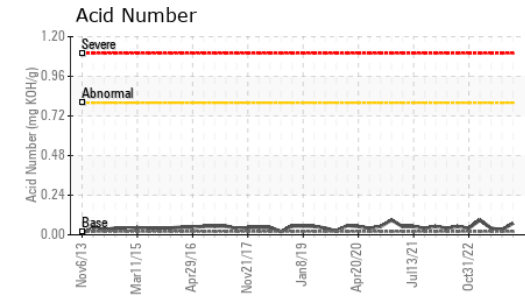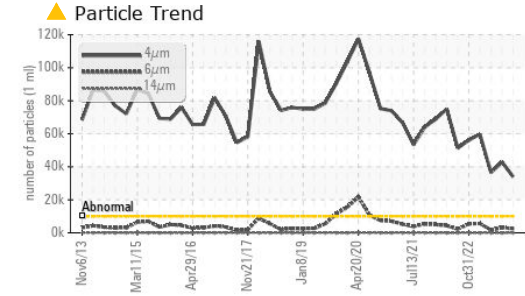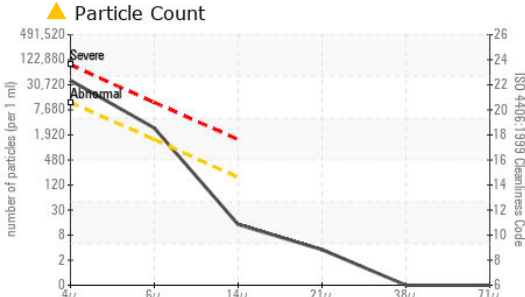

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0858087
Lab Number : 02592128
Unique Number : 5669207
Test Package : IND 2 (Additional Tests: BottomAnalysis, FilterPatch, PrtFilter, TAN Ma


Ontario Power Generation
 NIAGARA PLANT GROUP, 14000 NIAGARA PKWY
 NIAGARA ON THE LAKE, ON
 CA L0S 1J0
 Contact: Alex Courtemanche
 alex.courtemanche@opg.com
 T: (905)357-0322
 F: (905)357-6558

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	VLITE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	46.5	46.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

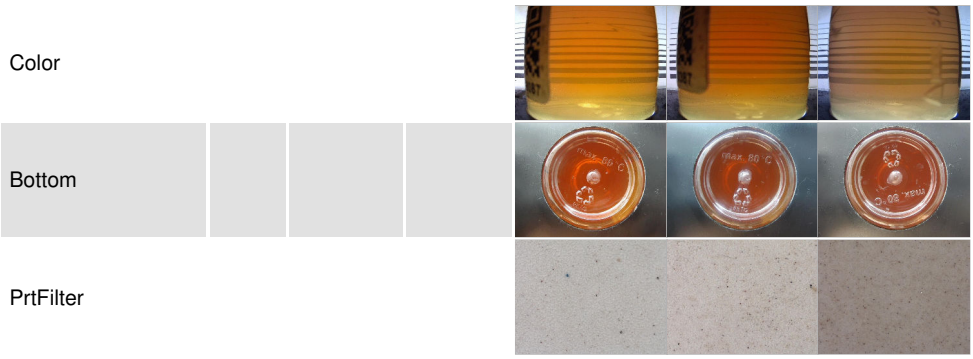

GRAPHS

