


OIL ANALYSIS REPORT



CATERPILLAR 320F EXC02

Component Left Planetary

MOBIL MOBILUBE HI

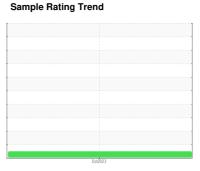



Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

D 80W90 (GAL))			Oct2023		
SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0861388		
Sample Date		Client Info		16 Oct 2023		
Machine Age	hrs	Client Info		5767		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	176		
Chromium	ppm	ASTM D5185(m)	>10	1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	6		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)		<1		
Tin		ASTM D5185(m)	>10	0		
	ppm	. ,		0		
Antimony	ppm	ASTM D5185(m)	>0	-		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		14		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		62		
Phosphorus	ppm	ASTM D5185(m)		420		
Zinc	ppm	ASTM D5185(m)		34		
Sulfur	ppm	ASTM D5185(m)		16490		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	26		
Sodium	ppm	ASTM D5185(m)		3		
Potassium	ppm	ASTM D5185(m)	>20	6		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*	~U.L	NEG		
16:33:17) Rov: 1	Juliai	Vioudi	Co		Mitch Lamontac	



OIL ANALYSIS REPORT

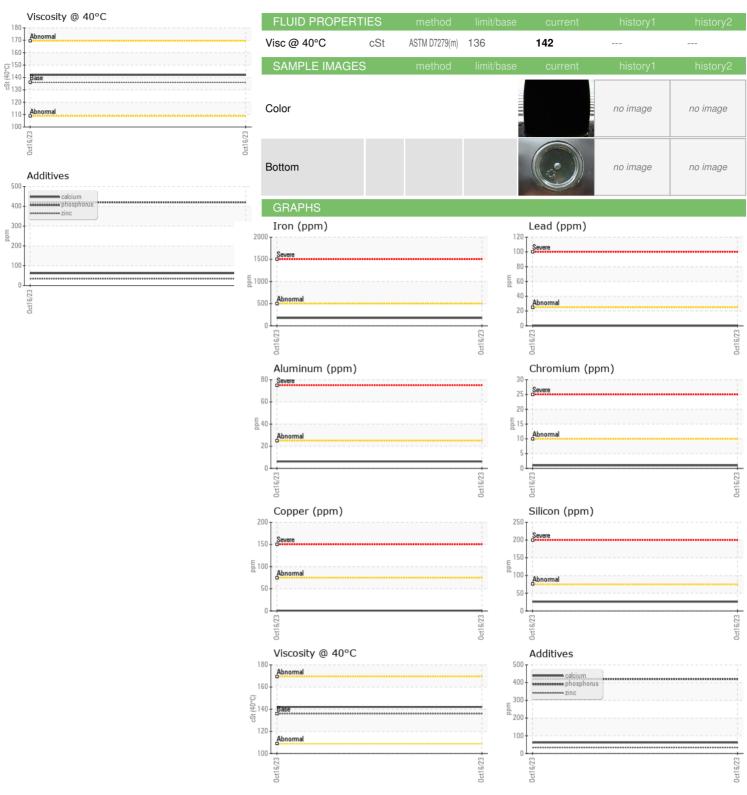



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: 5669311

: WC0861388 : 02592232

Received Diagnosed Diagnostician Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: 26 Oct 2023 : 26 Oct 2023 : Wes Davis

Agnico Eagle Canada 1350 Government Rd. W, MACASSA COMPLEX Kirkland Lake, ON CA P2N 3J1

Contact: Mitch Lamontagne AEM_KL_macassaoilsampleresults@agnicoeagle.com T: (705)567-5208

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (705)567-5221