




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

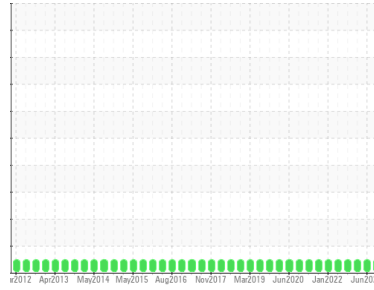

Area
Powerhouse Machine Room
 Machine Id
LBHPU1 (FAB30498)
 Component
Hydraulic System
 Fluid
SHELL TELLUS 32 (228 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC	WC	WC
Sample Date	Client Info	29 Oct 2023	26 Jun 2023	02 Feb 2023
Machine Age	mths Client Info	0	0	0
Oil Age	mths Client Info	0	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185(m) >20	0	<1	<1
Chromium	ppm ASTM D5185(m) >20	0	0	0
Nickel	ppm ASTM D5185(m) >20	<1	<1	0
Titanium	ppm ASTM D5185(m)	0	0	0
Silver	ppm ASTM D5185(m)	<1	<1	0
Aluminum	ppm ASTM D5185(m) >20	0	<1	0
Lead	ppm ASTM D5185(m) >20	<1	0	<1
Copper	ppm ASTM D5185(m) >20	<1	<1	0
Tin	ppm ASTM D5185(m) >20	0	0	0
Antimony	ppm ASTM D5185(m)	0	0	<1
Vanadium	ppm ASTM D5185(m)	0	0	0
Beryllium	ppm ASTM D5185(m)	0	0	0
Cadmium	ppm ASTM D5185(m)	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185(m)	<1	<1	<1
Barium	ppm ASTM D5185(m)	<1	0	0
Molybdenum	ppm ASTM D5185(m)	0	0	0
Manganese	ppm ASTM D5185(m)	0	0	0
Magnesium	ppm ASTM D5185(m) 11	11	12	12
Calcium	ppm ASTM D5185(m) 35	37	38	38
Phosphorus	ppm ASTM D5185(m) 259	239	251	262
Zinc	ppm ASTM D5185(m) 277	260	261	262
Sulfur	ppm ASTM D5185(m) 1865	763	747	768
Lithium	ppm ASTM D5185(m)	<1	<1	<1

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185(m) >15	4	4	4
Sodium	ppm ASTM D5185(m)	<1	0	<1
Potassium	ppm ASTM D5185(m) >20	0	<1	<1

FLUID CLEANLINESS





method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >5000	174	117	76
Particles >6µm	ASTM D7647 >1300	67	47	27
Particles >14µm	ASTM D7647 >160	10	8	2
Particles >21µm	ASTM D7647 >40	4	3	0
Particles >38µm	ASTM D7647 >10	2	0	0
Particles >71µm	ASTM D7647 >3	1	0	0
Oil Cleanliness	ISO 4406 (c) >19/17/14	15/13/10	14/13/10	13/12/9

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D974* 0.32	0.25	0.66	0.26




OIL ANALYSIS REPORT

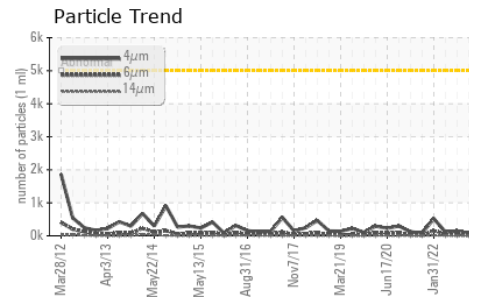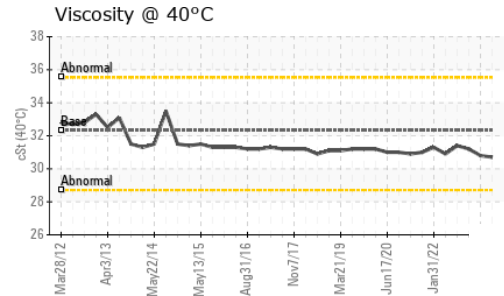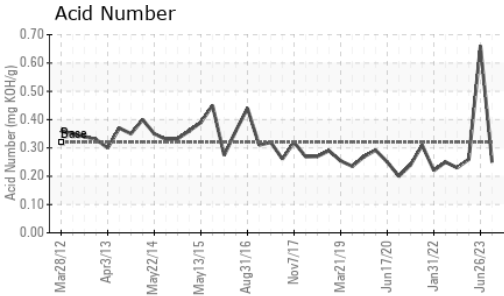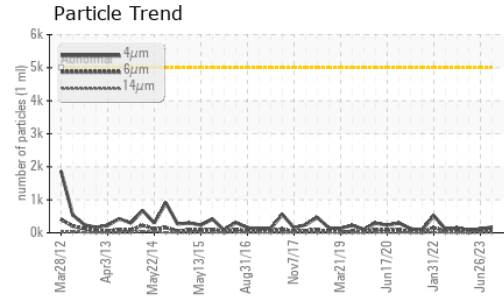






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	32.32	30.7	30.8

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

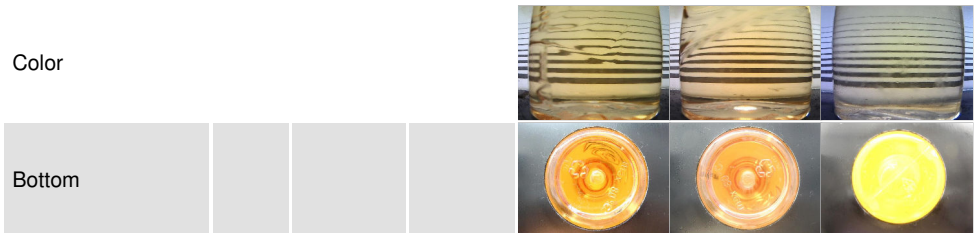

GRAPHS

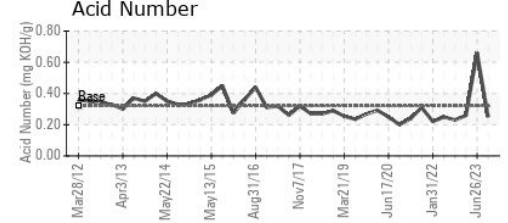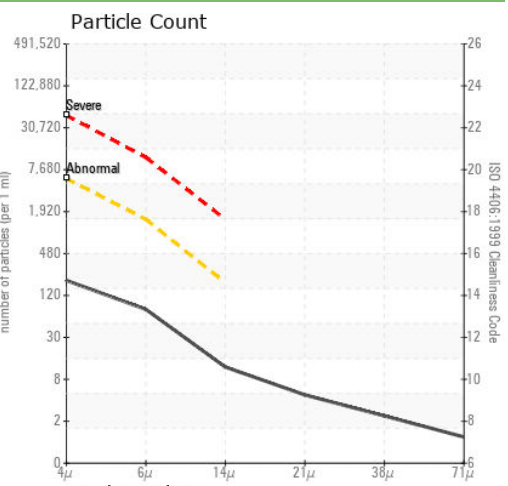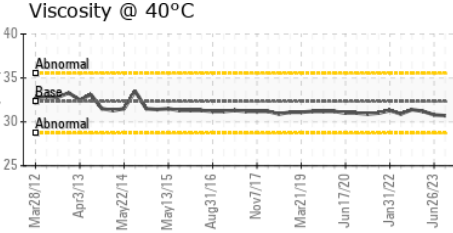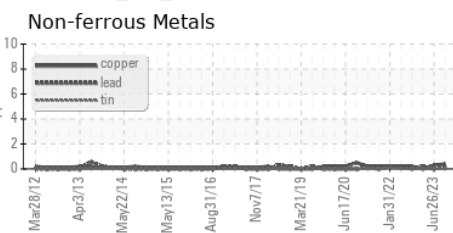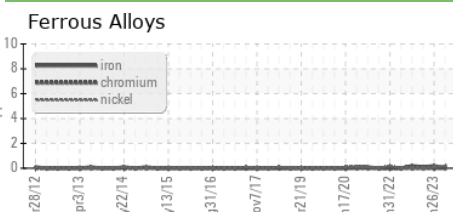

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC
Lab Number : 02592664
Unique Number : 5669743
Test Package : IND 2
Received : 30 Oct 2023
Diagnosed : 31 Oct 2023
Diagnostician : Wes Davis

Bear Creek (Regional Power)
 2557 Miles Rd.
 Roberts Creek, BC
 CA V0N 2W4
 Contact: James Florence
 jfflorance@cclinfrastructure.com
 T: (604)741-8188
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.