




PROBLEM SUMMARY

Sample Rating Trend

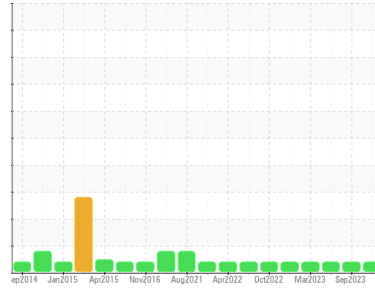


VISCOSITY



Area
Compressors [412866967]
 Machine Id
FES #1 Ammonia Compressor - Maximo #3547 1000042102
 Component
Screw Compressor
 Fluid
MOBIL GARGOYLE ARTIC 300 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Viscosity @ 40°C

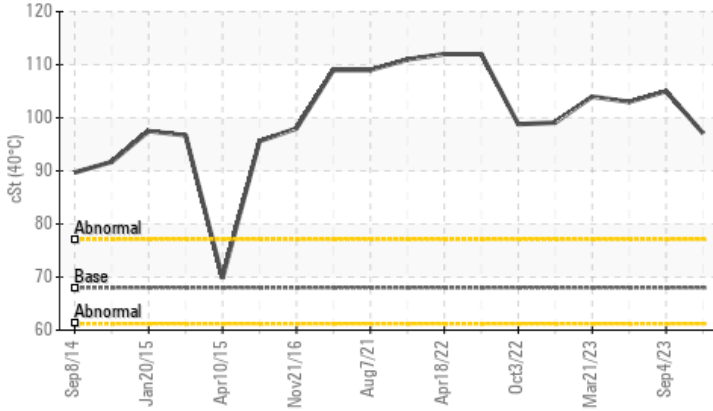

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Visc @ 40°C	cSt	ASTM D7279(m)	68.0	▲ 97.1	▲ 105	▲ 103

Customer Id: CARGUE
 Sample No.: WC0882223
 Lab Number: 02600978
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

04 Sep 2023 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



11 Jun 2023 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



21 Mar 2023 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

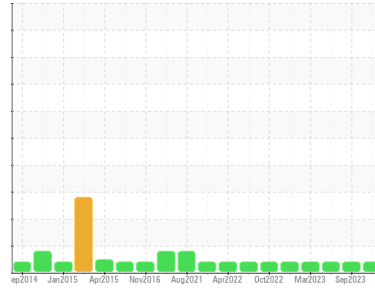

VISCOSITY



Area
Compressors [412866967]
 Machine Id
FES #1 Ammonia Compressor - Maximo #3547 1000042102
 Component
Screw Compressor
 Fluid
MOBIL GARGOYLE ARTIC 300 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0882223	WC0852626	WC0823719
Sample Date	Client Info		27 Nov 2023	04 Sep 2023	11 Jun 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m) >60	0	<1	<1
Chromium	ppm	ASTM D5185(m) >4	0	0	0
Nickel	ppm	ASTM D5185(m)	<1	0	<1
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	<1	0	0
Aluminum	ppm	ASTM D5185(m) >5	0	0	0
Lead	ppm	ASTM D5185(m) >10	<1	0	0
Copper	ppm	ASTM D5185(m) >30	<1	<1	<1
Tin	ppm	ASTM D5185(m) >15	0	0	0
Antimony	ppm	ASTM D5185(m)	0	0	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<1	0	0
Barium	ppm	ASTM D5185(m)	<1	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0
Manganese	ppm	ASTM D5185(m)	0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0
Calcium	ppm	ASTM D5185(m)	<1	1	2
Phosphorus	ppm	ASTM D5185(m)	0	0	0
Zinc	ppm	ASTM D5185(m)	<1	1	1
Sulfur	ppm	ASTM D5185(m)	206	223	228
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS





	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >50	0	0	0
Sodium	ppm	ASTM D5185(m)	0	0	0
Potassium	ppm	ASTM D5185(m) >20	0	0	<1
Water	%	ASTM D6304* >0.1	0.001	0.001	0.002
ppm Water	ppm	ASTM D6304* >1000	14	9.6	18.1

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 0.01	0.05	0.01	0.01




OIL ANALYSIS REPORT

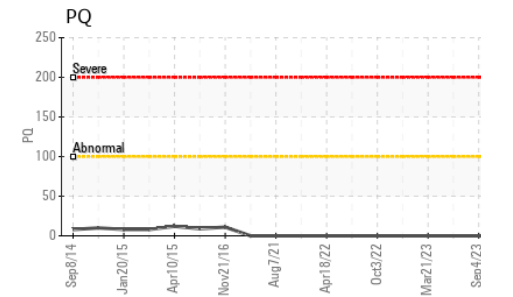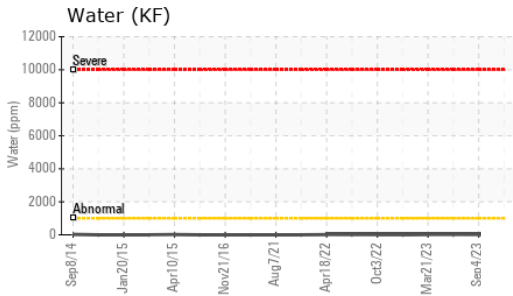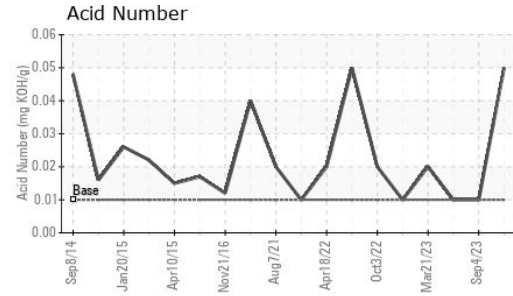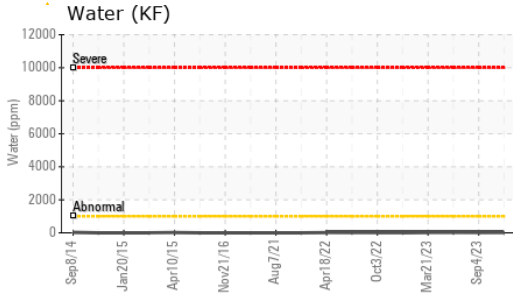






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	AMMON
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68.0 ▲ 97.1	▲ 105	▲ 103

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

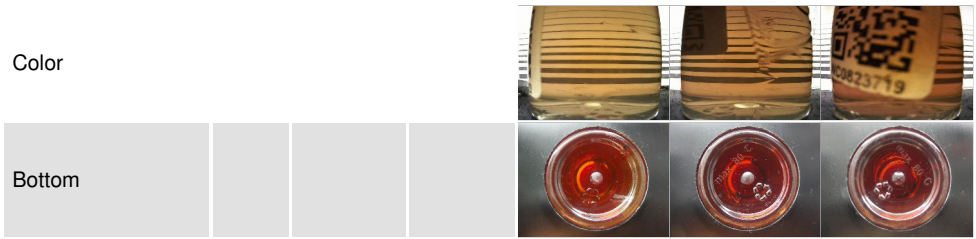

GRAPHS

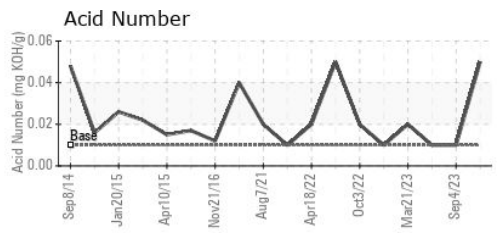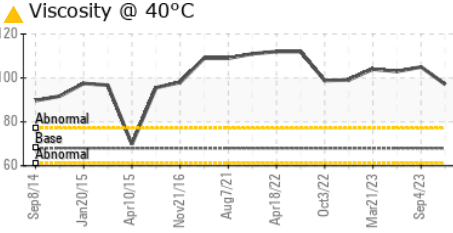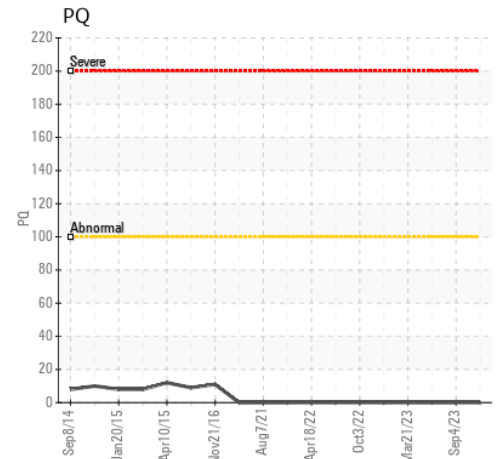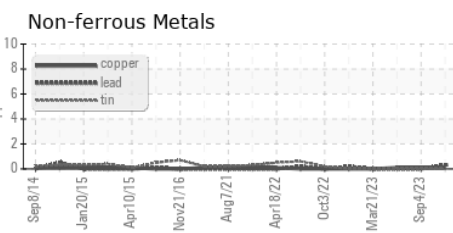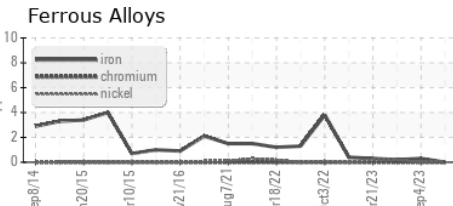

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0882223 **Received** : 05 Dec 2023
Lab Number : 02600978 **Diagnosed** : 06 Dec 2023
Unique Number : 5694063 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: KF, TAN Man)

Cargill Meat Solutions
 165 Dunlop Drive
 Guelph, ON
 CA N1L 1P4
 Contact: Jakub Posluszny
 jakub_posluszny@cargill.com
 T: (519)823-5200
 F: (519)823-5893

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.