




OIL ANALYSIS REPORT

Sample Rating Trend

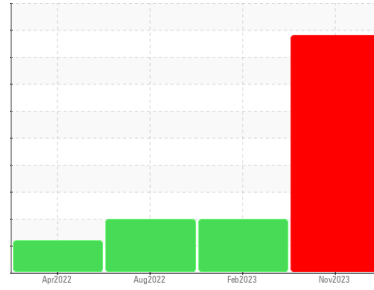

ISO



Machine Id
PRESS #4 SIG

Component
Hydraulic System

Fluid
AW HYDRAULIC OIL ISO 46 (5000 GAL)

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

Particles >14µm are severely high. Particles >21µm are severely high. Particles >6µm are severely high. Oil Cleanliness are severely high. Particles >4µm are severely high. Particles >4µm are severely high. Particles >38µm are abnormally high.

Fluid Condition

{not applicable}

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0861019	WC0758822	WC0721647
Sample Date	Client Info		28 Nov 2023	22 Feb 2023	04 Aug 2022
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		Not Chngd	N/A	N/A
Sample Status			SEVERE	SEVERE	SEVERE

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	NEG

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	141176	80621	48120
Particles >6µm	ASTM D7647	>1300	48002	6943	2996
Particles >14µm	ASTM D7647	>160	2126	111	50
Particles >21µm	ASTM D7647	>40	407	27	8
Particles >38µm	ASTM D7647	>10	25	2	0
Particles >71µm	ASTM D7647	>3	2	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/23/18	24/20/14	23/19/13

VISUAL



	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	VLITE	NONE
Appearance	scalar	Visual*	NORML LAYRD	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML

SAMPLE IMAGES


	method	limit/base	current	history1	history2
Color					
Bottom					



OIL ANALYSIS REPORT

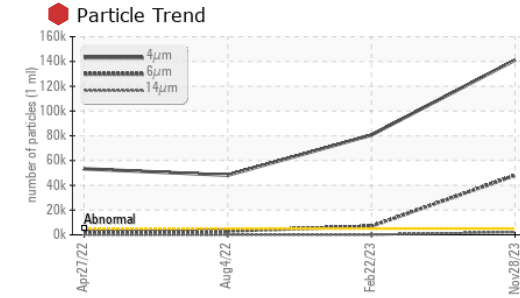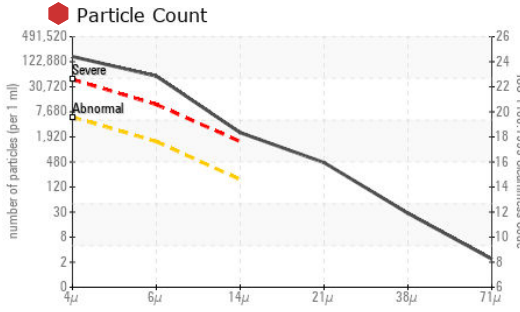

GRAPHS

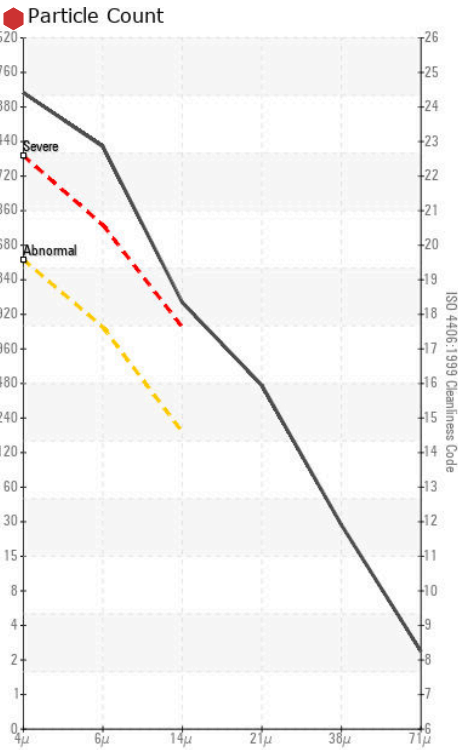

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **KLA HYDRAULIC SALES & SERVICE**
Sample No. : WC0861019 **Received** : 05 Dec 2023 43 Rockview Gardens
Lab Number : **02601090** **Diagnosed** : 07 Dec 2023 Concord, ON
Unique Number : 5694175 **Diagnostician** : Kevin Marson CA L4K 2J4
Test Package : TEST (Additional Tests: PrtCount) Contact: Dave Ferraro

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

dferraro4@hotmail.com
 T: (647)382-4668
 F: