



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
CATERPILLAR 980K LDR015
 Component
Front Left Planetary
 Fluid
PETRO CANADA PRODURO TO-4 SAE 30 (--- GAL)



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0879730	---	---
Sample Date	Client Info		01 Dec 2023	---	---
Machine Age	hrs	Client Info	15581	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Not Chngd	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >500	37	---	---
Chromium	ppm	ASTM D5185(m) >10	<1	---	---
Nickel	ppm	ASTM D5185(m) >10	<1	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m)	<1	---	---
Aluminum	ppm	ASTM D5185(m) >25	4	---	---
Lead	ppm	ASTM D5185(m) >25	<1	---	---
Copper	ppm	ASTM D5185(m) >75	4	---	---
Tin	ppm	ASTM D5185(m) >10	0	---	---
Antimony	ppm	ASTM D5185(m) >5	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES


	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 2	15	---	---
Barium	ppm	ASTM D5185(m) 0	<1	---	---
Molybdenum	ppm	ASTM D5185(m) 0	<1	---	---
Manganese	ppm	ASTM D5185(m) 9	0	---	---
Magnesium	ppm	ASTM D5185(m) 1	19	---	---
Calcium	ppm	ASTM D5185(m) 3131	3128	---	---
Phosphorus	ppm	ASTM D5185(m) 1194	986	---	---
Zinc	ppm	ASTM D5185(m) 1281	1147	---	---
Sulfur	ppm	ASTM D5185(m) 3811	9166	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >75	15	---	---
Sodium	ppm	ASTM D5185(m)	1	---	---
Potassium	ppm	ASTM D5185(m) >20	0	---	---



OIL ANALYSIS REPORT

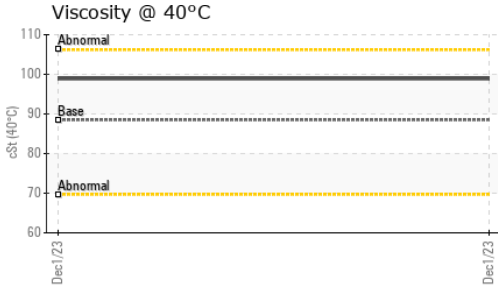









VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	88.5	98.9	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color		no image	no image
Bottom		no image	no image

GRAPHS

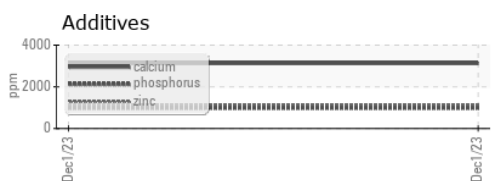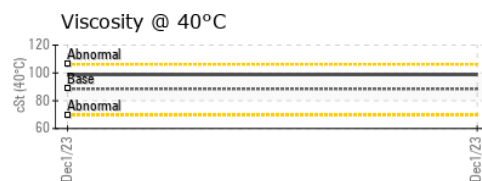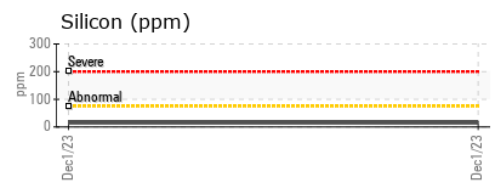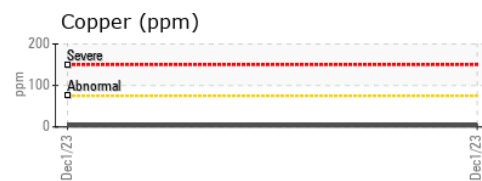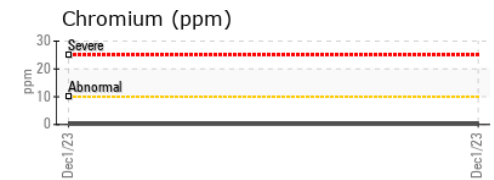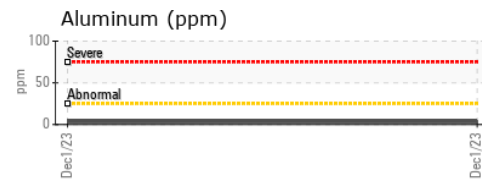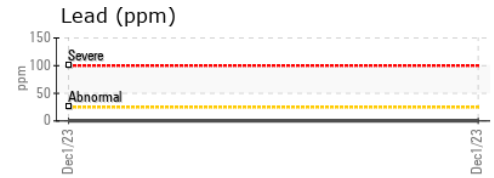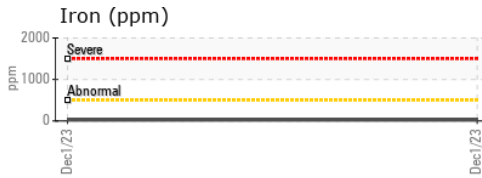

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0879730 **Received** : 06 Dec 2023
Lab Number : **02601307** **Diagnosed** : 06 Dec 2023
Unique Number : 5694392 **Diagnostician** : Wes Davis
Test Package : MOB 1

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1
 Contact: Mitch Lamontagne
 AEM_KL_macassaoilsampleresults@agnicoeagle.com
 T: (705)567-5208
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.