




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

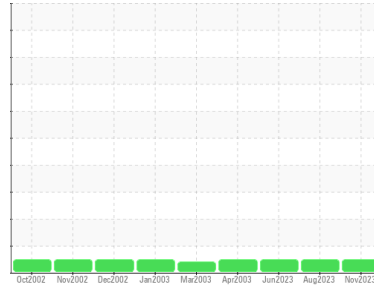

Machine Id  
**EG017**  
 Component  
**Hydraulic System**  
 Fluid  
**NOT GIVEN (--- LTR)**

## DIAGNOSIS

### Recommendation

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition. À NOTER: S.V.P. inclure, avec le prochain échantillon, des détails de la capacité du réservoir et le type et le degré de filtration. Veuillez préciser la marque, le type et la viscosité de l'huile lors de votre prochain échantillon.

### Wear

Les taux d'usure de tous les composants sont normaux.

### Contamination

La propreté du système est acceptable pour votre objectif de propreté ISO 4406. La propreté du système et du fluide est acceptable.

### Fluid Condition

Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0879178</b>	WC0848586	WC0823264
Sample Date	Client Info			<b>15 Nov 2023</b>	23 Aug 2023	06 Jun 2023
Machine Age	hrs	Client Info		<b>93287</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>8</b>	9	8
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Barium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Phosphorus	ppm	ASTM D5185(m)		<b>405</b>	466	462
Zinc	ppm	ASTM D5185(m)		<b>61</b>	67	62
Sulfur	ppm	ASTM D5185(m)		<b>812</b>	867	864
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>1</b>	1	1
Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>588</b>	151	595
Particles >6µm		ASTM D7647	>1300	<b>151</b>	52	193
Particles >14µm		ASTM D7647	>160	<b>12</b>	5	20
Particles >21µm		ASTM D7647	>40	<b>4</b>	2	5
Particles >38µm		ASTM D7647	>10	<b>1</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/14/11</b>	14/13/10	16/15/11



# OIL ANALYSIS REPORT

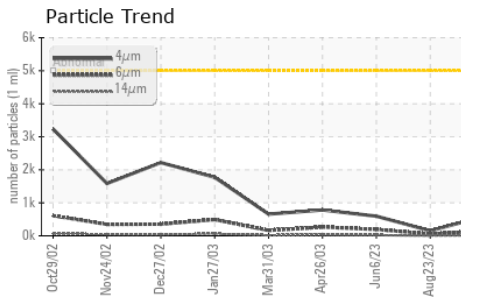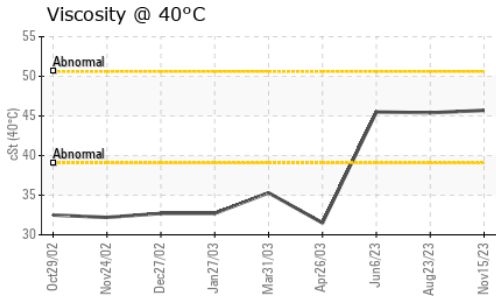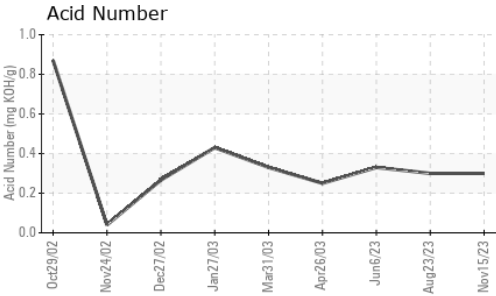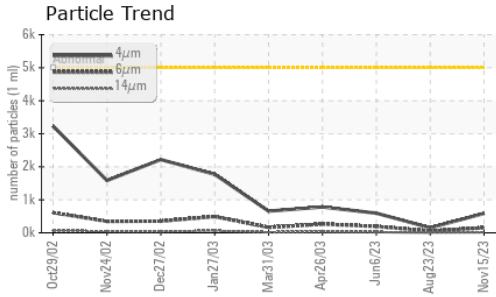


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.30</b>	0.30	0.33






VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		<b>45.7</b>	45.4	45.5

### SAMPLE IMAGES

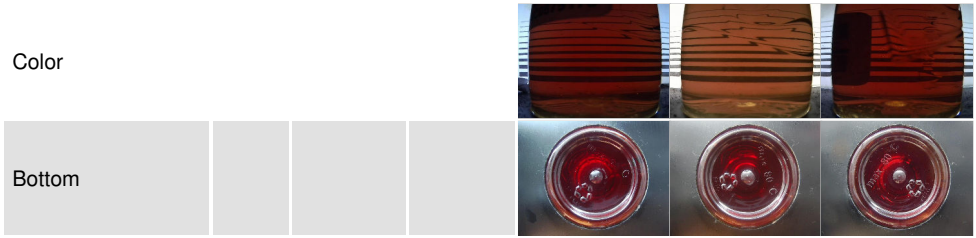

### GRAPHS

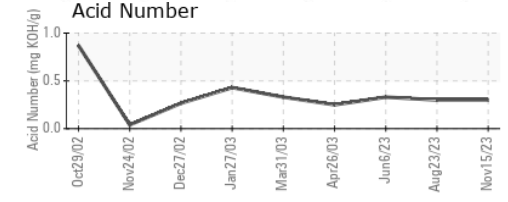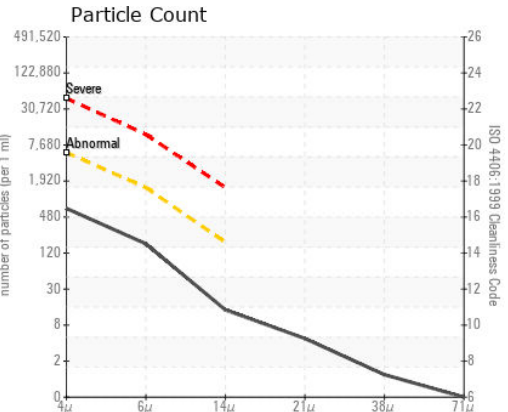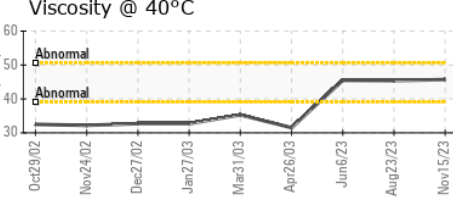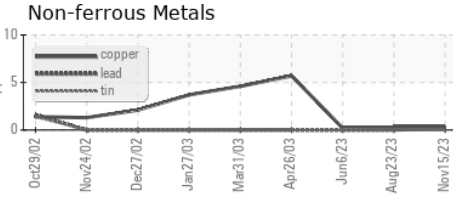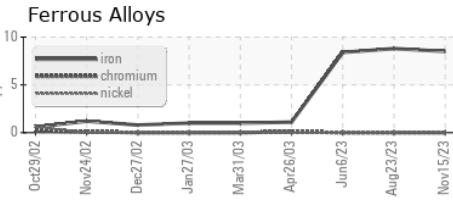

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Chamby QC CA CSRDY 1019 Cargill Limited  
**Sample No.** : WC0879178 **Received** : 07 Dec 2023 7901 Rue Samuel Hatt  
**Lab Number** : 02601542 **Diagnosed** : 11 Dec 2023 Chambley, QC  
**Unique Number** : 5694627 **Diagnostician** : Wes Davis CA J3L 6V7  
**Test Package** : IND 2

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Sylvain Benjamin  
 sylvain\_benjamin@cargill.com  
 T: (450)447-4649  
 F: (450)447-4512