




# OIL ANALYSIS REPORT

Sample Rating Trend

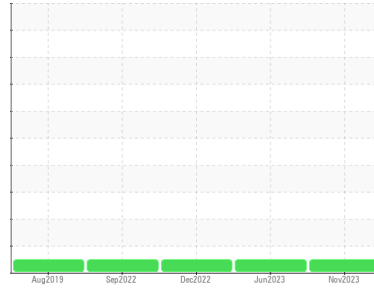

**NORMAL**



Machine Id  
**MPG A (S/N CAHE-V833200A)**

Component  
**Hydraulic System**

Fluid  
**MOBIL JET OIL II (--- LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.  
NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>PP13937658</b>	PP13874957	PP13809087
Sample Date	Client Info			<b>25 Nov 2023</b>	02 Jun 2023	11 Dec 2022
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>.1	<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>1</b>	<1	<1
Barium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Phosphorus	ppm	ASTM D5185(m)		<b>3062</b>	2994	2872
Zinc	ppm	ASTM D5185(m)		<b>2</b>	1	<1
Sulfur	ppm	ASTM D5185(m)		<b>10</b>	0	4
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>&lt;1</b>	<1	<1
Sodium	ppm	ASTM D5185(m)		<b>4</b>	4	4
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>328</b>	903	3751
Particles >6µm		ASTM D7647	>1300	<b>90</b>	164	676
Particles >14µm		ASTM D7647	>160	<b>11</b>	13	42
Particles >21µm		ASTM D7647	>40	<b>4</b>	4	15
Particles >38µm		ASTM D7647	>10	<b>1</b>	1	3
Particles >71µm		ASTM D7647	>3	<b>0</b>	1	1
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/14/11</b>	17/15/11	19/17/13



# OIL ANALYSIS REPORT

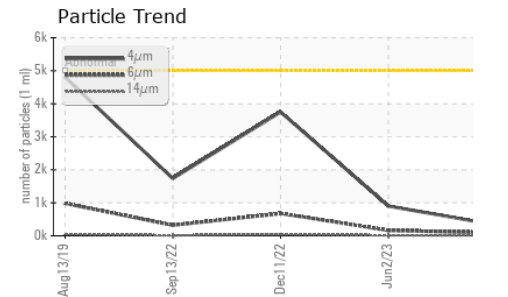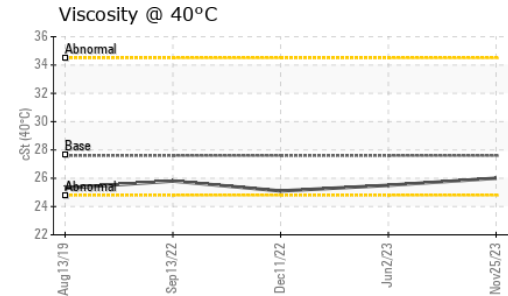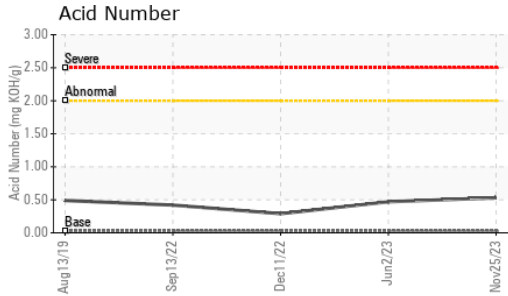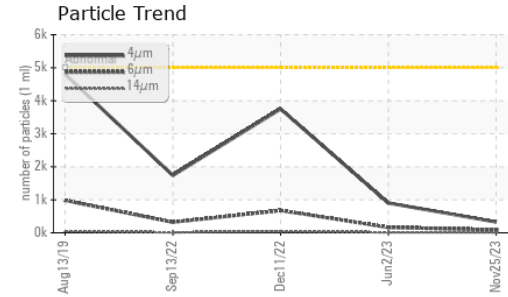


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.03	<b>0.53</b>	0.47	0.29






VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>.1	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	27.6	<b>26.0</b>	25.5	25.1

### SAMPLE IMAGES

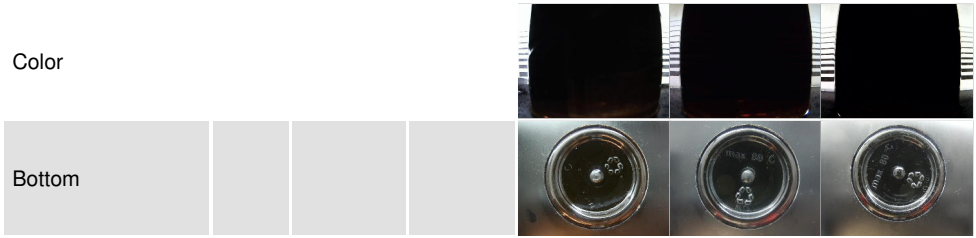

### GRAPHS

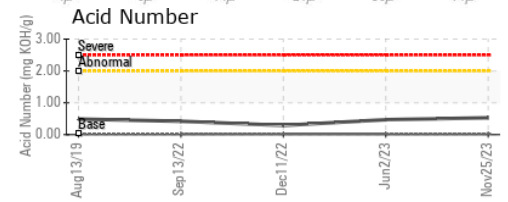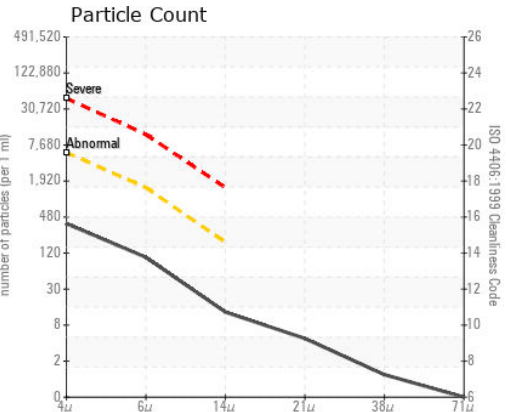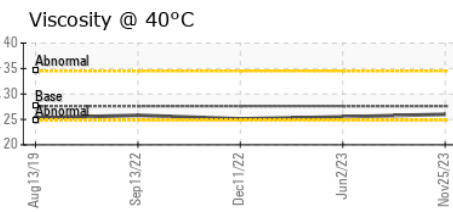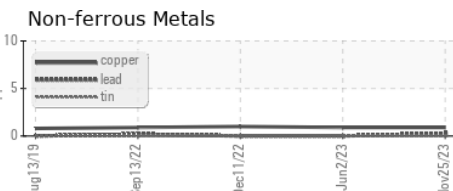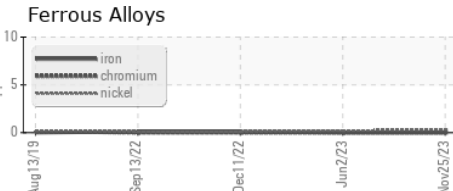

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PP13937658  
**Lab Number** : 02601552  
**Unique Number** : 5694637  
**Test Package** : MAR 2

**ExxonMobil Canada East Ltd.**  
 Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow  
 St. John's, NL  
 CA A1C 6K3  
 Contact: Liam Maher  
 liam.m.maher@exxonmobil.com  
 T: (709)273-3729  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.