




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

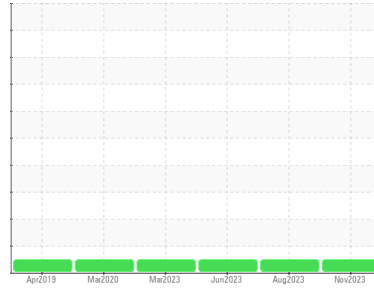

Machine Id  
**MPG B TURBINE SYNTHETIC MOBIL JET 2 (S/N CAHE-V833200B)**  
 Component  
**Unknown Component**  
 Fluid  
**MOBIL JET OIL II (--- LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.  
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the sample is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>PP13937658</b>	PP13907151	PP13874957
Sample Date	Client Info		<b>25 Nov 2023</b>	06 Aug 2023	02 Jun 2023
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>.1	<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		<b>0</b>	0	0
Iron	ppm	ASTM D5185(m)	<b>0</b>	<1	<1
Chromium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185(m)	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES






	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<b>2</b>	1	<1
Barium	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Calcium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1
Phosphorus	ppm	ASTM D5185(m)	<b>2952</b>	2783	2746
Zinc	ppm	ASTM D5185(m)	<b>1</b>	2	1
Sulfur	ppm	ASTM D5185(m)	<b>6</b>	6	0
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	<b>1</b>	<1	<1
Sodium	ppm	ASTM D5185(m)	<b>6</b>	5	6
Potassium	ppm	ASTM D5185(m) >20	<b>0</b>	<1	0



# OIL ANALYSIS REPORT

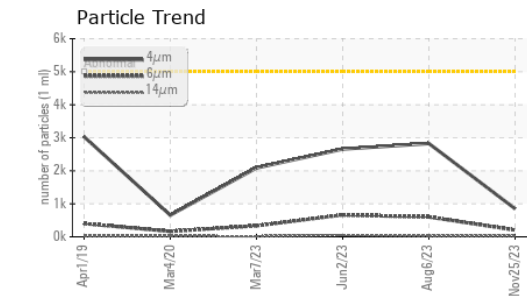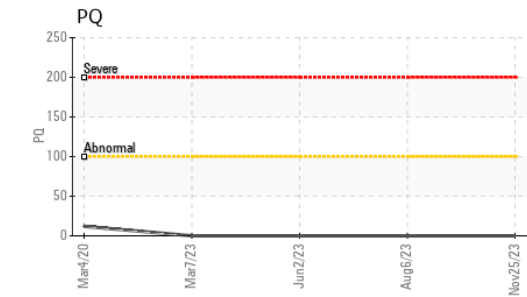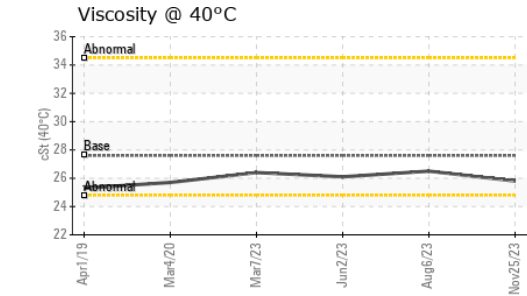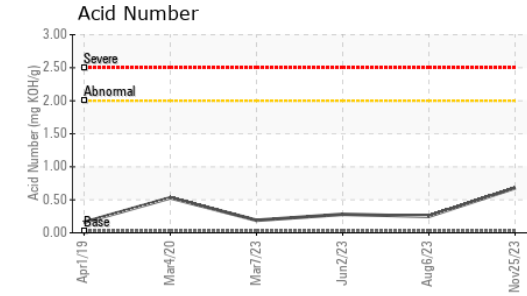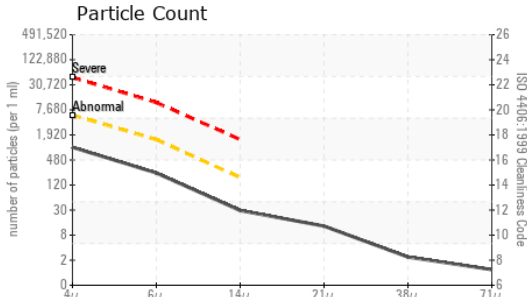


FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	<b>850</b>	2826	2658
Particles >6µm	ASTM D7647	>1300	<b>206</b>	602	662
Particles >14µm	ASTM D7647	>160	<b>26</b>	23	52
Particles >21µm	ASTM D7647	>40	<b>11</b>	4	20
Particles >38µm	ASTM D7647	>10	<b>2</b>	0	2
Particles >71µm	ASTM D7647	>3	<b>1</b>	0	1
Oil Cleanliness	ISO 4406 (c)	>19/17/14	<b>17/15/12</b>	19/16/12	19/17/13

FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D974*	0.03	<b>0.68</b>	0.25	0.28

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar Visual*	NONE	<b>NONE</b>	VLITE	VLITE
Sand/Dirt	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar Visual*	>.1	<b>NEG</b>	NEG	NEG
Free Water	scalar Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D7279(m)	27.6	<b>25.8</b>	26.5	26.1

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

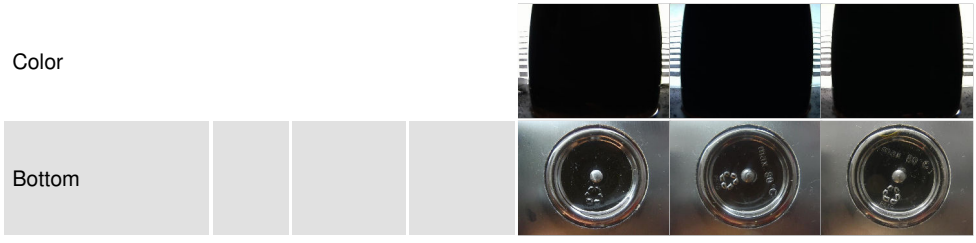

Color

Bottom



**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PP13937658  
**Lab Number** : **02601559**  
**Unique Number** : 5694644  
**Test Package** : MAR 2 ( Additional Tests: PQ, PRTCOUNT, TAN Man )

**ExxonMobil Canada East Ltd.**  
 Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow  
 St. John's, NL  
 CA A1C 6K3  
 Contact: Liam Maher  
 liam.m.maher@exxonmobil.com  
 T: (709)273-3729  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.