


Area
[6100205943]
Machine Id
HITACHI NO UNIT WA0016763
Component
Hydraulic System
Fluid
SHELL TELLUS S4 VX 32 (--- GAL)

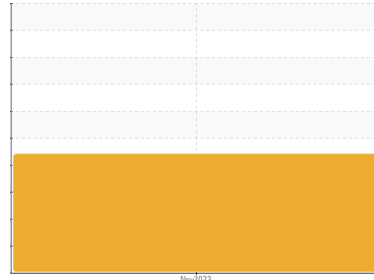

DIAGNOSIS

Recommendation

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

Fluid Condition

l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WA0016763	---	---
Sample Date	Client Info			30 Nov 2023	---	---
Machine Age	hrs	Client Info		5000	---	---
Oil Age	hrs	Client Info		5000	---	---
Oil Changed	Client Info			Changed	---	---
Sample Status				SEVERE	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.1	NEG	---	---




WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	6	---	---
Chromium	ppm	ASTM D5185(m)	>10	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		<1	---	---
Aluminum	ppm	ASTM D5185(m)	>10	2	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	1	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		<1	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		<1	---	---
Calcium	ppm	ASTM D5185(m)		2	---	---
Phosphorus	ppm	ASTM D5185(m)		528	---	---
Zinc	ppm	ASTM D5185(m)		11	---	---
Sulfur	ppm	ASTM D5185(m)		303	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	2	---	---
Sodium	ppm	ASTM D5185(m)		<1	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	80883	---	---
Particles >6µm		ASTM D7647	>1300	32439	---	---
Particles >14µm		ASTM D7647	>160	938	---	---
Particles >21µm		ASTM D7647	>40	63	---	---
Particles >38µm		ASTM D7647	>10	1	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	24/22/17	---	---

OIL ANALYSIS REPORT

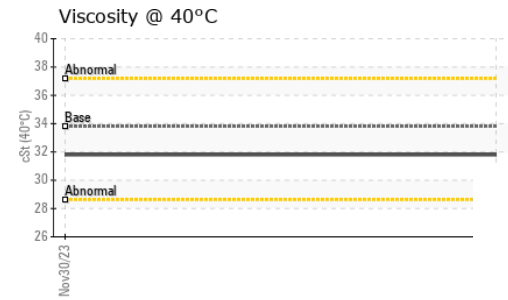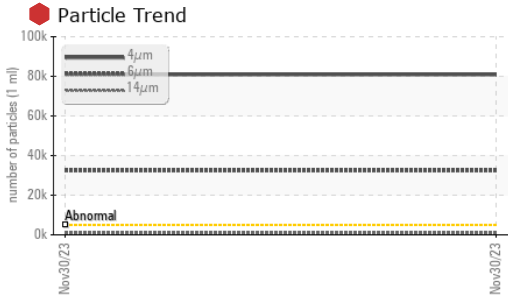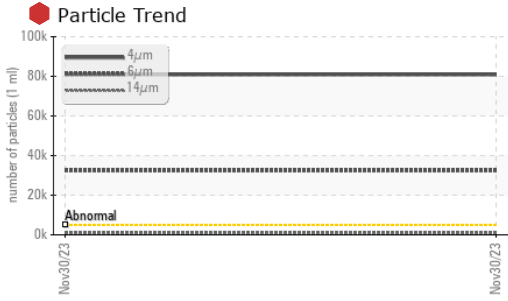





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	33.8	31.8	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color		no image	no image
Bottom		no image	no image

GRAPHS

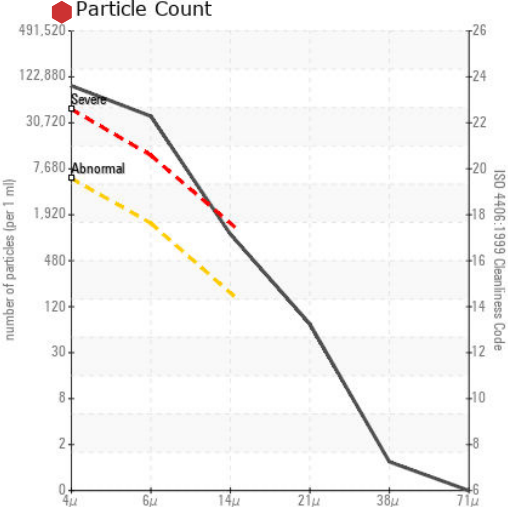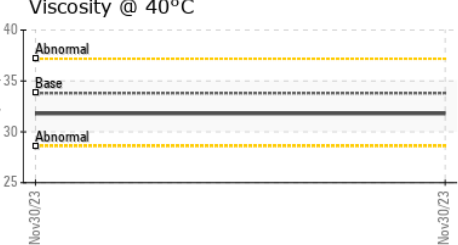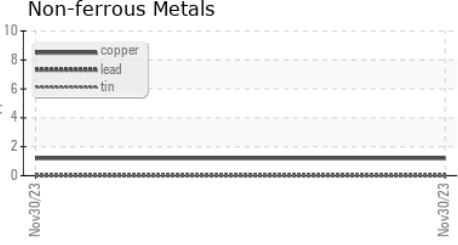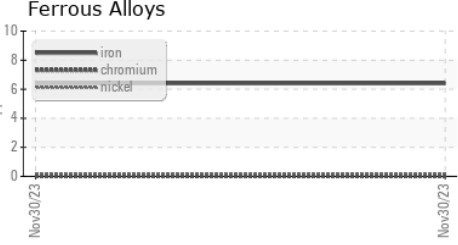

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WA0016763 **Received** : 07 Dec 2023
Lab Number : 02601588 **Diagnosed** : 11 Dec 2023
Unique Number : 5694673 **Diagnostician** : Kevin Marson
Test Package : MOB 2

Wajax Power Systems
 1080 Rue Jules-Brisebois
 Val D'Or, QC
 CA J9P 6X4
 Contact: Luc Laflamme
 llaflamme@wajax.com
 T: (819)874-2552
 F: (819)874-8995

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.