

# **PROBLEM SUMMARY**

# Sample Rating Trend

# VISCOSITY


# 0-37100-BELV-001 BUCKET CONVEYOR 1

Component

Crusher

GEAR OIL ISO 150 (--- GAL)

# **COMPONENT CONDITION SUMMARY**

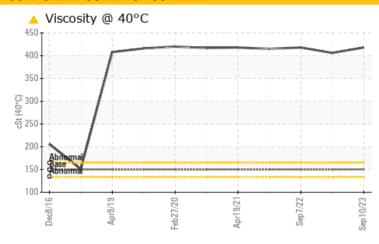

# **RECOMMENDATION**

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC T	EST RESULTS
---------------	-------------

Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Visc @ 40°C	cSt	ASTM D7279(m)	150	<b>418</b>	<b>4</b> 06	<u>418</u>

Customer Id: ONTATI Sample No.: WC0851397 Lab Number: 02604235 Test Package: IND 1



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

### **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Alert			?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.
Information Required			?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### HISTORICAL DIAGNOSIS

# 08 Mar 2023 Diag: Kevin Marson



Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 460 range, advise investigate. The condition of the oil is acceptable for the time in service.



#### VISCOSITY



### 07 Sep 2022 Diag: Kevin Marson

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 460 range, advise investigate. The condition of the oil is acceptable for the time in service.



#### VICCOCITY



# 01 Sep 2021 Diag: Kevin Marson

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 460 range, advise investigate. The condition of the oil is acceptable for the time in service.





# **OIL ANALYSIS REPORT**

Sulfur

Lithium

Silicon

Sodium

Potassium

**CONTAMINANTS** 

# Sample Rating Trend

# VISCOSITY

Machine Id

# 0-37100-BELV-001 BUCKET CONVEYOR 1

Component

Crusher

GEAR OIL ISO 150 (--- GAL)

# **DIAGNOSIS**

#### Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil.

#### Fluid Condition

Viscosity of sample indicates oil is within ISO 460 range, advise investigate. The condition of the oil is acceptable for the time in service.

					· · · · · · · · · · · · · · · · · · ·	
		Dec2016	Apr2019 Feb2020	Apr2021 Sep2022	Sep 2023	
SAMPLE INFORMA	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0851397	WC0794186	WC0736550
Sample Date		Client Info		10 Sep 2023	08 Mar 2023	07 Sep 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	17	24	18
Chromium	ppm	ASTM D5185(m)	>15	0	0	0
Nickel	ppm	ASTM D5185(m)	>15	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>50	<1	<1	0
Lead	ppm	ASTM D5185(m)	>100	<1	0	0
Copper	ppm	ASTM D5185(m)	>200	<1	0	0
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Antimony	ppm	ASTM D5185(m)	>5	0	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	50	16	17	14
Barium	ppm	ASTM D5185(m)	15	<1	0	0
Molybdenum	ppm	ASTM D5185(m)	15	<1	1	1
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)	50	<1	<1	<1
Calcium	ppm	ASTM D5185(m)	50	10	9	10
Phosphorus	ppm	ASTM D5185(m)	350	312	338	361
Zinc	ppm	ASTM D5185(m)	100	5	4	3

17074

<1

<1

0

current

16728

1

0

history1

ASTM D5185(m)

ASTM D5185(m)

method

ASTM D5185(m)

ASTM D5185(m)

ASTM D5185(m) >20

ppm

ppm

ppm

ppm

ppm

12500

>100

limit/base

17576

2


<1

0

history2





# **OIL ANALYSIS REPORT**

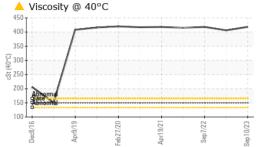


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	Visual*	>0.1	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
FLUID PROPER	TIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	150	<u> </u>	<b>4</b> 06	<b>▲</b> 418
SAMPLE IMAGE	S	method	limit/base	current	history1	history2
Color						
Bottom					\$ 0 80 x x x x x x x x x x x x x x x x x	

# **GRAPHS**

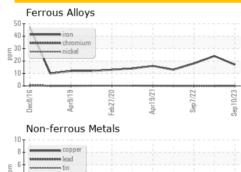

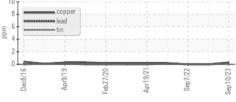

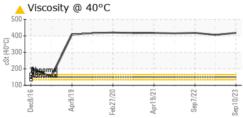



**CALA** ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5697320

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0851397 : 02604235

Recieved Diagnosed

: 19 Dec 2023 Diagnostician : Kevin Marson

: 19 Dec 2023

Test Package : IND 1 To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

**Ontario Power Generation** ATIKOKAN T.G.S., BOX 1900 ATIKOKAN, ON

> CA POT 1C0 Contact: Dale Anthony

dale.anthony@opg.com

F: (807)597-1198

Submitted By: ?