


# **OIL ANALYSIS REPORT**



# A-171 Ch#1 Circ 2 [222806] TRANE U97000401(1,2) Component Chiller

CALGON C-4s (--- GAL)

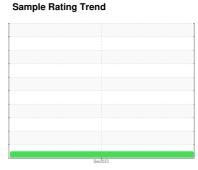



## DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

The water content is negligible. There is no indication of any contamination in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

<b>L)</b>				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0001270		
Sample Date		Client Info		01 Dec 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	1		
Chromium	ppm	ASTM D5185(m)	>2	0		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1		
Lead	ppm	ASTM D5185(m)	>2	0		
Copper	ppm	ASTM D5185(m)	>8	<1		
Tin	ppm	ASTM D5185(m)	>4	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		0		
Phosphorus	ppm	ASTM D5185(m)		1		
Zinc	ppm	ASTM D5185(m)		<1		
Sulfur	ppm	ASTM D5185(m)	500	152		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	12		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	0		
ppm Water	ppm	ASTM D6304*	>300	5		
FLUID DEGRADA	ATION_	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.01	0.05		



## **OIL ANALYSIS REPORT**

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	65.8	58.8		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
GRAPHS			_			



 Sample No.
 : GTT0001270
 Recieved
 : 28 Dec 2023

 Lab Number
 : 02605681
 Diagnosed
 : 06 Jan 2024

 Unique Number
 : 5698766
 Diagnostician
 : Bill Quesnel

Unique Number: 5698766Diagnostician: Bill QuesnelCA L4V 1T1Test Package: IND 2 (Additional Tests: KV40)Contact: Service ManagerTo discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26.accountspayable@dexterra.com

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

ommercial nature, resulting from any cause.

Report Id: GTT0000746 [WCAMIS] 02605681 (Generated: 01/08/2024 08:26:00) Rev: 1

Contact/Location: Service Manager - GTT0000746

Dexterra

T:

425-5915 Airport Rd

Mississauga, ON