


# **OIL ANALYSIS REPORT**



**NORMAL** 

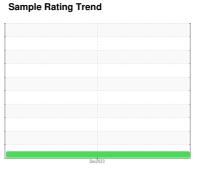

# Z-3301A F-33101

Component

**Hydraulic System** 

**MOBIL JET OIL II (--- GAL)** 

#### Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

#### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Dec2023		
SAMPLE INFORM	//ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PP		
Sample Date		Client Info		14 Dec 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	0	Client Info		N/A		
Sample Status		Onorte iriio		NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water	•	WC Method	>.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	0		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	4.0	<1		
Aluminum	ppm	ASTM D5185(m)		<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	0		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		0		
Phosphorus	ppm	ASTM D5185(m)		2109		
Zinc	ppm	ASTM D5185(m)		<1		
Sulfur	ppm	ASTM D5185(m)		4		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	2		
FLUID CLEANLIN		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	1192		
Particles >6μm		ASTM D7647	>1300	247		
Particles >14µm		ASTM D7647	>1600	14		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm Oil Cleanliness		ASTM D7647 ISO 4406 (c)	>3 >19/17/14	0 17/15/11		



## **OIL ANALYSIS REPORT**

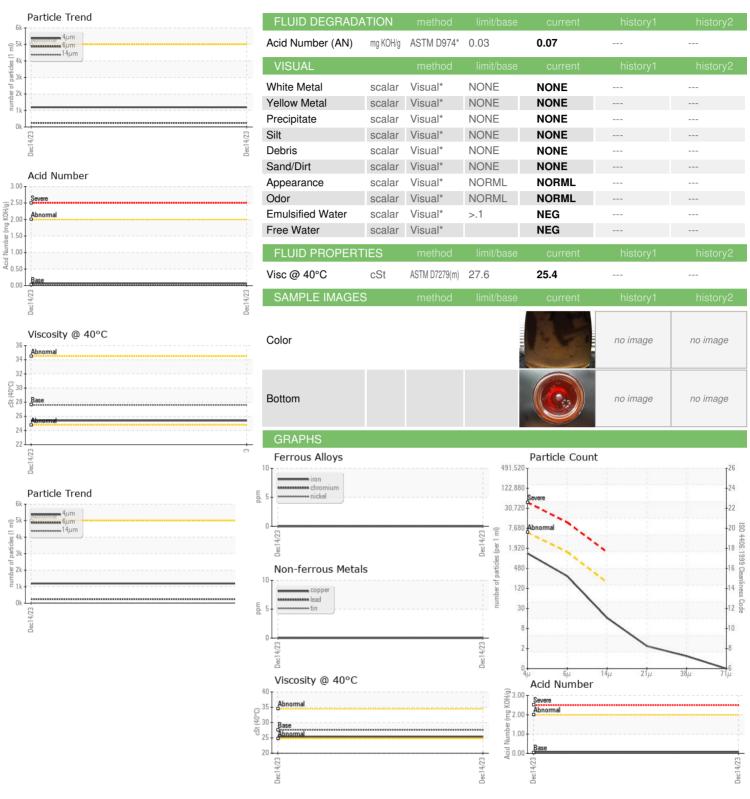



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** Test Package : MAR 2

: PP

To discuss this sample report, contact Customer Service at 1-800-268-2131.

: 02605939

Recieved Diagnosed : 5707025 Diagnostician

: 02 Jan 2024 : 03 Jan 2024

: Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 HIBERNIA MGMT & DEVELOPMENT CO. LTD SUITE 1000,, 100 NEW GOWER STREET

ST.JOHNS, NL **CA A1C 6K3** Contact: Sam Nash

samantha.m.nash@exxonmobil.com T:

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (709)722-3766