

OIL ANALYSIS REPORT

MTU PORT GEARBOX

Component

Port Gearbox

SAE 15W40 (--- LTR)

Sample Rating Trend **NORMAL**

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

Viscosity of sample indicates oil is within SAE 30 range, advise investigate. The condition of the oil is acceptable for the time in service.

				Dec2023		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WA0019255		
Sample Date		Client Info		23 Dec 2023		
Machine Age	hrs	Client Info		600		
Oil Age	hrs	Client Info		150		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	NC	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	7		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	2		
Lead	ppm	ASTM D5185(m)	>50	5		
Copper	ppm	ASTM D5185(m)	>200	62		
Tin	ppm	ASTM D5185(m)	>10	2		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		169		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		4		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		82		
Calcium	ppm	ASTM D5185(m)		2062		
Phosphorus	ppm	ASTM D5185(m)		938		
Zinc	ppm	ASTM D5185(m)		1043		
Sulfur	ppm	ASTM D5185(m)		3198		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	3		
Sodium	ppm	ASTM D5185(m)	>57	3		
Potassium	ppm	ASTM D5185(m)	>20	8		




OIL ANALYSIS REPORT

cSt

ASTM D7279(m) 115


Visc @ 40°C

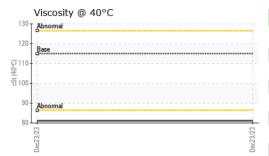

VISUAL		method				history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERTIES		method	limit/base	current	history1	history2

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

81.1

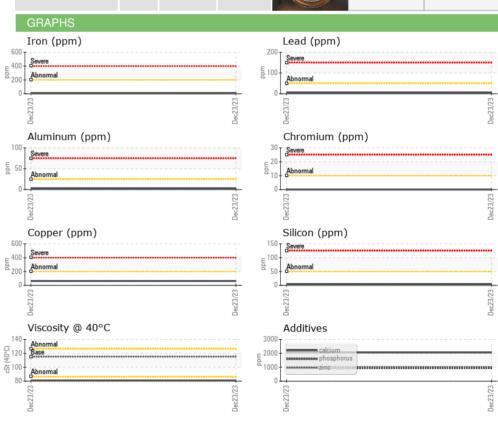



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5707149

Test Package : MOB 1

: WA0019255 : 02606063

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved Diagnosed

Diagnostician : Kevin Marson

: 02 Jan 2024 : 03 Jan 2024

Canadian Coast Guard 93 BOUNDRY ST CLARK'S HARBOUR, NS **CA BOW 1P0**

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.

CLARKS-HARBOUR.CCGS@dfo-mpo.gc.ca T:

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: