




OIL ANALYSIS REPORT

Sample Rating Trend

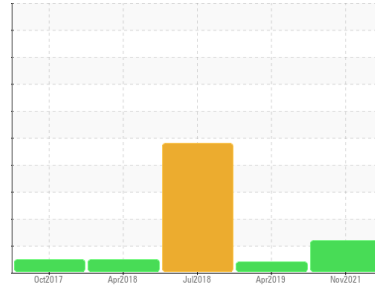

ISO



Machine Id
33-LU-101 SAG MILL
 Component
Hydraulic System
 Fluid
SHELL OMALA S2 GX 220 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0837940	WC0304290	WC0292487
Sample Date	Client Info		13 Nov 2021	08 Apr 2019	10 Jul 2018
Machine Age	yrs	Client Info	0	27	26
Oil Age	yrs	Client Info	0	1	0
Oil Changed	Client Info		Not Changed	Not Changed	Not Changed
Sample Status			ABNORMAL	ATTENTION	SEVERE

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.05	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>20	16	4	12
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	2	<1	2
Lead	ppm	ASTM D5185(m)	>20	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>20	<1	<1	2
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	<1	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	6.2	3	9	<1
Barium	ppm	ASTM D5185(m)	0.0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)	0	2	<1	2
Calcium	ppm	ASTM D5185(m)	0.0	38	11	11
Phosphorus	ppm	ASTM D5185(m)	290	221	267	267
Zinc	ppm	ASTM D5185(m)	3.8	3	2	<1
Sulfur	ppm	ASTM D5185(m)	8167	8443	10200	7545
Lithium	ppm	ASTM D5185(m)		<1	0	0

CONTAMINANTS






	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>15	2	2	5
Sodium	ppm	ASTM D5185(m)		13	5	2
Potassium	ppm	ASTM D5185(m)	>20	0	<1	0

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 28301	▲ 5088	● 124980
Particles >6µm	ASTM D7647	>1300	▲ 2067	83	● 17245
Particles >14µm	ASTM D7647	>160	87	3	▲ 851
Particles >21µm	ASTM D7647	>40	20	2	▲ 214
Particles >38µm	ASTM D7647	>10	1	1	2
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/18/14	▲ 20/14/9	● 24/21/17



OIL ANALYSIS REPORT

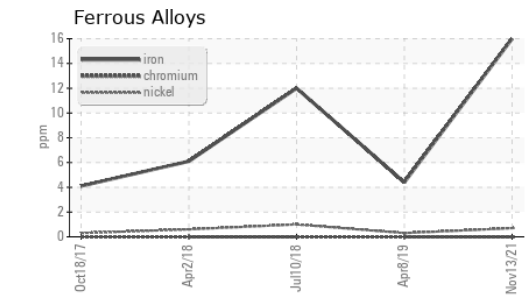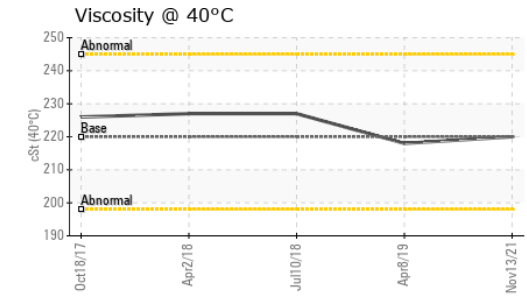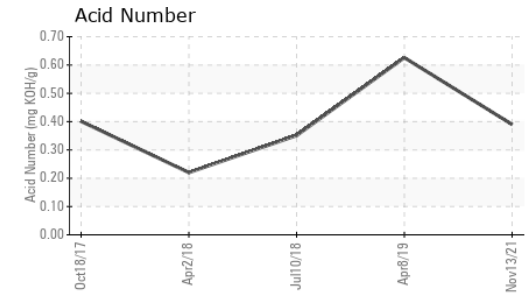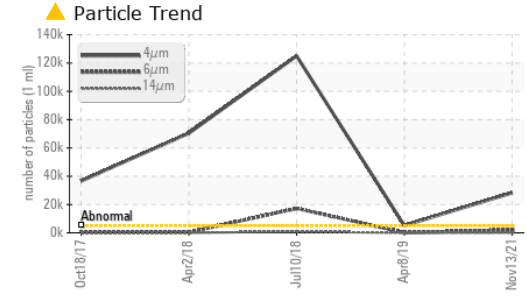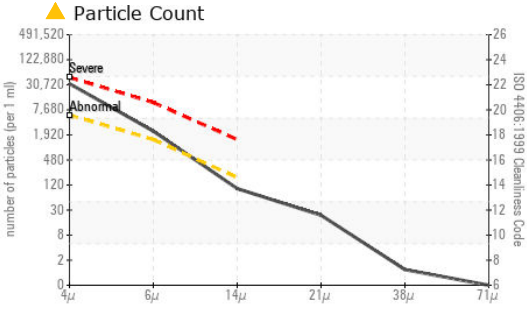

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.39	0.626	0.351

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	▲ VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	VLITE
Debris	scalar	Visual*	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	220	220	218	227

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						
Bottom						
PrtFilter						



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0837940 **Received** : 03 Jan 2024
Lab Number : **02606274** **Diagnosed** : 04 Jan 2024
Unique Number : 5707360 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Vale - Clarabelle Mill
 MTW (Mill, Tailings & Water)
 COPPER CLIFF, ON
 CA P0M 1N0
 Contact: Guy Gauthier
 guy.gauthier@vale.com
 T: (705)682-5646
 F: (705)682-6273