

OIL ANALYSIS REPORT

ÎPEX - 888063 **AM974**

Component **Hydraulic System**

AW HYDRAULIC OIL ISO 46 (--- GAL)

Sample Rating Trend NORMAL

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

{not applicable}

Fluid Condition

{not applicable}


				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Machine ID		Client Info		IMM53		
Department		Client Info		Sales		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		01/02/2024		
Sample Number		Client Info		E30001072		
Sample Date		Client Info		20 Dec 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	<1		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVE C			11 1. //		11.	11.

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	2		
Barium	ppm	ASTM D5185(m)	5	0		
Molybdenum	ppm	ASTM D5185(m)	5	<1		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	25	7		
Calcium	ppm	ASTM D5185(m)	200	79		
Phosphorus	ppm	ASTM D5185(m)	300	324		
Zinc	ppm	ASTM D5185(m)	370	411		
Sulfur	ppm	ASTM D5185(m)	2500	797		
Lithium	ppm	ASTM D5185(m)		<1		
CONTANAINIANIT		and a the end	11.00 11.00		la la La moral	la la tarrir O

CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	0		
Water	%	ASTM D6304*	>0.05	0.005		
ppm Water	ppm	ASTM D6304*	>500	50		



OIL ANALYSIS REPORT

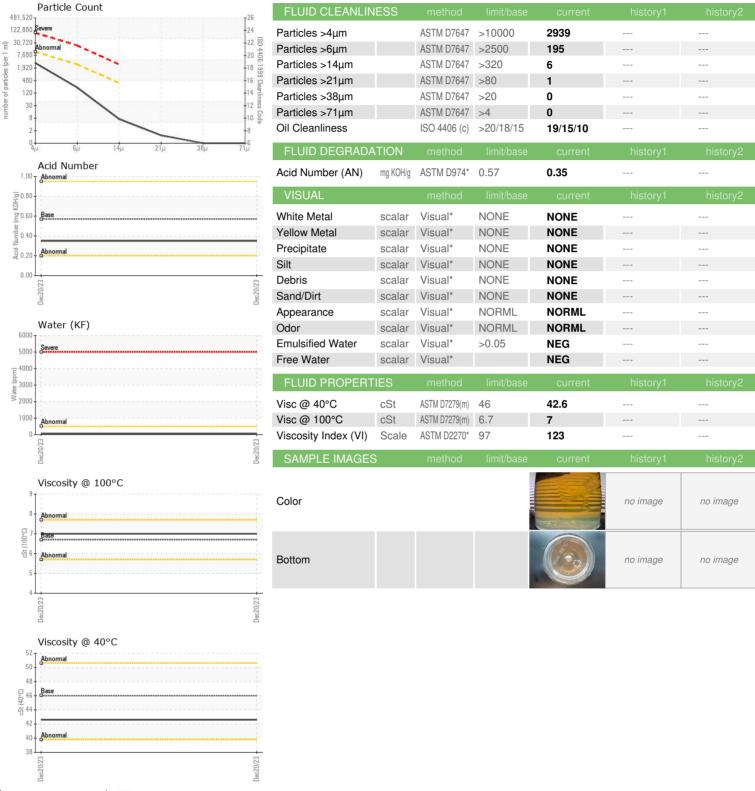



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: E30001072 : 02606557 : 5707643

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved Diagnosed

: 04 Jan 2024 : 08 Jan 2024

Diagnostician : Tatiana Sorkina

Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

640 Victoria Street Cobourg, ON **CA K9A 5H5** Contact: Tatiana Sorkina

tsorkina@e360s.ca T: (800)263-3939 F: (905)373-4950