


OIL ANALYSIS REPORT



CATERPILLAR R1600 SCP219

Component **Rear Right Planetary**

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

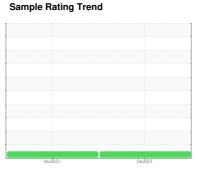



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

10 10-4 SAE 50	(GAL)		Nov2023	Dec2023		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		wc	WC0861416	
Sample Date		Client Info		31 Dec 2023	12 Nov 2023	
Machine Age	hrs	Client Info		2498	1972	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		Not Changd	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	NC	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	
WEAR METALS	;	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	25	68	
Chromium	ppm	ASTM D5185(m)	>10	0	<1	
Nickel	ppm	ASTM D5185(m)	>10	0	0	
Titanium	ppm	ASTM D5185(m)		0	0	
Silver	ppm	ASTM D5185(m)		0	<1	
Aluminum	ppm	ASTM D5185(m)	>25	1	1	
Lead	ppm	ASTM D5185(m)	>25	<1	4	
Copper	ppm	ASTM D5185(m)	>75	38	115	
Tin	ppm	ASTM D5185(m)	>10	1	4	
Antimony	ppm	ASTM D5185(m)	>5	0	0	
Vanadium	ppm	ASTM D5185(m)		0	0	
Beryllium	ppm	ASTM D5185(m)		0	0	
Cadmium	ppm	ASTM D5185(m)		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	2	<1	2	
Barium	ppm	ASTM D5185(m)	0	<1	3	
Molybdenum	ppm	ASTM D5185(m)	0	<1	<1	
Manganese	ppm	ASTM D5185(m)	0	0	1	
Magnesium	ppm	ASTM D5185(m)	9	10	13	
Calcium	ppm	ASTM D5185(m)	3114	3465	3797	
Phosphorus	ppm	ASTM D5185(m)	1099	888	922	
Zinc	ppm	ASTM D5185(m)	1245	1030	1099	
Sulfur	ppm	ASTM D5185(m)	7086	10625	7383	
Lithium	ppm	ASTM D5185(m)		<1	<1	
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	6	6	
Sodium	ppm	ASTM D5185(m)		<1	2	
Potassium	ppm	ASTM D5185(m)	>20	0	<1	




OIL ANALYSIS REPORT

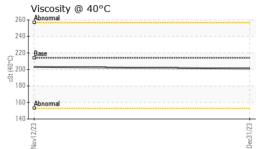

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	
Precipitate	scalar	Visual*	NONE	NONE	NONE	
Silt	scalar	Visual*	NONE	NONE	NONE	
Debris	scalar	Visual*	NONE	NONE	NONE	
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	
Appearance	scalar	Visual*	NORML	NORML	NORML	
Odor	scalar	Visual*	NORML	NORML	NORML	
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	
Free Water	scalar	Visual*		NEG	NEG	
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	213.9	201	203	

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					no image
Bottom					no image

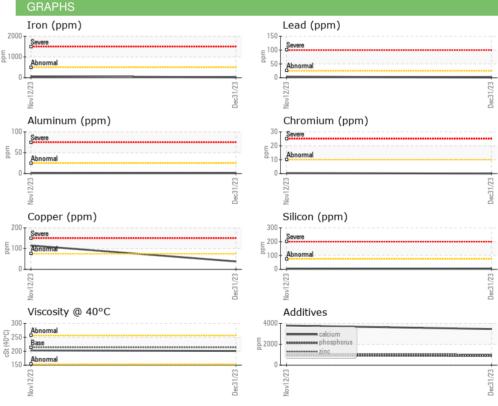



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

: WC

: 02606618 Unique Number : 5707704 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved Diagnosed

: 04 Jan 2024 : 04 Jan 2024 Diagnostician : Kevin Marson

Agnico Eagle Canada 1350 Government Rd. W, MACASSA COMPLEX

Kirkland Lake, ON **CA P2N 3J1**

Contact: Mitch Lamontagne AEM_KL_macassaoilsampleresults@agnicoeagle.com

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (705)567-5208 F: (705)567-5221