


# **OIL ANALYSIS REPORT**

# IAC-Maple - L01500 A2401015

Component **Hydraulic System** 

{not provided} (--- GAL)

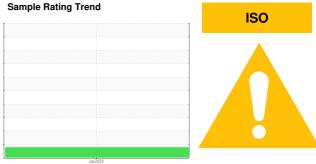

## DIAGNOSIS

#### Recommendation

This is a baseline read-out on the submitted sample.

#### Wear

Copper and iron ppm levels are noted.

### Contamination

The sample submitted is 2 times dirtier than the ISO dirt count recommendation of 19/16/14.

#### **Fluid Condition**

{not applicable}

				Jan 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Machine ID		Client Info		21		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		01/03/2024		
Sample Number		Client Info		E30001091		
Sample Date		Client Info		03 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>20	14		
Chromium	ppm	ASTM D5185(m)	>20	2		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	<1		
Copper	ppm	ASTM D5185(m)	>20	18		
Tin	ppm	ASTM D5185(m)	>20	<1		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		7		
Calcium	ppm	ASTM D5185(m)		69		
Phosphorus	ppm	ASTM D5185(m)		334		
Zinc	ppm	ASTM D5185(m)		404		
Sulfur	ppm	ASTM D5185(m)		2271		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<1		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.003		
nnm Matar		ACTM DCCC4*	. FOO	24		


ppm Water

ppm ASTM D6304\* >500

34



# OIL ANALYSIS REPORT

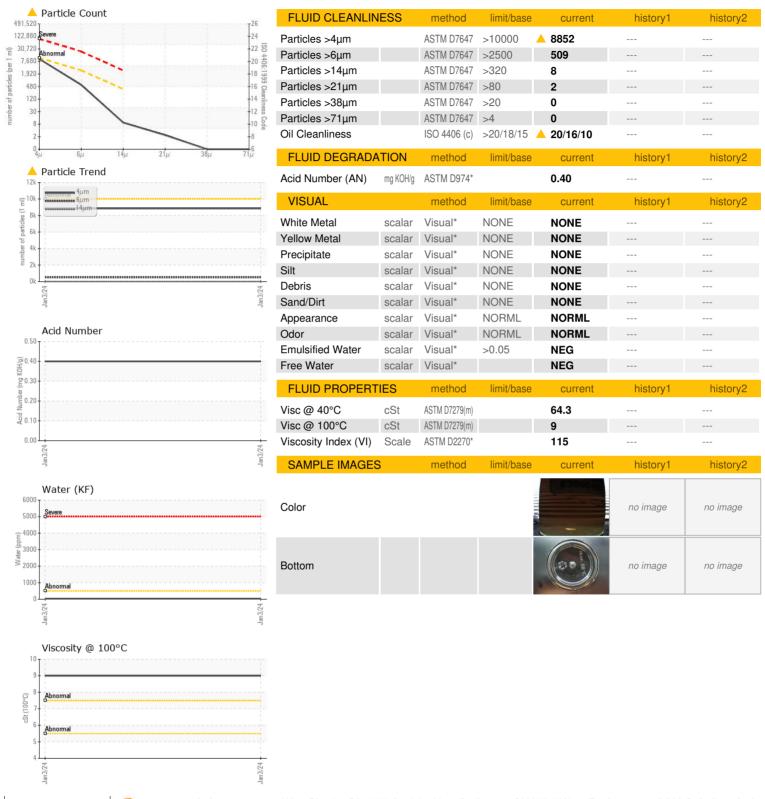



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : E30001091

Recieved : 02606792 : 5707878

: 05 Jan 2024 Diagnosed : 25 Jan 2024 Diagnostician : Tatiana Sorkina

Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

640 Victoria Street Cobourg, ON **CA K9A 5H5** Contact: Tatiana Sorkina

tsorkina@e360s.ca T: (800)263-3939 F: (905)373-4950