




OIL ANALYSIS REPORT

Sample Rating Trend

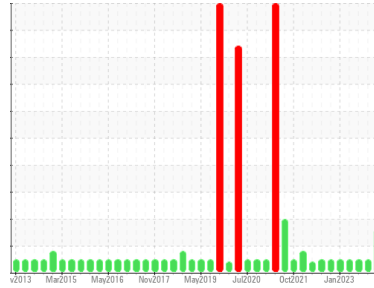

ISO



Area
SAB2
 Machine Id
SAB2 G23 Governor

Component
Hydraulic System
 Fluid
ESSO TERESSO ISO 46 (6160 LTR)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0801617	WC0858098	WC0830398
Sample Date	Client Info			07 Jan 2024	25 Oct 2023	31 Jul 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed	Client Info			N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	NEG	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1	<1	1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	0
Lead	ppm	ASTM D5185(m)	>20	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>20	<1	0	0
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	<1
Calcium	ppm	ASTM D5185(m)	0	0	0	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	1	2	2
Zinc	ppm	ASTM D5185(m)	0	<1	<1	1
Sulfur	ppm	ASTM D5185(m)		1848	1728	1881
Lithium	ppm	ASTM D5185(m)		<1	<1	<1


CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0	0	0
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>2500	▲ 5626	475	611
Particles >6µm		ASTM D7647	>640	▲ 1665	143	233
Particles >14µm		ASTM D7647	>80	▲ 111	10	23
Particles >21µm		ASTM D7647	>20	22	3	6
Particles >38µm		ASTM D7647	>4	2	1	0
Particles >71µm		ASTM D7647	>3	1	1	0
Oil Cleanliness		ISO 4406 (c)	>18/16/13	▲ 20/18/14	16/14/10	16/15/12




OIL ANALYSIS REPORT


Particle Trend

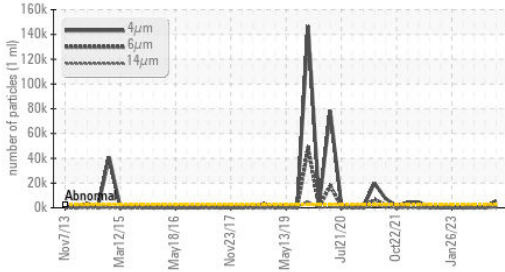


Particle Trend

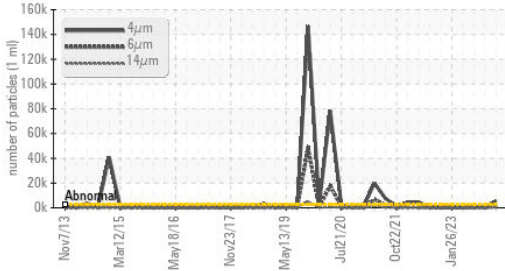

Acid Number

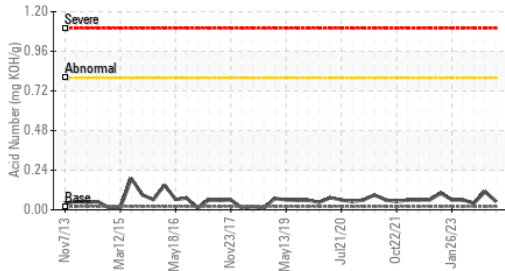

Viscosity @ 40°C

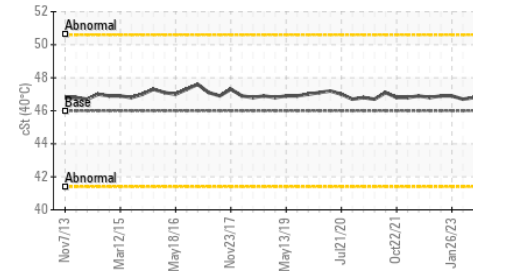

FLUID DEGRADATION	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.05	0.11	0.04

VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	46	47.1	46.5	46.8

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color




Bottom




GRAPHS


Ferrous Alloys

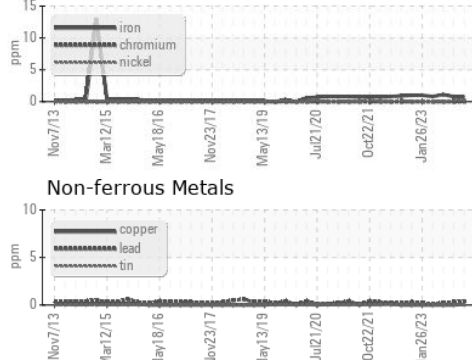


Non-ferrous Metals

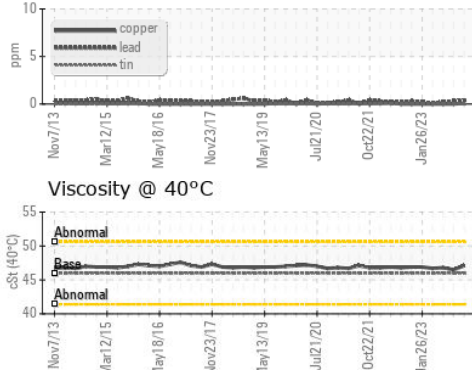


Viscosity @ 40°C

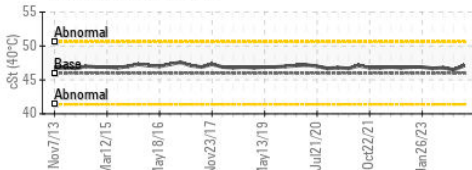

Particle Count

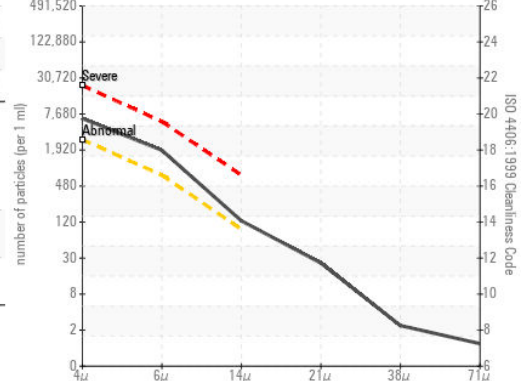

Acid Number

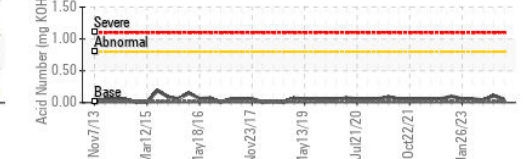

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
 Sample No. : WC0801617
 Lab Number : **02607052**
 Unique Number : 5708138
 Test Package : IND 2 (Additional Tests: TAN Man)

Ontario Power Generation
 NIAGARA PLANT GROUP, 14000 NIAGARA PKWY
 NIAGARA ON THE LAKE, ON
 CA L0S 1J0
 Contact: Michael Brochu
 mike.brochu@opg.com
 T: (905)357-0322
 F: (905)374-5466

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.