

## **OIL ANALYSIS REPORT**

# SAB2 **SAB2 G26 Governor Lube**

**Governor System** 

ESSO TERESSO ISO 46 (6160 LTR)

# ............

Sample Rating Trend



### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

### Wear

Component wear rates appear to be normal (unconfirmed).

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. NOTE: An increase in the particle count is noted.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0801628	WC0858109	WC0830409
Sample Date		Client Info		07 Jan 2024	25 Oct 2023	31 Jul 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>50	<1	<1	1
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>3	<1	0	0
Lead	ppm	ASTM D5185(m)	>75	1	1	2
Copper	ppm	ASTM D5185(m)	>15	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>55	0	0	0
Antimony	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0	<1	<1
Barium	ppm	ASTM D5185(m)		0	<1	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Calcium	ppm	ASTM D5185(m)		<1	<1	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	2	2	3
Zinc	ppm	ASTM D5185(m)	0	<1	<1	2
Sulfur	ppm	ASTM D5185(m)		1284	1216	1333
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>8	0	0	<1
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1
FLUID CLEANLINE	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>2500	1978	353	250
Particles >6µm		ASTM D7647	>640	378	97	68
Particles >14μm		ASTM D7647	>80	12	3	8
Particles >21µm		ASTM D7647	>20	3	1	3
Particles >38μm		ASTM D7647	>4	1	0	1

ASTM D7647 >3

ISO 4406 (c) >18/16/13

18/16/11


16/14/9

Particles >71µm

Oil Cleanliness



### OIL ANALYSIS REPORT

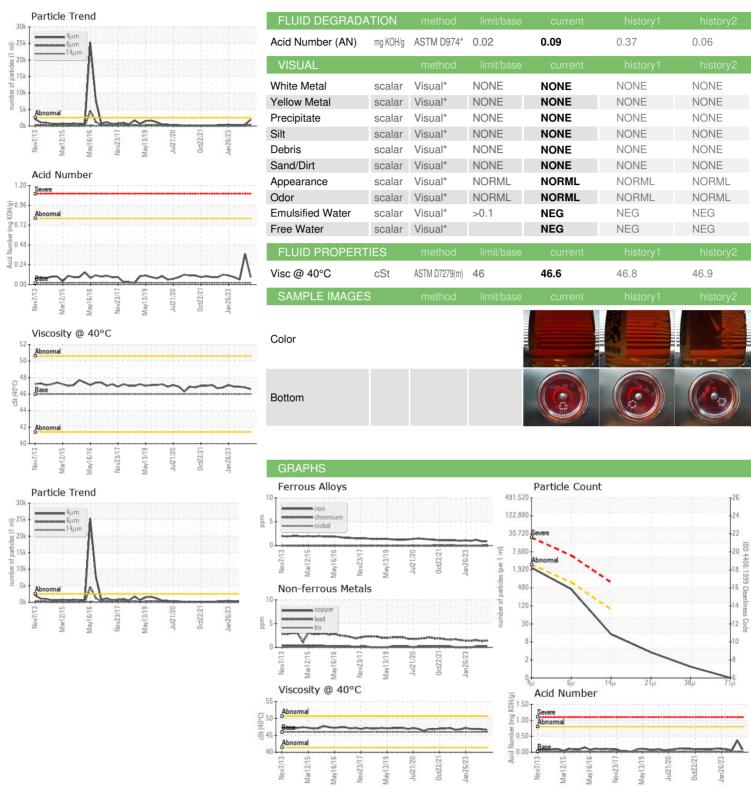



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WC0801628 : 02607054

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved

Diagnosed : 5708140 Diagnostician : 08 Jan 2024

: 09 Jan 2024

: Kevin Marson

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

**Ontario Power Generation** 

NIAGARA PLANT GROUP,, 14000 NIAGARA PKWY NIAGARA ON THE LAKE, ON

CA LOS 1J0 Contact: Alex Courtemanche

alex.courtemanche@opg.com T: (905)357-0322

F: (905)357-6558