

# **OIL ANALYSIS REPORT**

## Sample Rating Trend

## NORMAL



RONI Component **Left Final Drive** 

PETRO CANADA 30W (--- GAL)



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

( GAL)				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0872937		
Sample Date		Client Info		10 Dec 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>800	185		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>5	<1		
Titanium	ppm	ASTM D5185(m)	>15	1		
Silver	ppm	ASTM D5185(m)	>2	<1		
Aluminum	ppm	ASTM D5185(m)	>75	29		
Lead	ppm	ASTM D5185(m)	>10	0		
Copper	ppm	ASTM D5185(m)	>75	<1		
Tin	ppm	ASTM D5185(m)	>8	0		
Antimony	ppm	ASTM D5185(m)	>50	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		3		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		1		
Magnesium	ppm	ASTM D5185(m)		18		
Calcium	ppm	ASTM D5185(m)		2893		
Phosphorus	ppm	ASTM D5185(m)		1005		
Zinc	ppm	ASTM D5185(m)		1181		
Sulfur	ppm	ASTM D5185(m)		6071		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>400	116		
Sodium	ppm	ASTM D5185(m)		11		
Potassium	ppm	ASTM D5185(m)	>20	15		




## **OIL ANALYSIS REPORT**

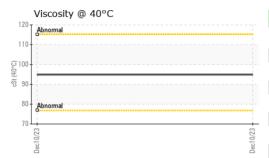

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
<b>Emulsified Water</b>	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	TIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		94.9		

S	AMPLE IMAGES	method	limit/base	current	history1	history2
Col	lor				no image	no image
Bot	ttom				no image	no image
G	BAPHS					

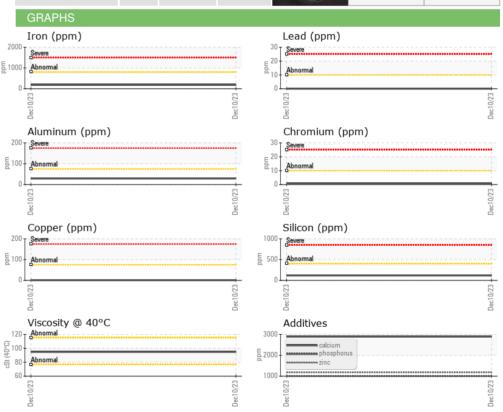



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5708334

: WC0872937

: 02607248

Recieved : 08 Jan 2024 Diagnosed

: 09 Jan 2024 Diagnostician : Wes Davis

Test Package : MOBCE ( Additional Tests: Visual )

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. 100 MACINTOSH BLVD VAUGHAN, ON

CA L4K 4P3 Contact: Service Team

To discuss this sample report, contact Customer Service at 1-800-268-2131.

service.team@roni.ca T:

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: