




# OIL ANALYSIS REPORT

Sample Rating Trend

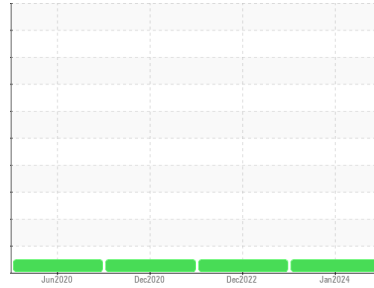

**NORMAL**



Machine Id  
**SBK G1 GOV (S/N 627022)**

Component  
**Hydraulic System**

Fluid  
**ESSO TERESSO ISO 68 (40 GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0706209</b>	WC0445343	WC0327891
Sample Date	Client Info			<b>05 Jan 2024</b>	08 Dec 2022	15 Dec 2020
Machine Age	mths	Client Info		<b>102</b>	102	0
Oil Age	mths	Client Info		<b>102</b>	102	97
Oil Changed	Client Info			<b>N/A</b>	N/A	Not Chngd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>1</b>	1	1
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>20	<b>2</b>	2	2
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	4.5	<b>0</b>	<1	<1
Barium	ppm	ASTM D5185(m)	0.4	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	0	<1
Phosphorus	ppm	ASTM D5185(m)	0.7	<b>20</b>	8	7
Zinc	ppm	ASTM D5185(m)	0	<b>9</b>	2	2
Sulfur	ppm	ASTM D5185(m)	1315	<b>1955</b>	2031	2054
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	<1
Sodium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	4

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>918</b>	411	882
Particles >6µm		ASTM D7647	>1300	<b>238</b>	98	211
Particles >14µm		ASTM D7647	>160	<b>18</b>	12	35
Particles >21µm		ASTM D7647	>40	<b>4</b>	4	14
Particles >38µm		ASTM D7647	>10	<b>0</b>	0	2
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>17/15/11</b>	16/14/11	17/15/12



# OIL ANALYSIS REPORT

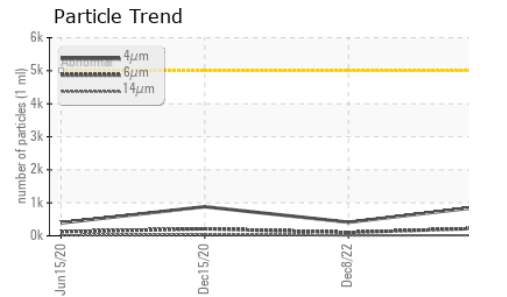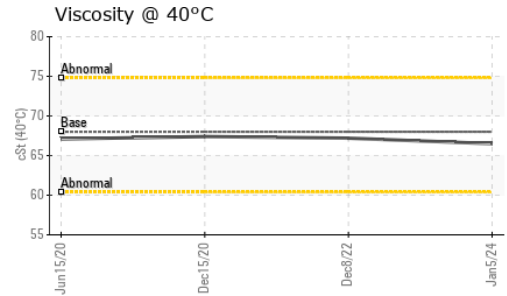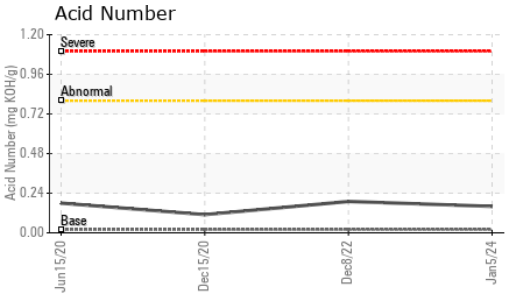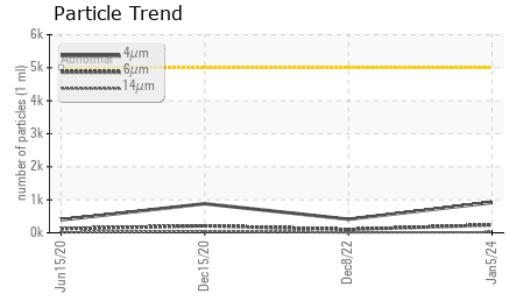


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	<b>0.16</b>	0.19	0.11





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	<b>66.5</b>	67.2	67.4

### SAMPLE IMAGES

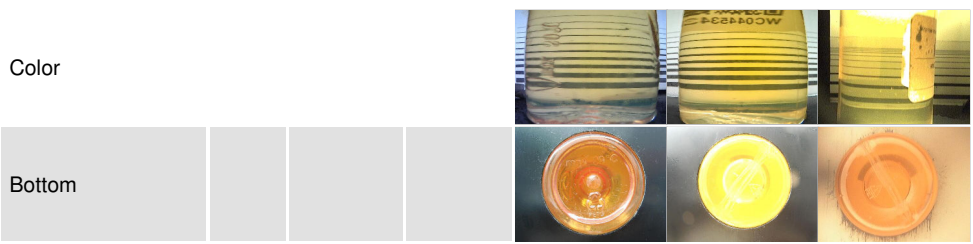

### GRAPHS

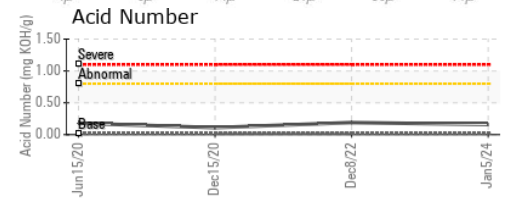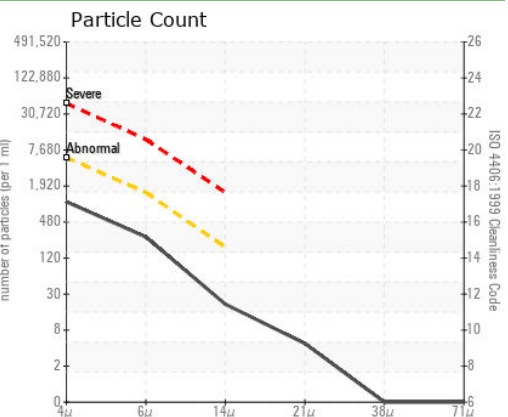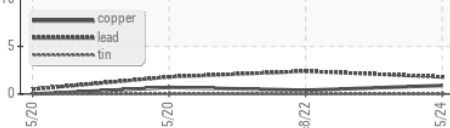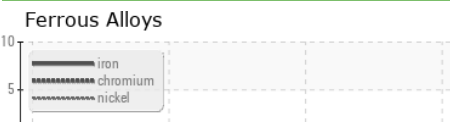

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0706209 **Received** : 09 Jan 2024  
**Lab Number** : **02607498** **Diagnosed** : 11 Jan 2024  
**Unique Number** : 5708584 **Diagnostician** : Wes Davis  
**Test Package** : IND 2 ( Additional Tests: TAN Man )

**NEWFOUNDLAND POWER INC.**  
 50 DUFFY PLACE, PO BOX 8910  
 ST. JOHNS, NL  
 CA A1B 3P6  
 Contact: Paul Martin  
 pmartin@newfoundlandpower.com  
 T:  
 F: (709)737-2926

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.