

OIL ANALYSIS REPORT

Area Linimar Coop - T01200 Machine Id A2401037

Component Quench Oil Fluid {not provided} (--- GAL)

DIAGNOSIS


Recommendation

This is a baseline read-out on the submitted sample.

Wear Iron ppm levels are noted.

Contamination {not applicable}

Fluid Condition {not applicable}

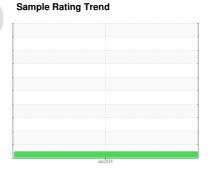



NORMAL


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Batch #		Client Info		2023 12 0330		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Final		
Sent to WC		Client Info		01/05/2024		
Sample Number		Client Info		E30001117		
Sample Date		Client Info		05 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)		12		
Chromium	ppm	ASTM D5185(m)		<1		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)		<1		
Lead	ppm	ASTM D5185(m)		<1		
Copper	ppm	ASTM D5185(m)		7		
Tin	ppm	ASTM D5185(m)		0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		2		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		35		
Phosphorus	ppm	ASTM D5185(m)		95		
Zinc	ppm	ASTM D5185(m)		40		
Sulfur	ppm	ASTM D5185(m)		393		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)		4		
Sodium	ppm	ASTM D5185(m)		5		
Potassium	ppm	ASTM D5185(m)	>20	3		
Water	%	ASTM D6304*		0.002		
ppm Water	ppm	ASTM D6304*		17		





OIL ANALYSIS REPORT

FLUID CLEANLINESS

Particles >4µm

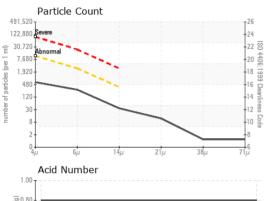

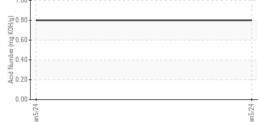


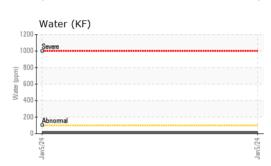

Viscosity @ 100°C

16


15

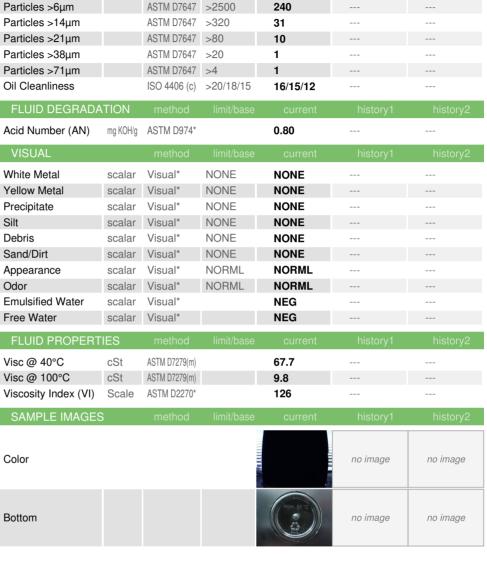

546

>10000

ASTM D7647

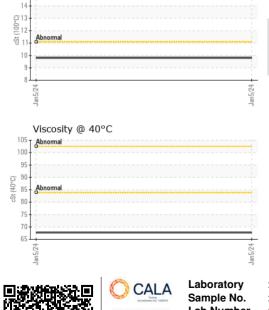

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Environmental 360 Solutions Ltd. Sample No. Recieved : 09 Jan 2024 : E30001117 640 Victoria Street Lab Number Cobourg, ON : 02607588 Diagnosed : 11 Jan 2024 ISO 17025:2017 Accredited CA K9A 5H5 Unique Number : 5708674 Diagnostician : Tatiana Sorkina Laboratory Test Package : IND 2 (Additional Tests: KF, KV100, PrtCount, TAN Man, VI) Contact: Tatiana Sorkina To discuss this sample report, contact Customer Service at 1-905-372-2251. tsorkina@e360s.ca T: (800)263-3939 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied. F: (905)373-4950