




OIL ANALYSIS REPORT

Sample Rating Trend

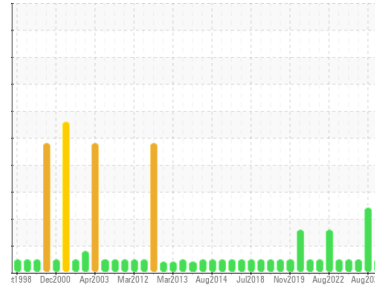

NORMAL



Area
PUMPHOUSE/HOOD COOLING PUMPS
 Machine Id
C - Hood Cooling Pumps Gearbox Oil System
 Component
Gearbox
 Fluid
PETRO CANADA HYDREX AW 100 (45 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0898656	WC0850129	WC0824415
Sample Date	Client Info		10 Jan 2024	16 Aug 2023	31 May 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	ABNORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>5	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*	>DFLT	0	0	0
Iron	ppm	ASTM D5185(m) >200	<1	<1	2
Chromium	ppm	ASTM D5185(m) >15	0	0	0
Nickel	ppm	ASTM D5185(m) >15	0	<1	0
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >25	<1	0	0
Lead	ppm	ASTM D5185(m) >100	5	0	<1
Copper	ppm	ASTM D5185(m) >200	3	<1	9
Tin	ppm	ASTM D5185(m) >25	0	0	0
Antimony	ppm	ASTM D5185(m) >5	0	0	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES






	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	0	<1	0
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	0	0	0
Manganese	ppm	ASTM D5185(m) 0	0	0	0
Magnesium	ppm	ASTM D5185(m) 0	<1	<1	0
Calcium	ppm	ASTM D5185(m) 50	19	28	26
Phosphorus	ppm	ASTM D5185(m) 330	320	351	362
Zinc	ppm	ASTM D5185(m) 430	402	422	391
Sulfur	ppm	ASTM D5185(m) 760	2827	2848	4440
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >50	4	4	<1
Sodium	ppm	ASTM D5185(m)	0	<1	0
Potassium	ppm	ASTM D5185(m) >20	<1	<1	<1



OIL ANALYSIS REPORT

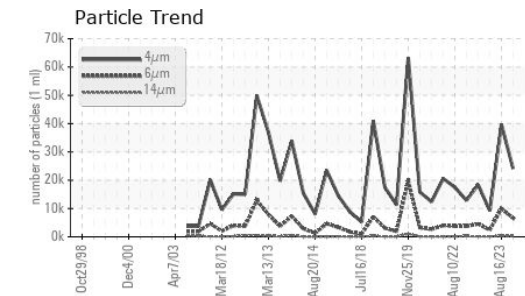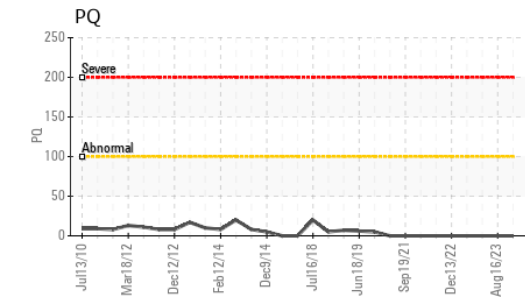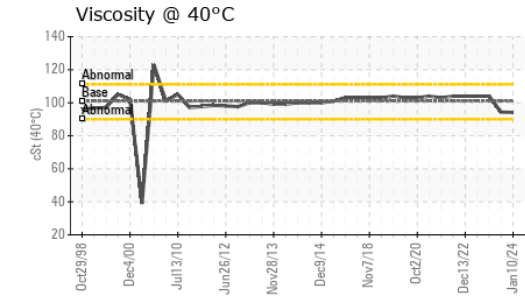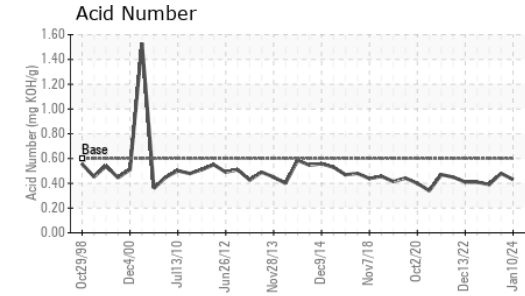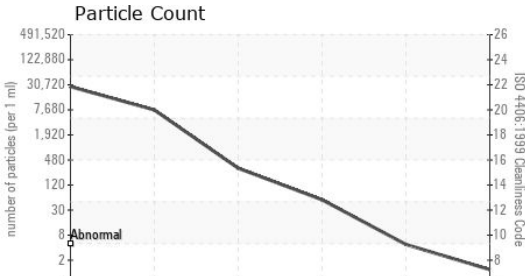

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0898656
Lab Number : 02608051
Unique Number : 5709137
Test Package : IND 2 (Additional Tests: PQ, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.


FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		24137	39754	9218
Particles >6µm	ASTM D7647	>10240000	6658	9899	2405
Particles >14µm	ASTM D7647	>10240000	268	315	125
Particles >21µm	ASTM D7647	>2560000	47	60	24
Particles >38µm	ASTM D7647	>640000	4	1	0
Particles >71µm	ASTM D7647	>160000	1	0	0
Oil Cleanliness	ISO 4406 (c)	>--/30/30	22/20/15	22/20/15	20/18/14

FLUID DEGRADATION	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.60	0.43	0.48	0.39

VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	VLITE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	▲ WGOIL	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>5	NEG	.5%	NEG
Free Water	scalar	Visual*		NEG	▲ 1%	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	101	94.1	94.3	104

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

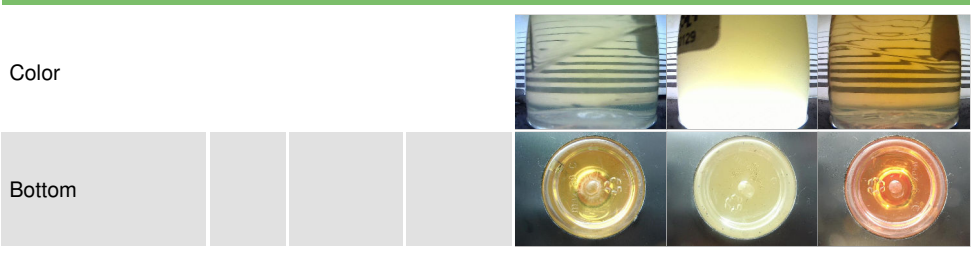

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **STELCO - BOSC - Basic Oxygen Slab Caster**
 2330 Regional Road #3, Door: BOSC8
 NANTICOKE, ON
 CA N0A 1L0
 Contact: Tom Walden
 Thomas.Walden@stelco.com
 T: (519)587-4541
 F: (519)587-7702