

## **PROBLEM SUMMARY**

Sample Rating Trend

CONTAMINANT

X

# Caster/Segment Drives Machine Id B - Strand 2 - 1 Gear Box Roll # 65 Bottom

Component **Gearbox** 

SHELL OMALA 220 (45 GAL)

#### COMPONENT CONDITION SUMMARY

No relevant graphs to display

#### RECOMMENDATION

Technician was unable to draw sample from the machine. Suspect the unit has a very low oil level. We recommend that you check the oil level and top up as required.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				SEVERE	NORMAL	SEVERE
Appearance	scalar	Visual*	NORML	NOOIL	NORML	NOOIL

Customer Id: LEWBOSC Sample No.: WC0898688 Lab Number: 02608075 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

#### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

#### HISTORICAL DIAGNOSIS

#### 30 May 2023 Diag: Bill Quesnel

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. Viscosity of sample indicates oil is within ISO 320 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 14 Sep 2022 Diag: Kevin Marson

#### CONTAMINANT



Recommend check oil level in system. During sampling it was discovered that there is little to no oil present in the system, therefore a complete oil sample could not be taken. {not applicable} Insufficient sample was received to conduct all the routine laboratory tests. {not applicable}



#### 01 Mar 2022 Diag: Kevin Marson

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. Viscosity of sample indicates oil is within ISO 320 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**


Sample Rating Trend

# CONTAMINANT

# Caster/Segment Drives B - Strand 2 - 1 Gear Box Roll # 65 Bottom

Component Gearbox

SHELL OMALA 220 (45 GAL)

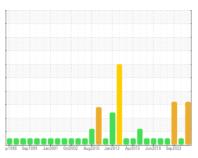



#### DIAGNOSIS

#### Recommendation

Technician was unable to draw sample from the machine. Suspect the unit has a very low oil level. We recommend that you check the oil level and top up as required.

#### Wear

{not applicable}

#### Contamination


{not applicable}

**Fluid Condition** {not applicable}

SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0898688	WC0824365	WC0743652
Sample Date		Client Info		10 Jan 2024	30 May 2023	14 Sep 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				SEVERE	NORMAL	SEVERE
CONTAMINATION	l	method	limit/base	current	history1	history2
Water		WC Method	>5	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*	>DFLT		0	
Iron	ppm	ASTM D5185(m)	>200		10	
Chromium	ppm	ASTM D5185(m)	>15		0	
Nickel	ppm	ASTM D5185(m)	>15		0	
Titanium	ppm	ASTM D5185(m)			0	
Silver	ppm	ASTM D5185(m)			<1	
Aluminum	ppm	ASTM D5185(m)	>25		<1	
Lead	ppm	ASTM D5185(m)	>100		0	
Copper	ppm	ASTM D5185(m)	>200		0	
Tin	ppm	ASTM D5185(m)	>25		0	
Antimony	ppm	ASTM D5185(m)	>5		0	
Vanadium	ppm	ASTM D5185(m)			0	
Beryllium	ppm	ASTM D5185(m)			0	
Cadmium	ppm	ASTM D5185(m)			0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	4.4		25	
Barium	ppm	ASTM D5185(m)	0.0		0	
Molybdenum	ppm	ASTM D5185(m)	0		0	
Manganese	ppm	ASTM D5185(m)			<1	
Magnesium	ppm	ASTM D5185(m)	0		<1	
Calcium	ppm	ASTM D5185(m)	0		<1	
Phosphorus	ppm	ASTM D5185(m)	215		360	
Zinc	ppm	ASTM D5185(m)	0		1	
Sulfur	ppm	ASTM D5185(m)	7039		9820	
Lithium	ppm	ASTM D5185(m)			<1	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50		1	
Sodium	ppm	ASTM D5185(m)			<1	
Potassium	ppm	ASTM D5185(m)	>20		<1	



## **OIL ANALYSIS REPORT**

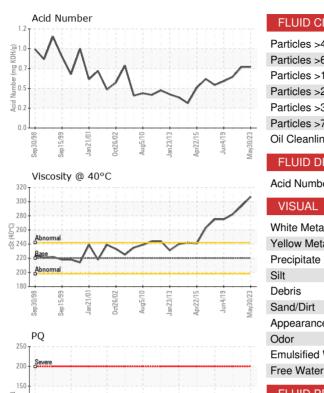

FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			166046	
Particles >6µm		ASTM D7647	>10240000		42461	
Particles >14µm		ASTM D7647	>10240000		2050	
Particles >21µm		ASTM D7647	>2560000		348	
Particles >38µm		ASTM D7647	>640000		4	
Particles >71µm		ASTM D7647	>160000		0	
Oil Cleanliness		ISO 4406 (c)	>/30/30		25/23/18	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*			0.74	
VISUAL		method	limit/base	current	history1	history2
Vhite Metal	scalar	Visual*	NONE	NONE	NONE	NONE
'ellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	VLITE	NONE
Appearance	scalar	Visual*	NORML	NOOIL	NORML	NOOIL
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>5	NEG	NEG	
ree Water	scalar	Visual*		NEG	NEG	
FLUID PROPERT	TIES	method	limit/base	current	history1	history2
/isc @ 40°C	cSt	ASTM D7279(m)	220		307	
SAMPLE IMAGE	S	method	limit/base	current	history1	history2
Color						
				The same of the sa		The said
Bottom					(C) 0 8	



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5709161

: WC0898688

: 02608075

Recieved Diagnosed Diagnostician : Kevin Marson

: 10 Jan 2024 : 11 Jan 2024

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 STELCO - BOSC - Basic Oxygen Slab Caster 2330 Regional Road #3, Door: BOSC8

NANTICOKE, ON CA NOA 1L0 Contact: Tom Walden

Test Package : IND 2 ( Additional Tests: PQ, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: (519)587-4541 F: (519)587-7702

Thomas.Walden@stelco.com