




OIL ANALYSIS REPORT

Sample Rating Trend

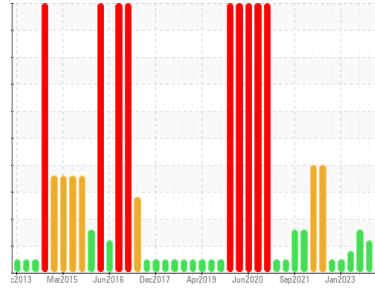

NORMAL



Area
6 Calender Line
 Machine Id
39-0036 North Cooling Mixer
 Component
Gearbox
 Fluid
MOBIL GLYGOYLE 30 (70 LTR)

DIAGNOSIS

Recommendation
 Resample at the next service interval to monitor.

Wear
 All component wear rates are normal.

Contamination
 There is no indication of any contamination in the oil.

Fluid Condition
 The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0867512	WC0808300	WC0782354
Sample Date	Client Info		04 Jan 2024	04 Oct 2023	06 Jul 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	ABNORMAL	ABNORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>200	74	82	30
Chromium	ppm	ASTM D5185(m)	>15	1	1	▲ 18
Nickel	ppm	ASTM D5185(m)	>15	<1	0	<1
Titanium	ppm	ASTM D5185(m)		4	▲ 5	1
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>25	2	2	<1
Lead	ppm	ASTM D5185(m)	>100	<1	<1	7
Copper	ppm	ASTM D5185(m)	>200	14	10	184
Tin	ppm	ASTM D5185(m)	>25	<1	<1	▲ 27
Antimony	ppm	ASTM D5185(m)	>5	7	▲ 8	2
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES


	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		21	28	24
Barium	ppm	ASTM D5185(m)		0	<1	2
Molybdenum	ppm	ASTM D5185(m)		0	0	<1
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)		<1	<1	1
Calcium	ppm	ASTM D5185(m)		425	553	347
Phosphorus	ppm	ASTM D5185(m)		1152	1161	1153
Zinc	ppm	ASTM D5185(m)		2	2	7
Sulfur	ppm	ASTM D5185(m)		232	245	115
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>50	7	8	14
Sodium	ppm	ASTM D5185(m)		2	2	3
Potassium	ppm	ASTM D5185(m)	>20	6	<1	4




OIL ANALYSIS REPORT

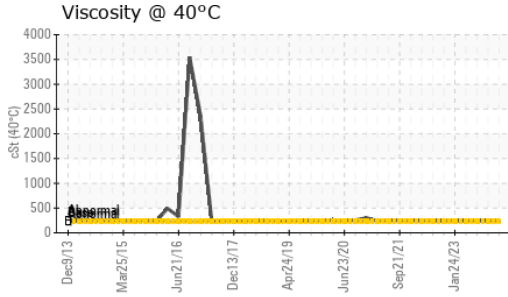


VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	VLITE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	224	237	242	241

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

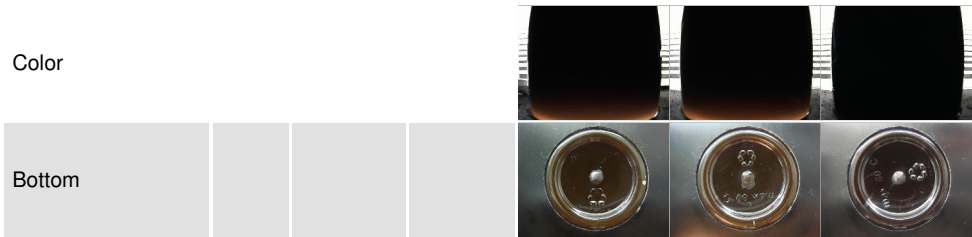

GRAPHS

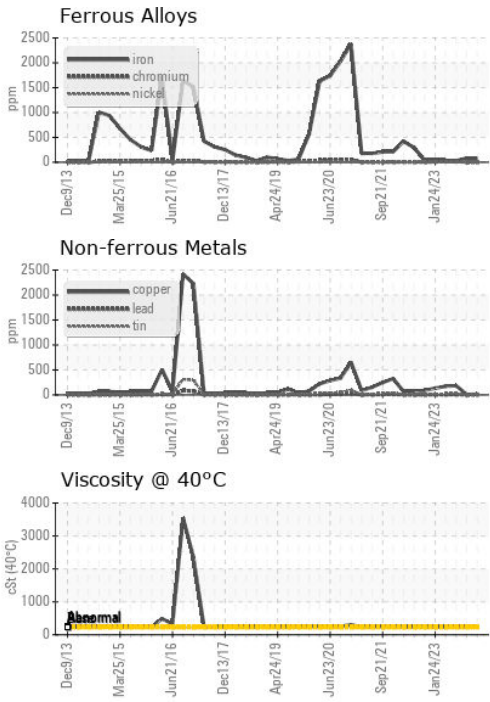

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **CANADIAN GENERAL TOWER LTD.**
Sample No. : WC0867512 **Received** : 11 Jan 2024 52 MIDDLETON STREET, P.O. BOX 160
Lab Number : **02608313** **Diagnosed** : 11 Jan 2024 CAMBRIDGE, ON
Unique Number : 5709399 **Diagnostician** : Wes Davis CA N1S 2R4
Test Package : IND 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Bob Abell
 bob.abell@cgtower.com
 T: (519)623-1630
 F: (519)623-7018