

OIL ANALYSIS REPORT

1

Area [0069751-H01333] CARRIER 634615(2)

Component Chiller

NU-CALGON C-3 (RO15)ISO 32 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

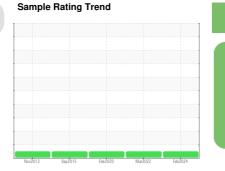



NORMAL

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0002139	GTT19666	GTT19667
Sample Date		Client Info		05 Feb 2024	15 Mar 2022	20 Feb 2020
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	0	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	0	<1	<1
Copper	ppm	ASTM D5185(m)	>8	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>4	0	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		0		
Phosphorus	ppm	ASTM D5185(m)		0		
Zinc	ppm	ASTM D5185(m)		<1	1	<1
Sulfur	ppm	ASTM D5185(m)	200	186		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	11		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	<1		
ppm Water	ppm	ASTM D6304*	>25	3	28	18
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.014	0.02	0.027	0.003



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2		
White Metal	scalar	Visual*	NONE	NONE				
Yellow Metal	scalar	Visual*	NONE	NONE				
Precipitate	scalar	Visual*	NONE	NONE				
Silt	scalar	Visual*	NONE	NONE				
Debris	scalar	Visual*	NONE	NONE				
Sand/Dirt	scalar	Visual*	NONE	NONE				
Appearance	scalar	Visual*	NORML	NORML				
Odor	scalar	Visual*	NORML	NORML				
FLUID PROPERTIES		method	limit/base	current	history1	history2		
Visc @ 40°C	cSt	ASTM D7279(m)	33.0	33.6				
SAMPLE IMAGES		method	limit/base	current	history1	history2		
Color					no image	no image		
Bottom					no image	no image		
GRAPHS								



 Sample No.
 : GTT0002139
 Received
 : 08 Mar 2024
 11

 Lab Number
 : 02621007
 Tested
 : 11 Mar 2024

 Unique Number
 : 5746126
 Diagnosed
 : 11 Mar 2024 - Bill Quesnel

 Test Package
 : IND 2 (Additional Tests: KV40)
 Contact

 To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26.
 pca

 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

Baulne Inc 1850 32nd Avenue Montreal, QC CA H8T 3J7 Contact: Paula Carvalho pcarvalho@baulne.ca T: (514)422-0444 use. F:

Contact/Location: Paula Carvalho - GTT0000213