


OIL ANALYSIS REPORT

ORIN CONTRACTORS **378**

Component

Right Final Drive

PETRO CANADA TRAXON 80W90 (--- GAL)

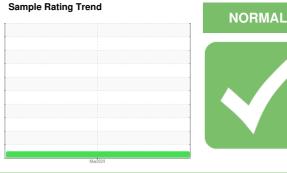

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

,				Mar2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0899550		
Sample Date		Client Info		01 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	462		
Chromium	ppm	ASTM D5185(m)	>10	8		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	1		
Lead	ppm	ASTM D5185(m)	>25	<1		
Copper	ppm	ASTM D5185(m)	>50	1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	243	18		
Barium	ppm	ASTM D5185(m)	1	<1		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		7		
Magnesium	ppm	ASTM D5185(m)	2	7		
Calcium	ppm	ASTM D5185(m)	6	2325		
Phosphorus	ppm	ASTM D5185(m)	987	919		
Zinc	ppm	ASTM D5185(m)	1	820		
Sulfur	ppm	ASTM D5185(m)	21530	9893		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	14		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	1		




OIL ANALYSIS REPORT

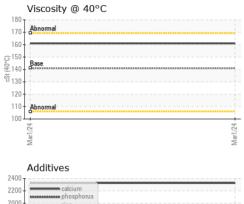

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	VLITE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	141.0	161		

2200 calcium phosphorus 1800 zinc 1800 til 1400 til 1200 til 1000
2000
[8 1600 - 1400 - 1200 - 1000 - 800
1400 1200 1000 800
1400 1200 1000 800
1000
800
24
Mar1/24

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			J	no image	no image
Bottom				no image	no image
GRAPHS					
Iron (ppm)			Lead (ppm)		

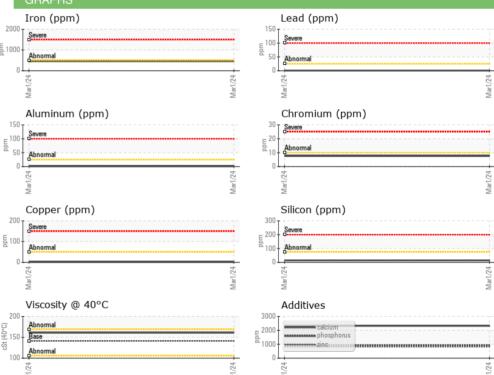



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number : 02621148

: WC0899550

Unique Number : 5746267

Received **Tested** Diagnosed

: 11 Mar 2024 : 11 Mar 2024 : 12 Mar 2024 - Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. 100 MACINTOSH BLVD

VAUGHAN, ON CA L4K 4P3 Contact: Service Team service.team@roni.ca

Test Package: MOBCE (Additional Tests: Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Validity of results and interpretation are based on the sample and information as supplied.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

T:

F: