


OIL ANALYSIS REPORT



RONI 9-101 Component

Rear Left Final Drive

PETRO CANADA 50W (--- GAL)

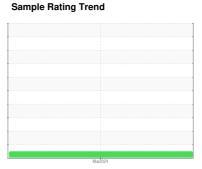



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

Viscosity of sample indicates oil is within SAE 50 range, advise investigate. The condition of the oil is acceptable for the time in service.

(GAL)				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0899470		
Sample Date		Client Info		06 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>800	18		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>5	<1		
Titanium	ppm	ASTM D5185(m)	>15	0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>75	9		
Lead	ppm	ASTM D5185(m)	>10	<1		
Copper	ppm	ASTM D5185(m)	>75	12		
Tin	ppm	ASTM D5185(m)	>8	0		
Antimony	ppm	ASTM D5185(m)	>50	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		907		
Calcium	ppm	ASTM D5185(m)		1083		
Phosphorus	ppm	ASTM D5185(m)		1120		
Zinc	ppm	ASTM D5185(m)		1223		
Sulfur	ppm	ASTM D5185(m)		3612		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>400	14		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	1		




OIL ANALYSIS REPORT

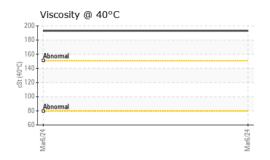

VISUAL		method				history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	TIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		193		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2

SAMPLE IMAGES	metnoa	ilmit/base	current	nistory i	nistory2
Color				no image	no image
Bottom			(C)*	no image	no image
GRAPHS					

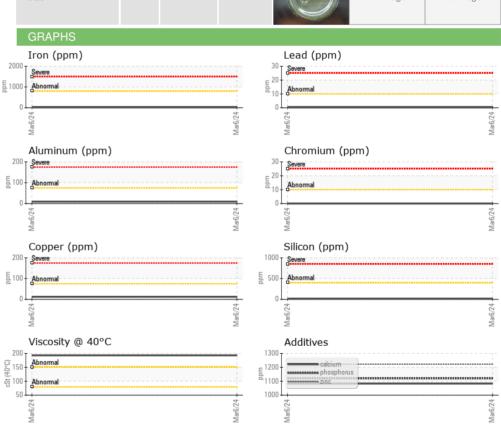



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WC0899470

Lab Number : 02621219

Received **Tested** Unique Number : 5746338 Diagnosed

: 11 Mar 2024 : 11 Mar 2024

: 11 Mar 2024 - Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. 100 MACINTOSH BLVD VAUGHAN, ON

CA L4K 4P3 Contact: Service Team

Test Package: MOBCE (Additional Tests: Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

service.team@roni.ca T:

Validity of results and interpretation are based on the sample and information as supplied.

F: