


OIL ANALYSIS REPORT

Sample Rating Trend



WATER

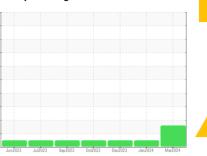

Machine Id **2229**

Component **Natural Gas Engine**

VALVOLINE PREMIUM BLUE 9200 15W40 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check for the source of water entry. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is a moderate concentration of water present in the oil. Test for glycol is negative.


Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

(GAL)		Jun2023	Jul2023 Sep2023	Oct2023 Dec2023 Jan2024	Mar2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0878024	WC0890981	WC0878129
Sample Date		Client Info		06 Mar 2024	19 Jan 2024	06 Dec 2023
Machine Age	kms	Client Info		65177	55239	0
Oil Age	kms	Client Info		0	0	0
Oil Changed		Client Info		N/A	Changed	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>50	8	8	8
Chromium	ppm	ASTM D5185(m)	>4	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	<1	0	<1
Aluminum	ppm	ASTM D5185(m)	>9	1	1	1
Lead	ppm	ASTM D5185(m)	>30	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>35	1	1	<1
Tin	ppm	ASTM D5185(m)	>4	<1	<1	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		25	15	23
Barium	ppm	ASTM D5185(m)		0	0	<1
Molybdenum	ppm	ASTM D5185(m)		55	55	53
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		834	803	803
Calcium	ppm	ASTM D5185(m)		1232	1272	1212
Phosphorus	ppm	ASTM D5185(m)		734	678	692
Zinc	ppm	ASTM D5185(m)		871	892	867
Sulfur	ppm	ASTM D5185(m)		2070	2137	1930
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>+100	4	4	4
Sodium	ppm	ASTM D5185(m)		5	3	3
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
Water	%	ASTM D6304*	>0.1	△ 0.143		
ppm Water	ppm	ASTM D6304*	>1000	<u> </u>		
Glycol	%	ASTM D7922*		0.0		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*		0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	10.6	12.3	10.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	22.6	22.0	22.0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	18.7	19.5	18.9



OIL ANALYSIS REPORT

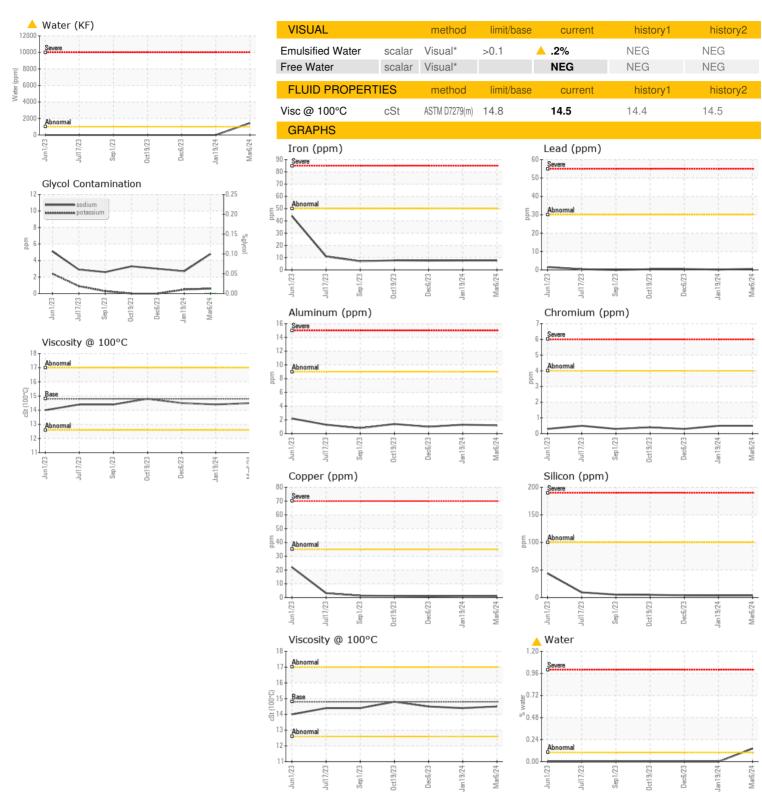



CALA ISO 17025:2017 Accredited

Laboratory

Sample No.

: WC0878024 Lab Number : 02621746

Unique Number : 5746865 Test Package : MOB 1 (Additional Tests: Glycol, KF)

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested**

Diagnosed

: 13 Mar 2024 : 14 Mar 2024

: 15 Mar 2024 - Kevin Marson

CITY OF HAMILTON 2200 UPPER JAMES,, MOUNTAIN TRANSIT STOREROOM MOUNT HOPE, ON

CA LOR 1W0 Contact: Ron Skinner ron.skinner@hamilton.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (905)679-4502

T: