



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
DEC 4124

Component
Hydraulic System

Fluid
LANXESS ROYCO 756 (--- GAL)



DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

Viscosity of sample indicates oil is within ISO 15 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0920425	---	---
Sample Date	Client Info		12 Mar 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.05	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>20	0	---	---
Chromium	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>20	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	<1	---	---
Lead	ppm	ASTM D5185(m)	>20	0	---	---
Copper	ppm	ASTM D5185(m)	>20	0	---	---
Tin	ppm	ASTM D5185(m)	>20	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		0	---	---
Barium	ppm	ASTM D5185(m)	0	4	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		<1	---	---
Calcium	ppm	ASTM D5185(m)		6	---	---
Phosphorus	ppm	ASTM D5185(m)		414	---	---
Zinc	ppm	ASTM D5185(m)		3	---	---
Sulfur	ppm	ASTM D5185(m)		117	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS




	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>15	0	---	---
Sodium	ppm	ASTM D5185(m)		0	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	4894	---	---
Particles >6µm	ASTM D7647	>1300	1026	---	---
Particles >14µm	ASTM D7647	>160	29	---	---
Particles >21µm	ASTM D7647	>40	5	---	---
Particles >38µm	ASTM D7647	>10	1	---	---
Particles >71µm	ASTM D7647	>3	0	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	19/17/12	---	---



OIL ANALYSIS REPORT

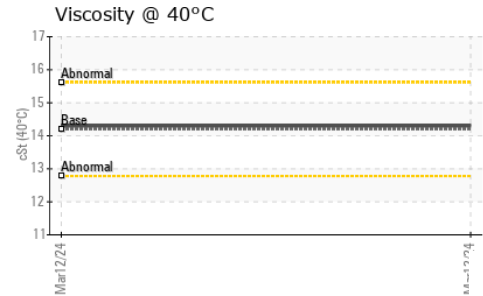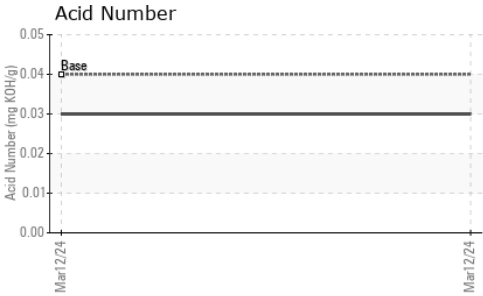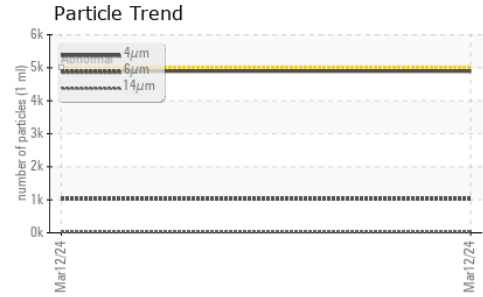



FLUID DEGRADATION	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.04	0.03	---	---




VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	14.2	14.3	---	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

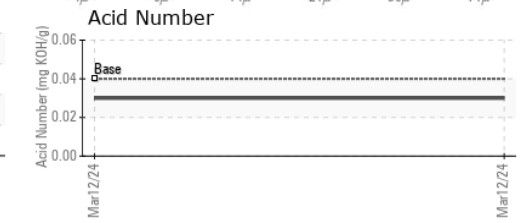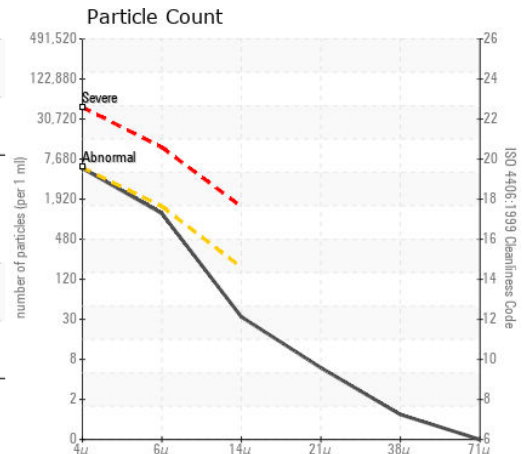

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0920425 **Received** : 13 Mar 2024
Lab Number : **02621766** **Tested** : 14 Mar 2024
Unique Number : 5746885 **Diagnosed** : 14 Mar 2024 - Kevin Marson
Test Package : IND 2

Safran Landing Systems
 574 Monarch Ave
 Ajax, ON
 CA L1S 2G8
 Contact: Stuart Potter
 stuart.potter@safrangroup.com
 T:
 F: (905)683-6983

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.