

OIL ANALYSIS REPORT

Red oil room/Rig 2 DEC 3983

Component

Hydraulic System

LANXESS ROYCO 756 (--- GAL)

Sample Rating Trend



ט	IA	٦ľ	VU	0	10

Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Mar2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0920416		
Sample Date		Client Info		12 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIO	DΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	0		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	<1		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0		
Barium	ppm	ASTM D5185(m)	0	5		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		440		
Zinc	ppm	ASTM D5185(m)		<1		
Sulfur	ppm	ASTM D5185(m)		94		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
FLUID CLEANLI	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	418		
Particles >6µm		ASTM D7647	>1300	100		
Particles >14µm		ASTM D7647	>160	7		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		

ISO 4406 (c) >19/17/14

Oil Cleanliness



OIL ANALYSIS REPORT

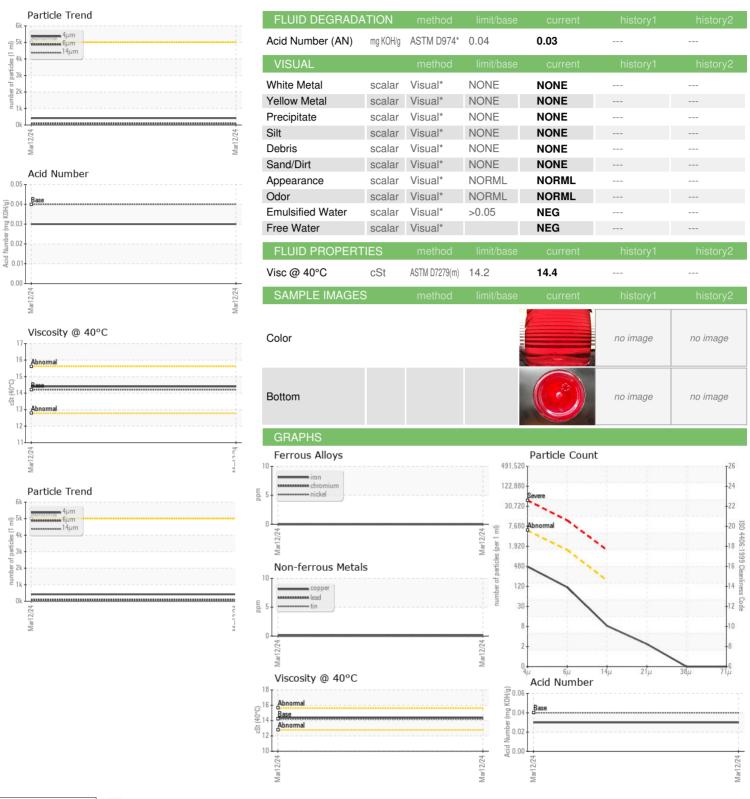



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

Unique Number : 5746889 Test Package : IND 2

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0920416 Received : 02621770

Validity of results and interpretation are based on the sample and information as supplied.

Tested Diagnosed

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

: 13 Mar 2024

: 14 Mar 2024

: 14 Mar 2024 - Wes Davis

Safran Landing Systems

574 Monarch Ave Ajax, ON **CA L1S 2G8**

Contact: Stuart Potter stuart.potter@safrangroup.com

> T: F: (905)683-6983

Contact/Location: Stuart Potter - SAFAJA2