

# **OIL ANALYSIS REPORT**

Injectik - 106900 A2403090

Component **Hydraulic System** 

AW HYDRAULIC OIL ISO 46 (--- GAL)

# Sample Rating Trend WEAR

# Recommendation

This is a baseline read-out on the submitted sample.


# Wear

Copper ppm levels are noted.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Batch #		Client Info		2024 02 0590		
Department		Client Info		Production		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		03/13/2024		
Sample Number		Client Info		E30001681		
Sample Date		Client Info		13 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	7		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>10	<1		
Lead	ppm	ASTM D5185(m)	>20	<1		
Copper	ppm	ASTM D5185(m)	>20	<u> </u>		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	<1		
Barium	ppm	ASTM D5185(m)	5	10		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	25	5		
Calcium	ppm	ASTM D5185(m)	200	170		
Phosphorus	ppm	ASTM D5185(m)	300	360		
Zinc	ppm	ASTM D5185(m)	370	410		
Sulfur	ppm	ASTM D5185(m)	2500	2997		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	2		



# **OIL ANALYSIS REPORT**

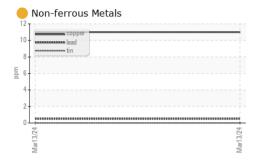

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES		method	limit/base	current	history1	history2

		•
Color	no image	no image
Bottom	no image	no image
GRAPHS		



**CALA** ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : E30001681 Lab Number : 02622492

Unique Number : 5747611 Test Package : TEST ( Additional Tests: ICP )

Received : 15 Mar 2024 **Tested** Diagnosed

: 15 Mar 2024

: 18 Mar 2024 - Tatiana Sorkina

CA K9A 5H5 Contact: Tatiana Sorkina tsorkina@e360s.ca

Environmental 360 Solutions Ltd.

T: (800)263-3939 F: (905)373-4950

640 Victoria Street

Cobourg, ON

To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.