

FUEL REPORT

Sample Rating Trend

NORMAL



Area
[R1-24207]
Machine Id
6VF22101

Component
Diesel Fuel
Fluid

No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- GAL)



DIAGNOSIS

Recommendation

Please contact your representative for information regarding the proper sampling kits for your service.

Contaminants

There is no indication of any contamination in the component(unconfirmed).

Fuel Condition

Not enough sample submitted to determine fuel condition and/or classification.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info	VPA058950	---	---
Sample Date	Client Info	06 Mar 2024	---	---
Machine Age	hrs	Client Info	134	---
Sample Status			NORMAL	---

PHYSICAL PROPERTIES method limit/base current history1 history2

Visc @ 40°C	cSt	ASTM D7279(m)	3.0	2.9	---	---
-------------	-----	---------------	-----	------------	-----	-----

SULFUR CONTENT method limit/base current history1 history2

Sulfur	ppm	ASTM D5185(m)	10	<1	---	---
--------	-----	---------------	----	--------------	-----	-----

CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185(m)	<1.0	0	---	---
Sodium	ppm	ASTM D5185(m)	<0.1	<1	---	---
Potassium	ppm	ASTM D5185(m)	<0.1	0	---	---

HEAVY METALS method limit/base current history1 history2



Aluminum	ppm	ASTM D5185(m)	<0.1	0	---	---
Nickel	ppm	ASTM D5185(m)	<0.1	0	---	---
Lead	ppm	ASTM D5185(m)	<0.1	0	---	---
Vanadium	ppm	ASTM D5185(m)	<0.1	0	---	---
Iron	ppm	ASTM D5185(m)	<0.1	0	---	---
Calcium	ppm	ASTM D5185(m)	<0.1	0	---	---
Magnesium	ppm	ASTM D5185(m)	<0.1	0	---	---
Phosphorus	ppm	ASTM D5185(m)	<0.1	0	---	---
Zinc	ppm	ASTM D5185(m)	<0.1	0	---	---

SAMPLE IMAGES method limit/base current history1 history2

Color					no image	no image
Bottom					no image	no image

FUEL REPORT

GRAPHS

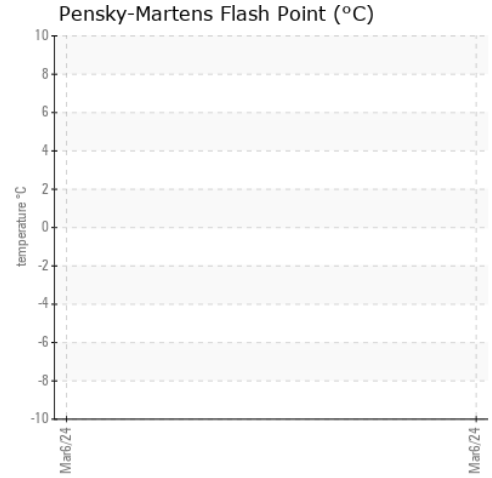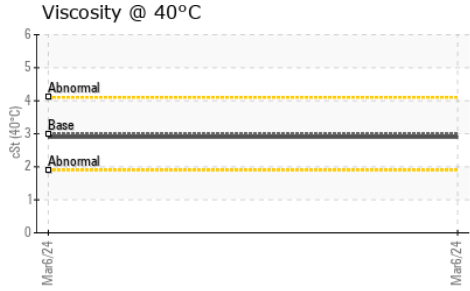

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : VPA058950
Lab Number : 02623583
Unique Number : 5748702
Test Package : MOB 1

CULLEN DIESEL POWER - 695335
 9300 192 ST
 SURREY, BC
 CA V4N 3R8
 Contact: Michelle Sayers
 mns@cullendiesel.com
 T: (604)888-1211
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.