


OIL ANALYSIS REPORT



NORMAL

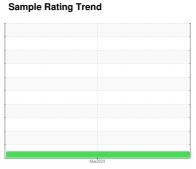

Machine Id 100-048

Component **Left Final Drive**

PETRO CANADA TRAXON 80W90 (--- GAL

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

				Mar 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0920790		
Sample Date		Client Info		16 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		285		
Iron	ppm	ASTM D5185(m)	>500	509		
Chromium	ppm	ASTM D5185(m)	>10	10		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		3		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	53		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	243	1		
Barium	ppm	ASTM D5185(m)	1	6		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		6		
Magnesium	ppm	ASTM D5185(m)	2	17		
Calcium	ppm	ASTM D5185(m)	6	185		
Phosphorus	ppm	ASTM D5185(m)	987	270		
Zinc	ppm	ASTM D5185(m)	1	8		
Sulfur	ppm	ASTM D5185(m)	21530	13476		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	231		
Sodium	ppm	ASTM D5185(m)		15		
Potassium	ppm	ASTM D5185(m)	>20	19		



OIL ANALYSIS REPORT

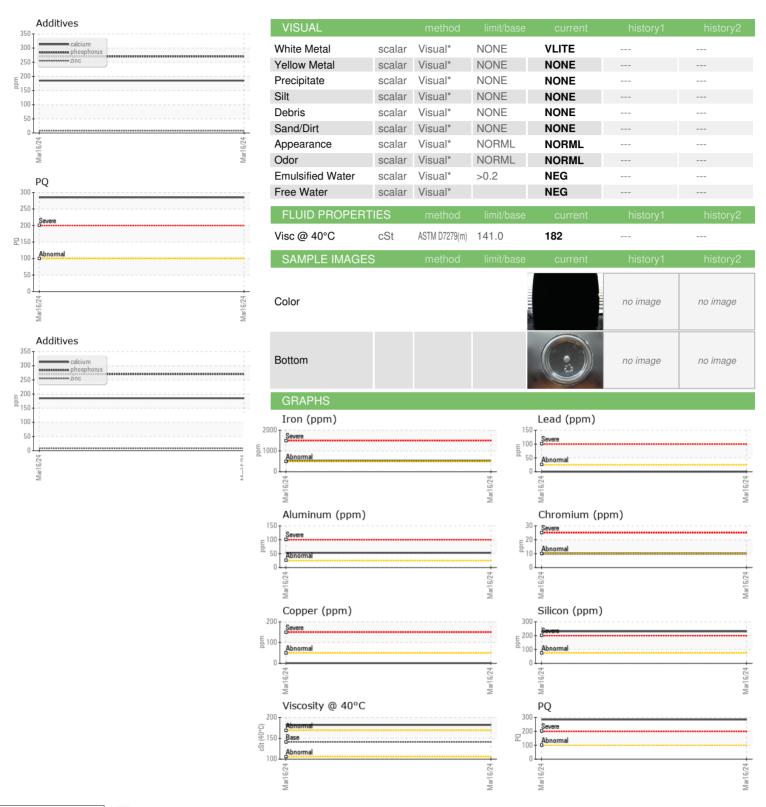





Laboratory Sample No.

Lab Number : 02624381 Unique Number : 5749500

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. : WC0920790

Received **Tested** Diagnosed

: 26 Mar 2024 - Kevin Marson Test Package: MOBCE (Additional Tests: PQ, Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Contact/Location: Service Team - RONVAU

: 25 Mar 2024

: 26 Mar 2024

100 MACINTOSH BLVD

Contact: Service Team

service.team@roni.ca

VAUGHAN, ON

CA L4K 4P3

T: F: