


OIL ANALYSIS REPORT







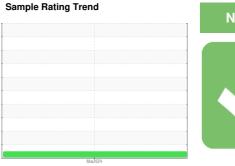

CATERPILLAR AD30 TRK228

Component **Front Left Planetary**

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

RO TO-4 SAE 50 (-	GAL)			Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0915109		
Sample Date		Client Info		24 Mar 2024		
Machine Age	hrs	Client Info		1357		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>500	265		
Chromium	ppm	ASTM D5185(m)	>10	2		
Nickel	ppm	ASTM D5185(m)	>10	1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	4		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>75	29		
Tin	ppm	ASTM D5185(m)	>10	<1		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	2	14		
Barium	ppm	ASTM D5185(m)	0	<1		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)	0	2		
Magnesium	ppm	ASTM D5185(m)	9	9		
Calcium	ppm	ASTM D5185(m)	3114	2997		
Phosphorus	ppm	ASTM D5185(m)	1099	796		
Zinc	ppm	ASTM D5185(m)	1245	907		
Sulfur	ppm	ASTM D5185(m)	7086	10951		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	22		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		




OIL ANALYSIS REPORT

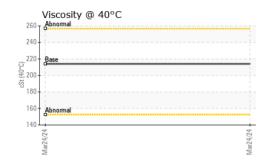

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	213.9	214		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
CDADUC					

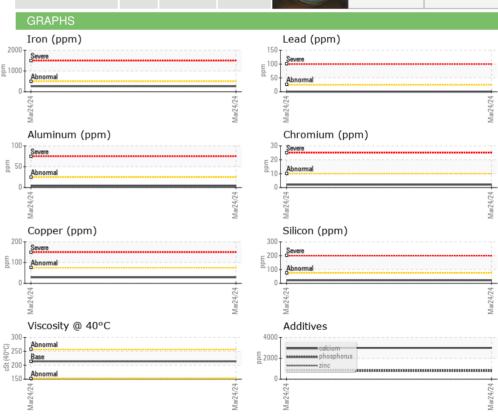



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02624775 Unique Number : 5749894

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0915109

Received **Tested** Diagnosed

: 26 Mar 2024 : 26 Mar 2024

: 26 Mar 2024 - Wes Davis

Agnico Eagle Canada 1350 Government Rd. W, MACASSA COMPLEX

Kirkland Lake, ON **CA P2N 3J1** Contact: Mitch Lamontagne

Test Package : MOB 1 To discuss this sample report, contact Customer Service at 1-800-268-2131.

AEM_KL_macassaoilsampleresults@agnicoeagle.com T: (705)567-5208

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (705)567-5221