

OIL ANALYSIS REPORT

Ventra Plastics - V00400 A2403164

Component

Hydraulic System

{not provided} (--- GAL)

Sample Rating Trend WEAR

Recommendation

This is a baseline read-out on the submitted sample.


Wear

Copper and iron ppm levels are noted.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Batch #		Client Info		2024 03 0520		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		03/25/2024		
Sample Number		Client Info		E30001755		
Sample Date		Client Info		25 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	29		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>10	<1		
Lead	ppm	ASTM D5185(m)	>20	1		
Copper	ppm	ASTM D5185(m)	>20	<u> </u>		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		2		
Barium	ppm	ASTM D5185(m)		8		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		8		
Phosphorus	ppm	ASTM D5185(m)		321		
Zinc	ppm	ASTM D5185(m)		317		
Sulfur	ppm	ASTM D5185(m)		1086		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<1		
Sodium	ppm	ASTM D5185(m)		4		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

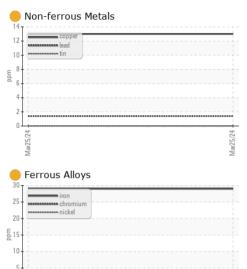

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
			22			
Bottom					no image	no image



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : E30001755 Lab Number : 02625090

Unique Number : 5750209

Received **Tested** Diagnosed Test Package : TEST (Additional Tests: ICP)

: 27 Mar 2024 : 27 Mar 2024

: 28 Mar 2024 - Tatiana Sorkina

Environmental 360 Solutions Ltd.

Contact: Tatiana Sorkina tsorkina@e360s.ca T: (800)263-3939

640 Victoria Street

F: (905)373-4950

Cobourg, ON

CA K9A 5H5

To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.