


OIL ANALYSIS REPORT

Sample Rating Trend





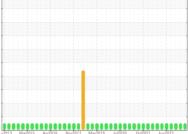

		vzors marzo	10 Apr2010 100V2017	may2013 0002020 0012021	0002023	
SAMPLE INFOF	RMATION	method	limit/base	current	history1	history
Sample Number		Client Info		WC0890867	WC0801616	WC085809
Sample Date		Client Info		27 Mar 2024	07 Jan 2024	25 Oct 202
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATIO	NC	method	limit/base	current	history1	history
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history
Iron	ppm	ASTM D5185(m)	>85	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>40	0	<1	0
Lead	ppm	ASTM D5185(m)	>60	0	0	0
Copper	ppm	ASTM D5185(m)	>7	0	<1	<1
Tin	ppm	ASTM D5185(m)	>40	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history
Boron	ppm	ASTM D5185(m)	0	0	0	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Calcium	ppm	ASTM D5185(m)	0	0	0	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	<1	0	<1
Zinc	ppm	ASTM D5185(m)	0	<1	<1	<1
Sulfur	ppm	ASTM D5185(m)		1796	1904	1817
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANT	S	method	limit/base	current	history1	history
Silicon	ppm	ASTM D5185(m)	>20	3	4	4
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	0	<1	0
FLUID CLEANLI	INESS	method	limit/base	current	history1	history
Particles >4µm		ASTM D7647	>10000	147	709	172
Particles >6µm		ASTM D7647	>1300	58	178	38
Particles >14µm		ASTM D7647	>160	10	14	5
Particles >21µm		ASTM D7647	>40	5	5	2
· ••• ••• • • • • • • • • • • • • • • •						
		ASTM D7647	>10	2	2	1
Particles >38µm Particles >71µm		ASTM D7647 ASTM D7647		2 1	2	1 0
Particles >38µm						

SAB2 G22 Component **Thrust Bearing** Fluid ESSO TERESSO ISO 46 (5000 LTR)

DIAGNOSIS

Area SAB2

Recommendation

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear

Component wear rates appear to be normal (unconfirmed).

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





Particle Filter (Magn: 100 x)


Report Id: ONTQUE [WCAMIS] 02625247 (Generated: 04/01/2024 09:19:52) Rev: 1



OIL ANALYSIS REPORT

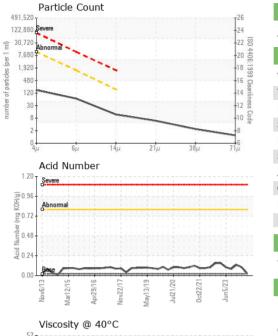

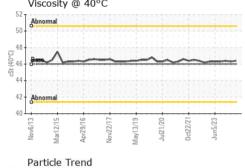

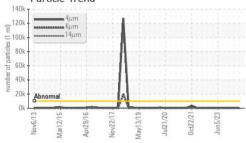

FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.03	0.10	0.13
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	46.4	46.3	46.4
SAMPLE IMAGES	5	method	limit/base	current	history1	history2
			S.		the second second	E

Color

Bottom



PrtFilter



: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **Ontario Power Generation** Laboratory CALA Sample No. : WC0890867 Received : 28 Mar 2024 NIAGARA PLANT GROUP,, 14000 NIAGARA PKWY Lab Number : 02625247 Tested : 01 Apr 2024 NIAGARA ON THE LAKE, ON ISO 17025:2017 Accredited Laboratory Unique Number : 5750366 Diagnosed : 01 Apr 2024 - Kevin Marson CA LOS 1J0 Test Package : IND 2 (Additional Tests: BottomAnalysis, FilterPatch, PrtFilter, TAN Man Contact: Alex Courtemanche To discuss this sample report, contact Customer Service at 1-800-268-2131. alex.courtemanche@opg.com Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: (905)357-0322 Validity of results and interpretation are based on the sample and information as supplied. F: (905)357-6558