


OIL ANALYSIS REPORT

Area Injectik - 106900 A2403175

Hydraulic System

Fluid AW HYDRAULIC OIL ISO 46 (--- GAL)

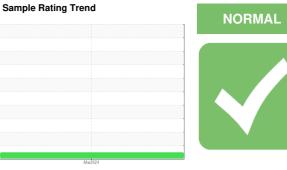

Recommendation

This is a baseline read-out on the submitted sample.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base		history1	history2
Batch #		Client Info		2024 03 0740		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		03/27/2024		
Sample Number		Client Info		E30001766		
Sample Date		Client Info		27 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	1	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	6		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>10	0		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	2		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	<1		
Barium	ppm	ASTM D5185(m)	5	6		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	25	5		
Calcium	ppm	ASTM D5185(m)	200	148		
Phosphorus	ppm	ASTM D5185(m)	300	344		
Zinc	ppm	ASTM D5185(m)	370	401		
Sulfur	ppm	ASTM D5185(m)	2500	2659		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	MODER		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	WGOIL		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES	;	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
GRAPHS						



CALA ISO 17025:2017 Accredited Laboratory

Laboratory

Sample No. : E30001766 Lab Number : 02625859 Unique Number : 5758991

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Test Package: TEST (Additional Tests: ICP)

Received **Tested** Diagnosed

: 01 Apr 2024 : 02 Apr 2024

: 03 Apr 2024 - Tatiana Sorkina

CA K9A 5H5 Contact: Tatiana Sorkina tsorkina@e360s.ca

Environmental 360 Solutions Ltd.

T: (800)263-3939 F: (905)373-4950

640 Victoria Street Cobourg, ON

To discuss this sample report, contact Customer Service at 1-905-372-2251. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied. Contact/Location: Tatiana Sorkina - CHECOB