




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

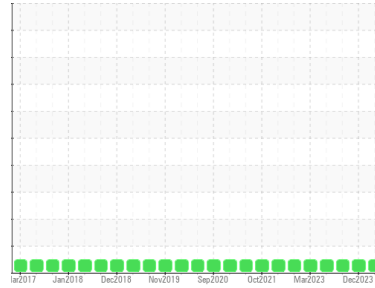

Machine Id  
**LLG1LOS**  
 Component  
**Hydraulic System**  
 Fluid  
**SHELL TELLUS S2 M 46 (900 LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0843679</b>	WC0843687	WC0843697
Sample Date	Client Info			<b>25 Mar 2024</b>	21 Dec 2023	26 Sep 2023
Machine Age	days	Client Info		<b>0</b>	0	0
Oil Age	days	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>20	<b>19</b>	19	20
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>0</b>	0	0
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>9</b>	10	9
Calcium	ppm	ASTM D5185(m)		<b>32</b>	33	32
Phosphorus	ppm	ASTM D5185(m)		<b>231</b>	236	235
Zinc	ppm	ASTM D5185(m)		<b>235</b>	242	245
Sulfur	ppm	ASTM D5185(m)		<b>936</b>	1021	975
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>0</b>	0	0
Sodium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	11	<1

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>182</b>	139	1163
Particles >6µm		ASTM D7647	>1300	<b>59</b>	54	417
Particles >14µm		ASTM D7647	>160	<b>8</b>	7	44
Particles >21µm		ASTM D7647	>40	<b>3</b>	2	11
Particles >38µm		ASTM D7647	>10	<b>1</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>15/13/10</b>	14/13/10	17/16/13



# OIL ANALYSIS REPORT

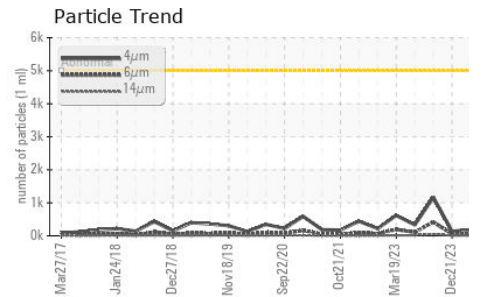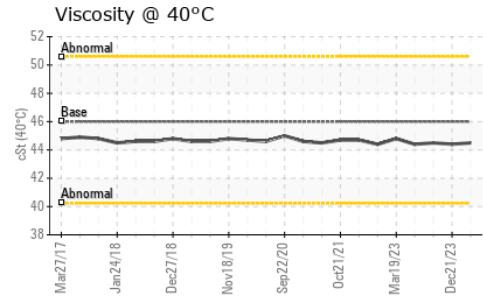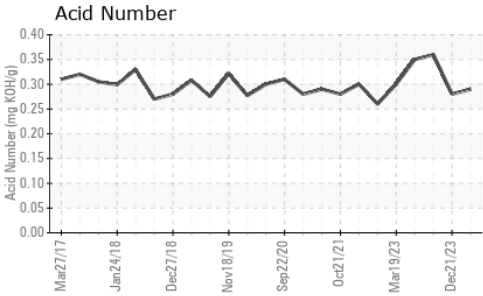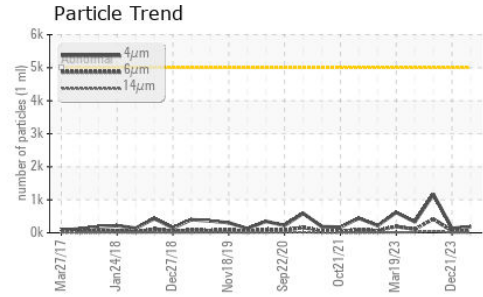


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.29</b>	0.28	0.36





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46.0	<b>44.5</b>	44.4	44.5

### SAMPLE IMAGES

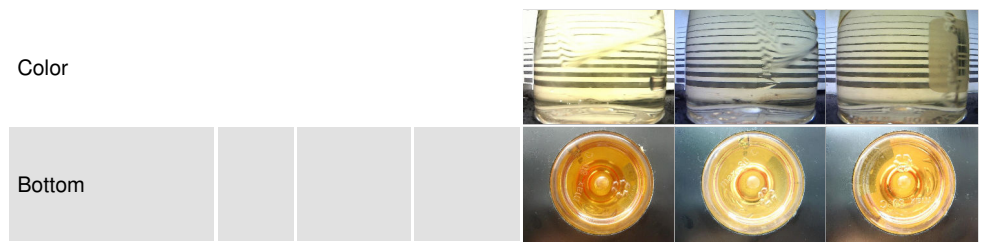

### GRAPHS

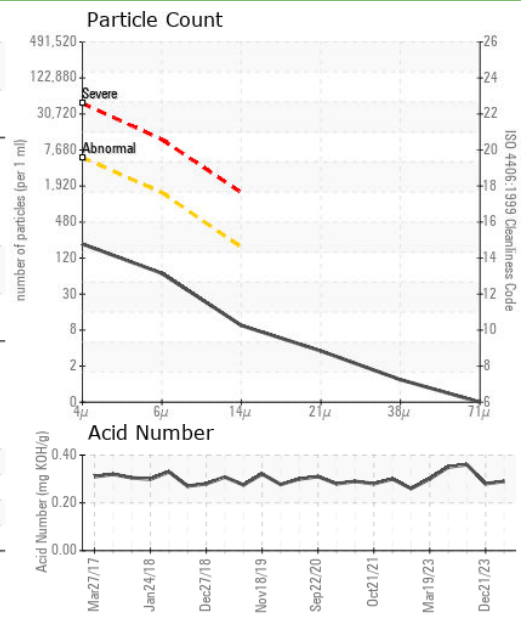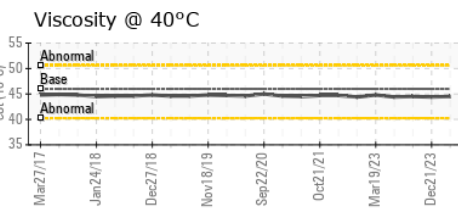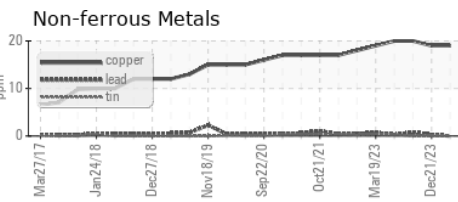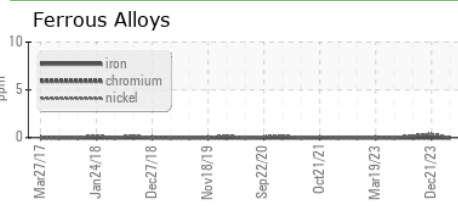

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0843679  
**Lab Number** : 02626428  
**Unique Number** : 5759560  
**Test Package** : IND 2

**Received** : 03 Apr 2024  
**Tested** : 04 Apr 2024  
**Diagnosed** : 04 Apr 2024 - Wes Davis

**Long Lake Hydro Inc. (Regional Power)**  
 1104 Railway St.  
 Stewart, BC  
 CA V0T 1W0  
 Contact: Jonathan Zappitelli  
 jzappitelli@cclinfrastucture.com  
 T: (778)794-0385  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.