




# OIL ANALYSIS REPORT

Sample Rating Trend

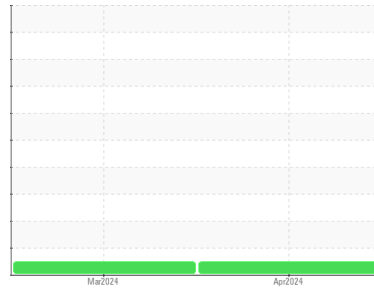

**NORMAL**



Area

**Red oil Room/Rig 1**

Machine Id

**DEC 3933**

Component

**Hydraulic System**

Fluid

**LANXESS ROYCO 756 (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.  
NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0926852</b>	WC0920417	---
Sample Date	Client Info			<b>03 Apr 2024</b>	12 Mar 2024	---
Machine Age	hrs	Client Info		<b>0</b>	0	---
Oil Age	hrs	Client Info		<b>0</b>	0	---
Oil Changed	Client Info			<b>N/A</b>	N/A	---
Sample Status				<b>NORMAL</b>	NORMAL	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	---
Aluminum	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	---
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Copper	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	---
Barium	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	<1	---
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	---
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	---
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	<1	---
Calcium	ppm	ASTM D5185(m)		<b>2</b>	2	---
Phosphorus	ppm	ASTM D5185(m)		<b>711</b>	926	---
Zinc	ppm	ASTM D5185(m)		<b>2</b>	2	---
Sulfur	ppm	ASTM D5185(m)		<b>41</b>	34	---
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	---
Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	1	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>538</b>	1581	---
Particles >6µm		ASTM D7647	>1300	<b>161</b>	392	---
Particles >14µm		ASTM D7647	>160	<b>22</b>	23	---
Particles >21µm		ASTM D7647	>40	<b>7</b>	6	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	0	---
Particles >71µm		ASTM D7647	>3	<b>1</b>	0	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/15/12</b>	18/16/12	---



# OIL ANALYSIS REPORT

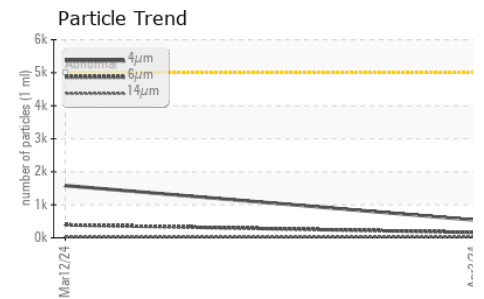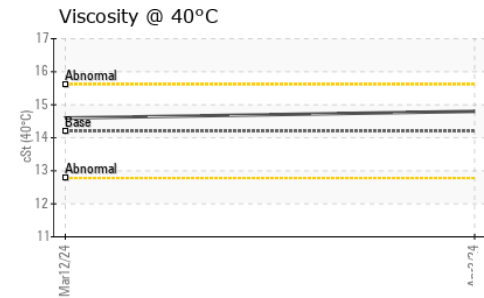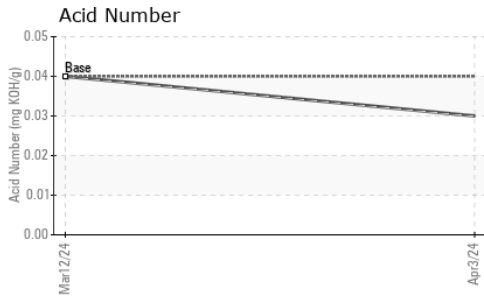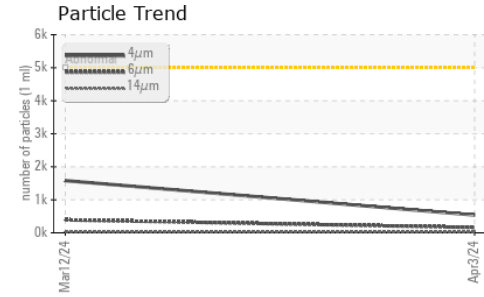


FLUID DEGRADATION	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.04	<b>0.03</b>	0.04	---






VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	---
Free Water	scalar	Visual*		<b>NEG</b>	NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	14.2	<b>14.8</b>	14.6	---

## SAMPLE IMAGES

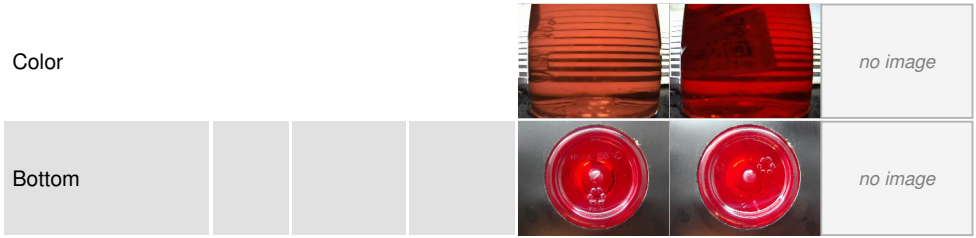

## GRAPHS

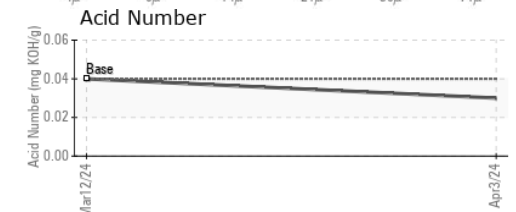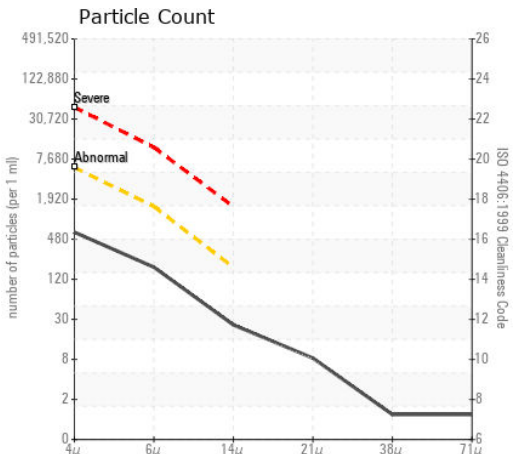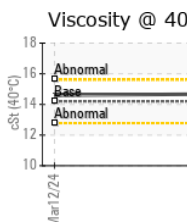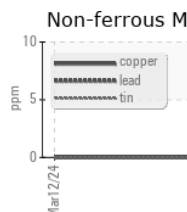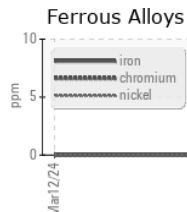

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0926852  
**Lab Number** : 02626605  
**Unique Number** : 5759737  
**Test Package** : IND 2  
**Received** : 04 Apr 2024  
**Tested** : 05 Apr 2024  
**Diagnosed** : 05 Apr 2024 - Wes Davis

**Safran Landing Systems**  
 574 Monarch Ave  
 Ajax, ON  
 CA L1S 2G8  
 Contact: Stuart Potter  
 stuart.potter@safrangroup.com  
 T:  
 F: (905)683-6983

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.